

PROBLEM SUMMARY

Sample Rating Trend

WEAR




Machine Id **50499516 (S/N R-02630R)**

Hydraulic System

MOBIL DTE 24 (--- GAL)

COMPONENT CONDITION SUMMARY

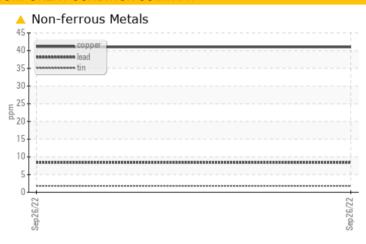

RECOMMENDATION

No corrective action is recommended at this time. Resample at the next service interval to monitor.

PROBLEMATIC TEST RESULTS									
Sample Status				ABNORMAL					
Copper	ppm	ASTM D5185m	>20	4 1					

Customer Id: TECGRENC Sample No.: WC0731078 Lab Number: 05651458 Test Package: PLANT To manage this report scan the QR code To discuss the diagnosis or test data: Angela Borella +1 800-237-1369 angela.borella@wearcheckusa.com To change component or sample information:

Customer Service +1 1-800-237-1369 customerservice@wearcheck.com


RECOMMENDED ACTIONS

There are no recommended actions for this sample.

HISTORICAL DIAGNOSIS



OIL ANALYSIS REPORT

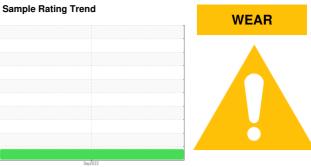

50499516 (S/N R-02630R)

Hydraulic System

MOBIL DTE 24 (--- GAL)

DIAGNOSIS

Recommendation

No corrective action is recommended at this time. Resample at the next service interval to monitor.

The copper level is abnormal. All other component wear rates are normal.

Contamination

The amount and size of particulates present in the system are acceptable.

Fluid Condition

The AN level is acceptable for this fluid. The condition of the oil is acceptable for the time in service.

				Sep2022		
SAMPLE INFORM	MATION	method	limit/base	current	history1	history2
Sample Number		Client Info		WC0731078		
Sample Date		Client Info		26 Sep 2022		
Machine Age	hrs	Client Info		0		
Oil Age	hrs	Client Info		0		
Oil Changed		Client Info		N/A		
Sample Status				ABNORMAL		
WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>20	5		
Chromium	ppm	ASTM D5185m	>20	0		
Nickel	ppm	ASTM D5185m	>20	0		
Titanium	ppm	ASTM D5185m		0		
Silver	ppm	ASTM D5185m		0		
Aluminum	ppm	ASTM D5185m	>20	<1		
Lead	ppm	ASTM D5185m	>20	8		
Copper	ppm	ASTM D5185m	>20	<u></u> 41		
Tin	ppm	ASTM D5185m	>20	2		
Vanadium	ppm	ASTM D5185m		0		
Cadmium	ppm	ASTM D5185m		0		
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m		0		
Barium	ppm	ASTM D5185m		2		
Molybdenum	ppm	ASTM D5185m		<1		
Manganese	ppm	ASTM D5185m		<1		
Magnesium	ppm	ASTM D5185m		7		
Calcium	ppm	ASTM D5185m		64		
Phosphorus	ppm	ASTM D5185m		329		
Zinc	ppm	ASTM D5185m		512		
Sulfur	ppm	ASTM D5185m		1200		
CONTAMINANTS	5	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>15	2		
Sodium	ppm	ASTM D5185m		0		
Potassium	ppm	ASTM D5185m	>20	1		
FLUID CLEANLIN	IESS	method	limit/base	current	history1	history2
Particles >4µm		ASTM D7647	>5000	1662		
Particles >6µm		ASTM D7647	>1300	324		
Particles >14µm		ASTM D7647	>160	13		
Particles >21µm		ASTM D7647	>40	2		
Particles >38µm		ASTM D7647	>10	0		
Particles >71µm		ASTM D7647	>3	0		
Oil Cleanliness		ISO 4406 (c)	>19/17/14	18/16/11		
FLUID DEGRADA	ATION	method	limit/base	current	history1	history2

Acid Number (AN) mg KOH/g ASTM D8045

0.43



OIL ANALYSIS REPORT







Certificate L2367

Sample No. Lab Number Unique Number

: WC0731078 : 05651458 : 10151010 Test Package : PLANT

Received : 27 Sep 2022 : 28 Sep 2022 Diagnosed Diagnostician

: Angela Borella

To discuss this sample report, contact Customer Service at 1-800-237-1369.

* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

US 27409

T:

F:

GREENSBORO, NC

billie.wallace@te.com

Contact: BILLIE WALLACE