

PROBLEM SUMMARY

Sample Rating Trend

WATER


KAESER 8075246

Component

Compressor

KAESER SIGMA (OEM) S-460 (--- GAL)

COMPONENT CONDITION SUMMARY

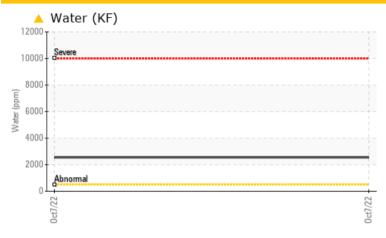

RECOMMENDATION

The filter change at the time of sampling has been noted. We advise that you stop the unit and follow the water drain-off procedure for this component. We recommend an early resample in 500 hours to monitor this condition.

PROBLEMATIC TEST RESULTS											
Sample Status				ABNORMAL							
Water	%	ASTM D6304	>0.05	△ 0.255							
nnm Water	nnm	ASTM D6304	>500	A 2550							

Customer Id: REIGIB Sample No.: KC106516 Lab Number: 05675086 Test Package: IND 2

To manage this report scan the QR code

To discuss the diagnosis or test data: Doug Bogart +1 (800)237-1369 x4016 dougb@wearcheckusa.com

To change component or sample information: Customer Service +1 1-800-237-1369 customerservice@wearcheck.com

RECOMMENDED ACTIONS

There are no recommended actions for this sample.

HISTORICAL DIAGNOSIS



OIL ANALYSIS REPORT

Sample Rating Trend

WATER



KAESER 8075246

Component

Compressor

KAESER SIGMA (OEM) S-460 (--- GAL)

DIAGNOSIS

Recommendation

The filter change at the time of sampling has been noted. We advise that you stop the unit and follow the water drain-off procedure for this component. We recommend an early resample in 500 hours to monitor this condition.

Wear

All component wear rates are normal.

Contamination

There is a light concentration of water present in the oil. The amount and size of particulates present in the system are acceptable.


Fluid Condition

The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

				Oct2022		
SAMPLE INFORM	MATION	method	limit/base	current	history1	history2
Sample Number		Client Info		KC106516		
Sample Date		Client Info		07 Oct 2022		
Machine Age	hrs	Client Info		3191		
Oil Age	hrs	Client Info		1115		
Oil Changed		Client Info		Not Changd		
Sample Status				ABNORMAL		
WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>50	0		
Chromium	ppm	ASTM D5185m	>10	0		
Nickel	ppm	ASTM D5185m	>3	0		
Titanium	ppm	ASTM D5185m	>3	0		
Silver	ppm	ASTM D5185m	>2	0		
Aluminum	ppm	ASTM D5185m	>10	3		
Lead	ppm	ASTM D5185m	>10	<1		
Copper	ppm	ASTM D5185m	>50	5		
Tin	ppm	ASTM D5185m	>10	0		
Vanadium	ppm	ASTM D5185m		<1		
Cadmium	ppm	ASTM D5185m		0		
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m		0		
Barium	ppm	ASTM D5185m	90	0		
Molybdenum	ppm	ASTM D5185m		0		
Manganese	ppm	ASTM D5185m		<1		
Magnesium	ppm	ASTM D5185m	90	24		
Calcium	ppm	ASTM D5185m	2	0		
Phosphorus	ppm	ASTM D5185m		16		
Zinc	ppm	ASTM D5185m		34		
CONTAMINANTS		method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>25	<1		
Sodium	ppm	ASTM D5185m		8		
Potassium	ppm	ASTM D5185m	>20	7		
Water	%	ASTM D6304	>0.05	△ 0.255		
ppm Water	ppm	ASTM D6304	>500	2550		
FLUID CLEANLIN	IESS	method	limit/base	current	history1	history2
Particles >4μm		ASTM D7647		11334		
Particles >6µm		ASTM D7647	>1300	895		
Particles >14μm		ASTM D7647	>80	15		
Particles >21μm		ASTM D7647	>20	5		
Particles >38μm		ASTM D7647	>4	1		
Particles >71μm		ASTM D7647	>3	0		
Oil Cleanliness		ISO 4406 (c)	>/17/13	21/17/11		
FLUID DEGRADA	TION	method	limit/base	current	history1	history2
Acid Number (AN)	mg KOH/g	ASTM D8045	0.4	0.37		



OIL ANALYSIS REPORT

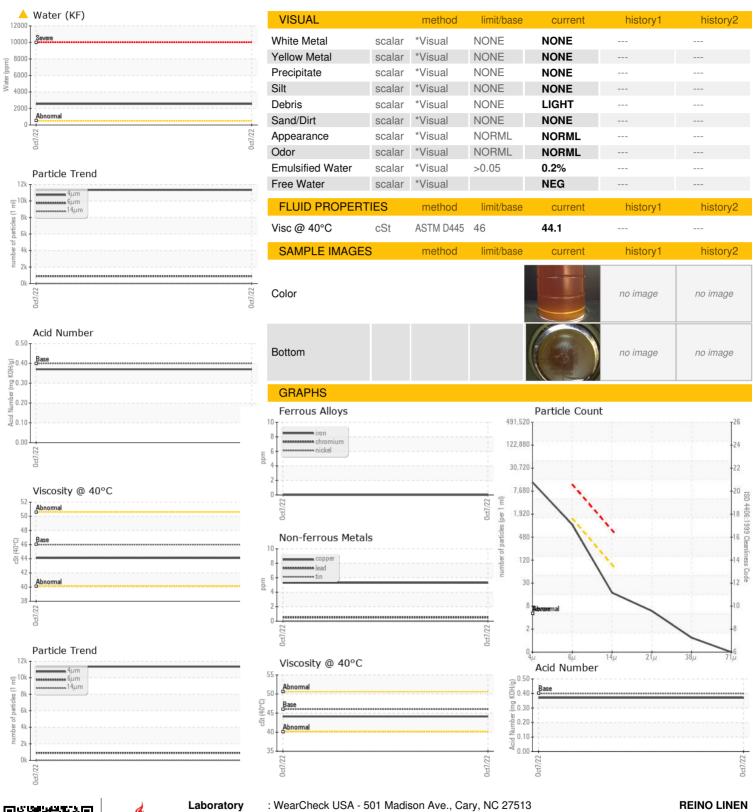





Certificate L2367

Sample No. Lab Number **Unique Number** Test Package

: KC106516 : 05675086

: 10189657 : IND 2

Received : 24 Oct 2022 Diagnosed Diagnostician

: 29 Oct 2022 : Doug Bogart

119 S MAIN ST GIBSONBURG, OH US 43431

Contact: Service Manager JOBERHAUS@REINOLINEN.COM T:

To discuss this sample report, contact Customer Service at 1-800-237-1369. * - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

F: