

[73293923]

PROBLEM SUMMARY


KAESER CS-121 1168075 (S/N 1026)
Component

Compressor

KAESER SIGMA (OEM) M-460 (--- GAL)

Sample Rating Trend ISO Api2023

COMPONENT CONDITION SUMMARY

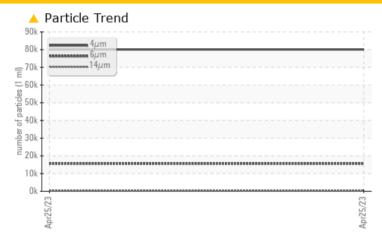

RECOMMENDATION

Oil and filter change at the time of sampling has been noted. Resample at the next service interval to monitor.

PROBLEMATIC TEST RESULTS									
Sample Status			ABNORMAL						
Particles >6µm	ASTM D7647	>1300	15619						
Particles >14μm	ASTM D7647	>80	421						
Particles >21µm	ASTM D7647	>20	<u>^</u> 96						
Particles >38µm	ASTM D7647	>4	<u> </u>						
Oil Cleanliness	ISO 4406 (c)	>/17/13	24/21/16						

Customer Id: COBSAN Sample No.: KCP53839 Lab Number: 05832732 Test Package: IND 2

To manage this report scan the QR code

To discuss the diagnosis or test data: Jonathan Hester +1 919-379-4092 x4092 jhester@wearcheckusa.com

To change component or sample information: Customer Service +1 1-800-237-1369 customerservice@wearcheck.com

RECOMMENDED ACTIONS						
Action	Status	Date	Done By	Description		
Change Fluid			?	Oil and filter change at the time of sampling has been noted.		
Change Filter			?	Oil and filter change at the time of sampling has been noted.		

HISTORICAL DIAGNOSIS




OIL ANALYSIS REPORT

[73293923]

KAESER CS-121 1168075 (S/N 1026)

Compressor

KAESER SIGMA (OEM) M-460 (--- GAL)

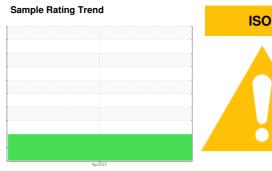

DIAGNOSIS

Recommendation

Oil and filter change at the time of sampling has been noted. Resample at the next service interval to monitor.

All component wear rates are normal.

Contamination

There is a high amount of particulates present in the oil.


Fluid Condition

The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

				Apr2023		
SAMPLE INFORM	MATION	method	limit/base	current	history1	history2
Sample Number		Client Info		KCP53839		
Sample Date		Client Info		25 Apr 2023		
Machine Age	hrs	Client Info		79886		
Oil Age	hrs	Client Info		5		
Oil Changed		Client Info		Changed		
Sample Status				ABNORMAL		
WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>50	2		
Chromium	ppm	ASTM D5185m	>10	0		
Nickel	ppm	ASTM D5185m	>3	0		
Titanium	ppm	ASTM D5185m	>3	0		
Silver	ppm	ASTM D5185m	>2	0		
Aluminum	ppm	ASTM D5185m	>10	1		
Lead	ppm	ASTM D5185m	>10	0		
Copper	ppm	ASTM D5185m	>50	1		
Tin	ppm	ASTM D5185m	>10	0		
Vanadium	ppm	ASTM D5185m		0		
Cadmium	ppm	ASTM D5185m		0		
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m	0	0		
Barium	ppm	ASTM D5185m	90	19		
Molybdenum	ppm	ASTM D5185m	0	0		
Manganese	ppm	ASTM D5185m		<1		
Magnesium	ppm	ASTM D5185m	100	55		
Calcium	ppm	ASTM D5185m	0	0		
Phosphorus	ppm	ASTM D5185m	0	0		
Zinc	ppm	ASTM D5185m	0	2		
Sulfur	ppm	ASTM D5185m	23500	23105		
CONTAMINANTS	3	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>25	0		
Sodium	ppm	ASTM D5185m		11		
Potassium	ppm	ASTM D5185m	>20	0		
Water	%	ASTM D6304	>0.05	0.021		
ppm Water	ppm	ASTM D6304	>500	217.2		
FLUID CLEANLIN	NESS	method	limit/base	current	history1	history2
Particles >4μm		ASTM D7647		80095		
Particles >6μm		ASTM D7647	>1300	<u> </u>		
Particles >14μm		ASTM D7647	>80	<u>421</u>		
Particles >21µm		ASTM D7647	>20	<u>^</u> 96		
Particles >38µm		ASTM D7647	>4	<u> </u>		
Particles >71μm		ASTM D7647	>3	1		
Oil Cleanliness		ISO 4406 (c)	>/17/13	<u>4</u> 24/21/16		
FLUID DEGRADA	NOITA	method	limit/base	current	history1	history2
Acid Number (AN)	mg KOH/g	ASTM D8045	1.0	0.43		



OIL ANALYSIS REPORT

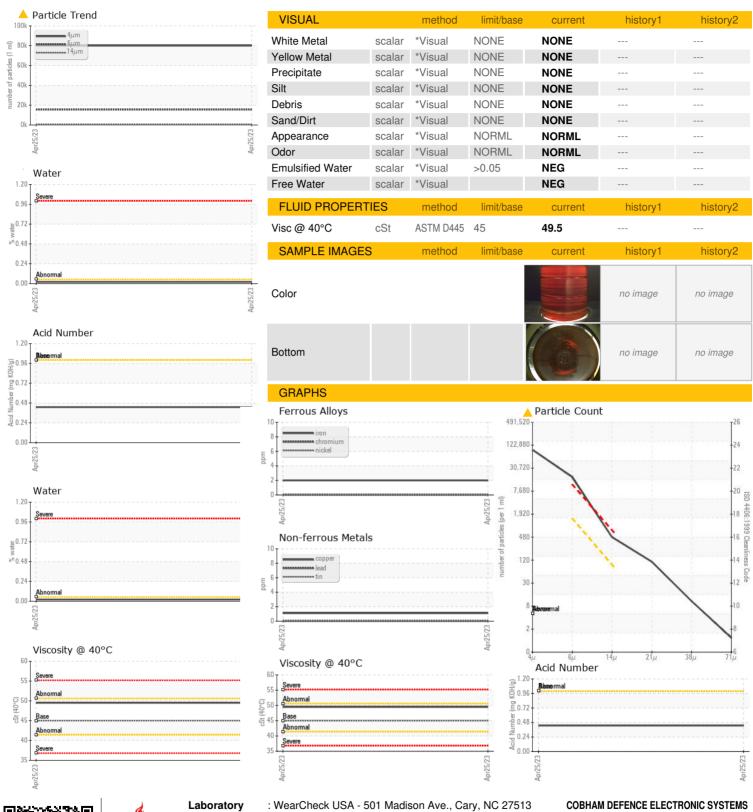



Sample No. Lab Number **Unique Number**

: KCP53839 : 05832732 : 10446225

Received Diagnosed

: 28 Apr 2023 : 03 May 2023

Diagnostician : Jonathan Hester

Test Package : IND 2 (Additional Tests: KF, PrtCount) Certificate L2367 To discuss this sample report, contact Customer Service at 1-800-237-1369.

* - Denotes test methods that are outside of the ISO 17025 scope of accreditation. Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

5300 HELLYER AVE. SAN JOSE, CA US 95138

Contact: FRANK SCHWEININGER

frank.schweininger@caes.com

T:

Contact/Location: FRANK SCHWEININGER - COBSAN

F: