




PROBLEM SUMMARY

Area
[1718910]
 Machine Id
Fristam
 Component
Bearing
 Fluid
MOBIL SHC 626 (--- GAL)

Sample Rating Trend

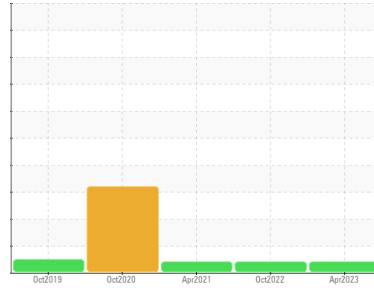


VISCOSITY



COMPONENT CONDITION SUMMARY

▲ Viscosity @ 40°C

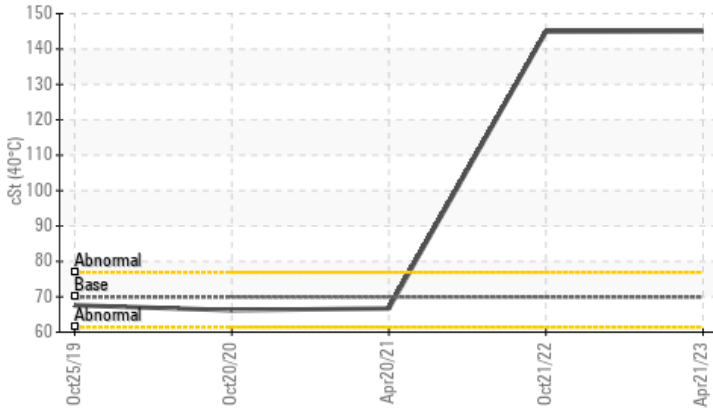

RECOMMENDATION

No corrective action is recommended at this time.
 Resample at the next service interval to monitor.

PROBLEMATIC TEST RESULTS

Sample Status				ATTENTION	ATTENTION	ABNORMAL
Visc @ 40°C	cSt	ASTM D445	69.9	▲ 145	▲ 144.9	66.7

Customer Id: LEPCRE
 Sample No.: WC0805907
 Lab Number: 05833339
 Test Package: IND 1



To manage this report scan the QR code

To discuss the diagnosis or test data:
 Jonathan Hester +1 919-379-4092 x4092
jhester@wearcheckusa.com

To change component or sample information:
 Customer Service +1 1-800-237-1369
customerservice@wearcheck.com

RECOMMENDED ACTIONS

There are no recommended actions for this sample.

HISTORICAL DIAGNOSIS

21 Oct 2022 Diag: Don Baldrige

VISCOSITY



Resample at the next service interval to monitor. All component wear rates are normal. There is no indication of any contamination in the oil. The oil viscosity is higher than normal. Confirm oil type.

view report



20 Apr 2021 Diag: Jonathan Hester

VIS DEBRIS



We suspect abnormal contamination may be due to sampling method. No corrective action is recommended at this time. Resample at the next service interval to monitor. All component wear rates are normal. Moderate concentration of visible dirt/debris present in the oil. The condition of the oil is acceptable for the time in service.

view report



20 Oct 2020 Diag:

DIRT



Oil and filter change at the time of sampling has been noted. Resample at the next service interval to monitor. Moderate concentration of visible metal present. All component wear rates are normal. Elemental level of silicon (Si) above normal indicating ingress of seal material. Moderate concentration of visible dirt/debris present in the oil. The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.


view report





OIL ANALYSIS REPORT

Sample Rating Trend

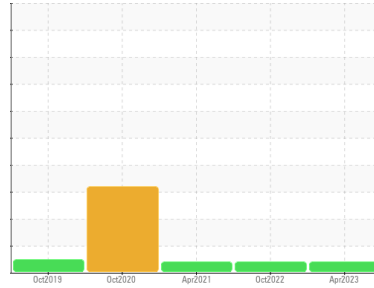

VISCOSITY



Area
[1718910]
 Machine Id
Fristam
 Component
Bearing
 Fluid
MOBIL SHC 626 (--- GAL)

DIAGNOSIS

Recommendation

No corrective action is recommended at this time. Resample at the next service interval to monitor.

Wear

All component wear rates are normal.

Contamination

There is no indication of any contamination in the oil.

Fluid Condition

The oil viscosity is higher than normal. Confirm oil type.

SAMPLE INFORMATION

	method	limit/base	current	history1	history2
Sample Number	Client Info		WC0805907	WC0747465	WC0571025
Sample Date	Client Info		21 Apr 2023	21 Oct 2022	20 Apr 2021
Machine Age	hrs	Client Info	0	0	0
Oil Age	hrs	Client Info	0	0	0
Oil Changed	Client Info		N/A	N/A	N/A
Sample Status			ATTENTION	ATTENTION	ABNORMAL

WEAR METALS

	method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m >20	8	12	9
Chromium	ppm	ASTM D5185m >20	0	0	<1
Nickel	ppm	ASTM D5185m >20	0	<1	0
Titanium	ppm	ASTM D5185m	0	0	0
Silver	ppm	ASTM D5185m	0	0	0
Aluminum	ppm	ASTM D5185m >20	0	<1	0
Lead	ppm	ASTM D5185m >20	0	<1	<1
Copper	ppm	ASTM D5185m >20	0	<1	1
Tin	ppm	ASTM D5185m >20	0	<1	0
Antimony	ppm	ASTM D5185m	---	---	0
Vanadium	ppm	ASTM D5185m	0	0	0
Cadmium	ppm	ASTM D5185m	0	0	0

ADDITIVES

	method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m	0	0	<1
Barium	ppm	ASTM D5185m	0	0	0
Molybdenum	ppm	ASTM D5185m	0	0	0
Manganese	ppm	ASTM D5185m	<1	<1	<1
Magnesium	ppm	ASTM D5185m	<1	0	0
Calcium	ppm	ASTM D5185m	0	<1	0
Phosphorus	ppm	ASTM D5185m	435	484	418
Zinc	ppm	ASTM D5185m	2	5	0
Sulfur	ppm	ASTM D5185m	6	23	0

CONTAMINANTS


	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m >15	5	7	12
Sodium	ppm	ASTM D5185m	<1	<1	0
Potassium	ppm	ASTM D5185m >20	0	<1	0

VISUAL

	method	limit/base	current	history1	history2
White Metal	scalar	*Visual NONE	NONE	NONE	NONE
Yellow Metal	scalar	*Visual NONE	NONE	NONE	NONE
Precipitate	scalar	*Visual NONE	NONE	NONE	NONE
Silt	scalar	*Visual NONE	NONE	NONE	NONE
Debris	scalar	*Visual NONE	NONE	NONE	▲ MODER
Sand/Dirt	scalar	*Visual NONE	NONE	NONE	NONE
Appearance	scalar	*Visual NORML	NORML	NORML	NORML
Odor	scalar	*Visual NORML	NORML	NORML	NORML
Emulsified Water	scalar	*Visual >2	NEG	NEG	NEG
Free Water	scalar	*Visual	NEG	NEG	NEG




OIL ANALYSIS REPORT



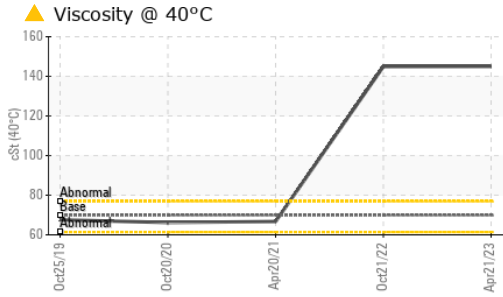


FLUID PROPERTIES	method	limit/base	current	history1	history2
Visc @ 40°C	cSt	ASTM D445	69.9 ▲ 145	▲ 144.9	66.7

SAMPLE IMAGES	method	limit/base	current	history1	history2
---------------	--------	------------	---------	----------	----------

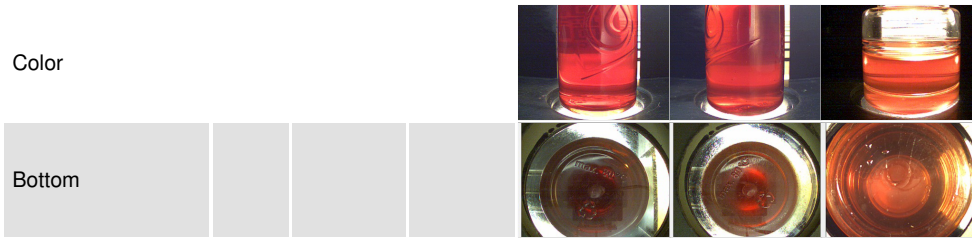

GRAPHS

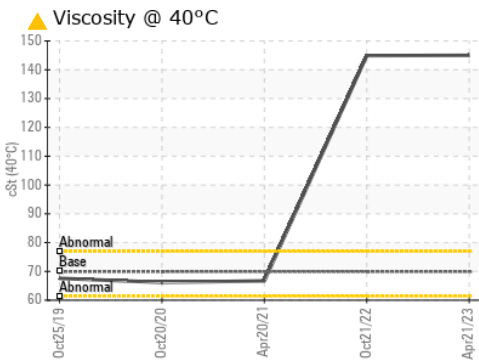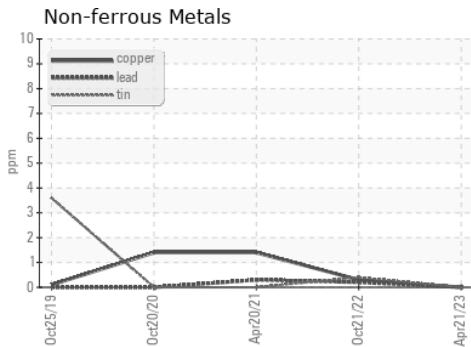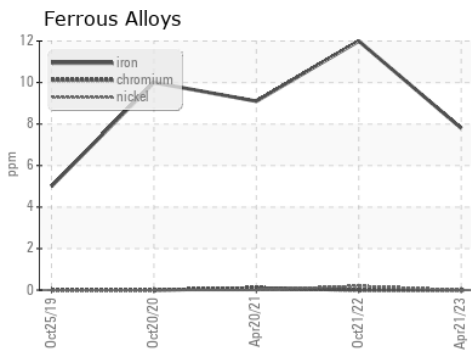

Certificate L2367

Laboratory : WearCheck USA - 501 Madison Ave., Cary, NC 27513
Sample No. : WC0805907 **Received** : 28 Apr 2023
Lab Number : 05833339 **Diagnosed** : 02 May 2023
Unique Number : 10446832 **Diagnostician** : Jonathan Hester
Test Package : IND 1

LEPRINO FOODS-GREELEY
 1302 1ST AVE
 GREELEY, CO
 US 80631-5909
 Contact: ERIC KLINE
 EKLIN@LEPRINOFODS.COM
 T:
 F: (970)347-5190

To discuss this sample report, contact Customer Service at 1-800-237-1369.

* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)