


PROBLEM SUMMARY

Sample Rating Trend




VISCOSITY

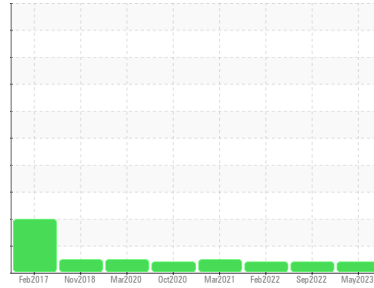

Area
MELT SHOP - SGP
Machine Id
NORTHSIDE GRINDER SOUTH GEARBOX (S/N 15-4000-0820)
Component
Gearbox
Fluid
EP 320 (--- QTS)

COMPONENT CONDITION SUMMARY

▲ Viscosity @ 40°C

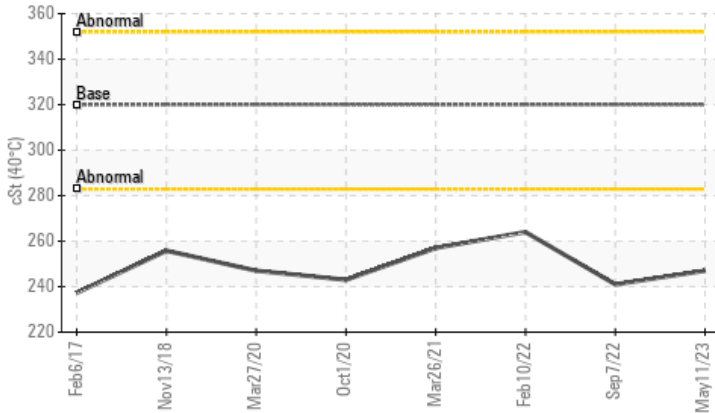

RECOMMENDATION

Resample at the next service interval to monitor.

PROBLEMATIC TEST RESULTS

Sample Status				ATTENTION	ATTENTION	ATTENTION
Visc @ 40°C	cSt	ASTM D445	320	▲ 247	▲ 241	▲ 264

Customer Id: OUTCALAL
Sample No.: RP0035100
Lab Number: 05846331
Test Package: IND 2



To manage this report scan the QR code

To discuss the diagnosis or test data:
Don Baldrige +1
don.b505@comcast.net

To change component or sample information:
Customer Service +1 1-800-237-1369
customerservice@wearcheck.com

RECOMMENDED ACTIONS

There are no recommended actions for this sample.

HISTORICAL DIAGNOSIS

07 Sep 2022 Diag: Doug Bogart

VISCOSITY



Resample at the next service interval to monitor. All component wear rates are normal. There is no indication of any contamination in the oil. Viscosity of sample indicates oil is within ISO 220 range, advise investigate. Confirm oil type. The AN level is acceptable for this fluid.

view report



10 Feb 2022 Diag: Angela Borella

VISCOSITY



Resample at the next service interval to monitor. All component wear rates are normal. There is no indication of any contamination in the oil. Viscosity of sample indicates oil is within ISO 220 range, advise investigate. Confirm oil type. The AN level is acceptable for this fluid.

view report



26 Mar 2021 Diag: Wes Davis

NORMAL



Little or no information is provided as to the component and lubricant being tested. Recommendations are therefore generic in nature and may not apply to the current application. Please forward information as to equipment type, reservoir capacity, lubricant type and any pertinent information to allow for a more accurate assessment. Resample at the next service interval to monitor. NOTE: Please provide information regarding reservoir capacity, filter type and micron rating with next sample. Please specify the brand, type, and viscosity of the oil on your next sample. All component wear rates are normal. The water content is negligible. There is no indication of any contamination in the oil. The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.


view report





OIL ANALYSIS REPORT

Sample Rating Trend

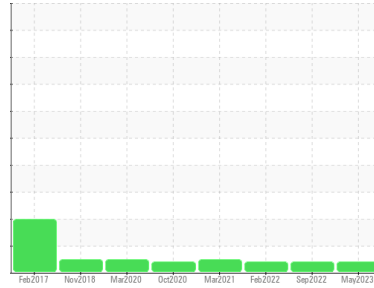

VISCOSITY



Area
MELT SHOP - SGP
 Machine Id
NORTHSIDE GRINDER SOUTH GEARBOX (S/N 15-4000-0820)
 Component
Gearbox
 Fluid
EP 320 (--- QTS)

DIAGNOSIS

▲ Recommendation

Resample at the next service interval to monitor.

Wear

All component wear rates are normal.

Contamination

There is no indication of any contamination in the oil.

▲ Fluid Condition

Viscosity of sample indicates oil is within ISO 220 range, advise investigate. Confirm oil type. The AN level is acceptable for this fluid.

SAMPLE INFORMATION

	method	limit/base	current	history1	history2
Sample Number	Client Info		RP0035100	RP0029741	RP0022624
Sample Date	Client Info		11 May 2023	07 Sep 2022	10 Feb 2022
Machine Age	hrs	Client Info	0	0	0
Oil Age	hrs	Client Info	0	0	0
Oil Changed	Client Info		N/A	N/A	N/A
Sample Status			ATTENTION	ATTENTION	ATTENTION

WEAR METALS

	method	limit/base	current	history1	history2
PQ	ASTM D8184		147	76	110
Iron	ppm	ASTM D5185m >200	127	119	140
Chromium	ppm	ASTM D5185m >15	1	<1	1
Nickel	ppm	ASTM D5185m >15	<1	0	<1
Titanium	ppm	ASTM D5185m	0	0	<1
Silver	ppm	ASTM D5185m	0	0	0
Aluminum	ppm	ASTM D5185m >25	2	<1	1
Lead	ppm	ASTM D5185m >100	0	0	0
Copper	ppm	ASTM D5185m >200	0	0	<1
Tin	ppm	ASTM D5185m >25	<1	0	<1
Antimony	ppm	ASTM D5185m >5	---	---	<1
Vanadium	ppm	ASTM D5185m	0	0	0
Cadmium	ppm	ASTM D5185m	0	0	0

ADDITIVES

	method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m	0	0	1
Barium	ppm	ASTM D5185m	0	0	1
Molybdenum	ppm	ASTM D5185m	0	0	0
Manganese	ppm	ASTM D5185m	2	1	2
Magnesium	ppm	ASTM D5185m	0	0	<1
Calcium	ppm	ASTM D5185m	110	106	132
Phosphorus	ppm	ASTM D5185m	264	250	267
Zinc	ppm	ASTM D5185m	31	63	63





CONTAMINANTS

	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m >50	3	3	4
Sodium	ppm	ASTM D5185m	6	5	<1
Potassium	ppm	ASTM D5185m >20	1	0	0
Water	%	ASTM D6304 >0.2	0.003	0.006	0.005
ppm Water	ppm	ASTM D6304 >2000	38.9	68.4	51.1

FLUID DEGRADATION

	method	limit/base	current	history1	history2
Acid Number (AN)	mg KOH/g	ASTM D8045	0.13	0.17	0.14


OIL ANALYSIS REPORT

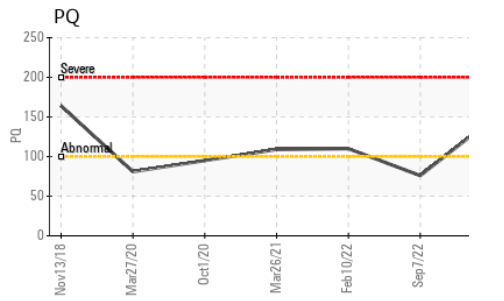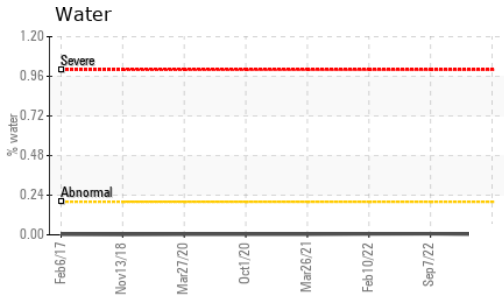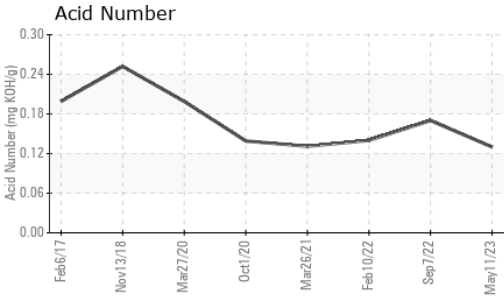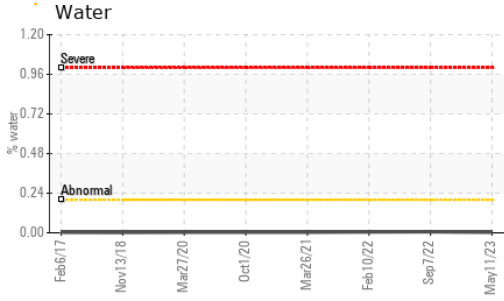






VISUAL	method	limit/base	current	history1	history2
White Metal	scalar	*Visual	NONE	NONE	NONE
Yellow Metal	scalar	*Visual	NONE	NONE	NONE
Precipitate	scalar	*Visual	NONE	NONE	NONE
Silt	scalar	*Visual	NONE	NONE	NONE
Debris	scalar	*Visual	NONE	NONE	NONE
Sand/Dirt	scalar	*Visual	NONE	NONE	NONE
Appearance	scalar	*Visual	NORML	NORML	NORML
Odor	scalar	*Visual	NORML	NORML	NORML
Emulsified Water	scalar	*Visual	>0.2	NEG	NEG
Free Water	scalar	*Visual		NEG	NEG

FLUID PROPERTIES	method	limit/base	current	history1	history2
Visc @ 40°C	cSt	ASTM D445	320 ▲ 247	▲ 241	▲ 264

SAMPLE IMAGES	method	limit/base	current	history1	history2
---------------	--------	------------	---------	----------	----------

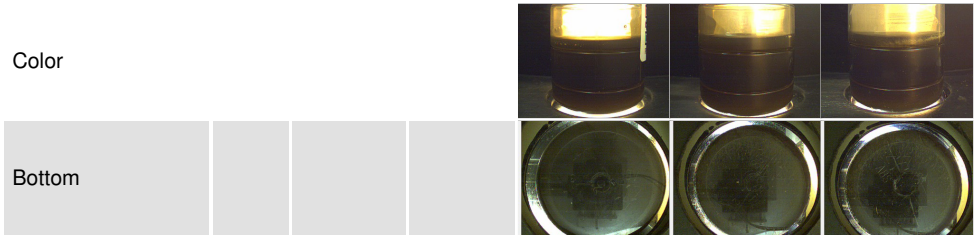

GRAPHS

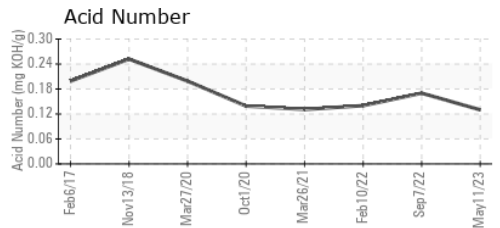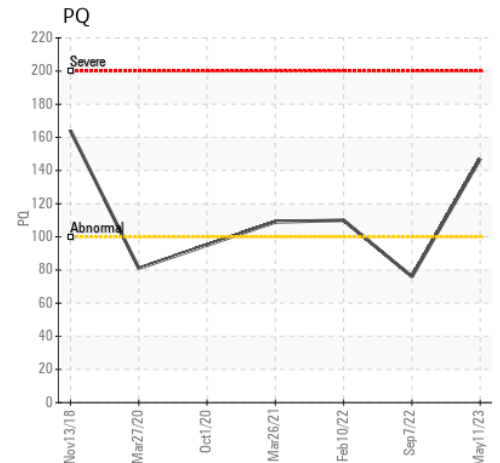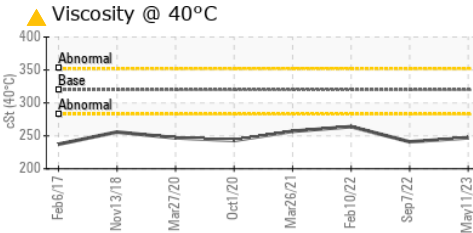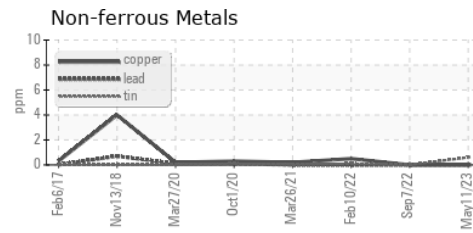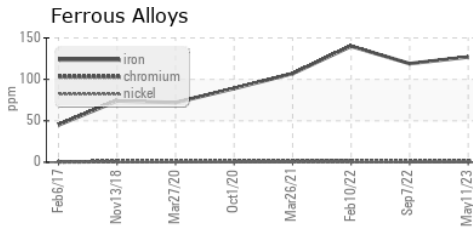

Certificate L2367

Laboratory : WearCheck USA - 501 Madison Ave., Cary, NC 27513
Sample No. : RP0035100 **Received** : 12 May 2023
Lab Number : 05846331 **Diagnosed** : 16 May 2023
Unique Number : 10470438 **Diagnostician** : Don Baldrige
Test Package : IND 2 (Additional Tests: PQ)

To discuss this sample report, contact Customer Service at 1-800-237-1369.

* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

OUTOKUMPU STAINLESS USA
 HWY 43 N
 CALVERT, AL
 US 36513
 Contact: MARIO JOHNSON
 Mario.johnson@outokumpu.com
 T: (251)321-4105
 F: x: