

PROBLEM SUMMARY

Sample Rating Trend


ISO

KAESER CSD 125 6048902 - SCHUETZ (S/N 1210)

Compressor

NOT GIVEN (--- QTS)

COMPONENT CONDITION SUMMARY

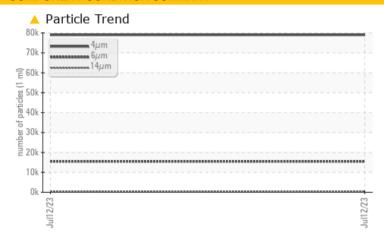

RECOMMENDATION

No corrective action is recommended at this time. The filter change at the time of sampling has been noted. Resample at the next service interval to monitor.

PROBLEMATIC TEST RESULTS									
Sample Status			ABNORMAL						
Particles >6µm	ASTM D7647	>1300	15467						
Particles >14µm	ASTM D7647	>80	473						
Particles >21µm	ASTM D7647	>20	<u> </u>						
Particles >38μm	ASTM D7647	>4	14						
Oil Cleanliness	ISO 4406 (c)	>/17/13	<u>^</u> 23/21/16						

Customer Id: KAEFRE Sample No.: KCPA002206 Lab Number: 05902333 Test Package: IND 2



To manage this report scan the QR code

To discuss the diagnosis or test data: Doug Bogart +1 (800)237-1369 x4016 dougb@wearcheckusa.com

To change component or sample information: Customer Service +1 1-800-237-1369 customerservice@wearcheck.com

RECOMMENDED ACTIONS

There are no recommended actions for this sample.

HISTORICAL DIAGNOSIS



OIL ANALYSIS REPORT

Sample Rating Trend

ISO

Machine Id

KAESER CSD 125 6048902 - SCHUETZ (S/N 1210)

Component

Compressor

NOT GIVEN (--- QTS)

DIAGNOSIS

Recommendation

No corrective action is recommended at this time. The filter change at the time of sampling has been noted. Resample at the next service interval to monitor.

Wear

All component wear rates are normal.

▲ Contamination

There is a high amount of particulates present in the oil.

Fluid Condition

The AN level is acceptable for this fluid. The condition of the oil is acceptable for the time in service.

						, in the second second
				Jul2023		
SAMPLE INFORM	MATION	method	limit/base	current	history1	history2
Sample Number		Client Info		KCPA002206		
Sample Date		Client Info		12 Jul 2023		
Machine Age	hrs	Client Info		0		
Oil Age	hrs	Client Info		0		
Oil Changed	1110	Client Info		N/A		
Sample Status				ABNORMAL		
WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>50	18		
Chromium	ppm	ASTM D5185m	>10	0		
Nickel	ppm	ASTM D5185m	>3	0		
Titanium	ppm	ASTM D5185m	>3	0		
Silver	ppm	ASTM D5185m	>2	0		
Aluminum	ppm	ASTM D5185m	>10	1		
Lead	ppm	ASTM D5185m	>10	0		
Copper	ppm	ASTM D5185m	>50	20		
Tin	ppm	ASTM D5185m	>10	0		
Vanadium	ppm	ASTM D5185m		0		
Cadmium	ppm	ASTM D5185m		0		
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m		0		
Barium	ppm	ASTM D5185m		0		
Molybdenum	ppm	ASTM D5185m		0		
Manganese	ppm	ASTM D5185m		0		
Magnesium	ppm	ASTM D5185m		<1		
Calcium	ppm	ASTM D5185m		0		
Phosphorus	ppm	ASTM D5185m		154		
Zinc	ppm	ASTM D5185m		173		
Sulfur	ppm	ASTM D5185m		1366		
CONTAMINANTS	3	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>25	0		
Sodium	ppm	ASTM D5185m		0		
Potassium	ppm	ASTM D5185m	>20	2		
Water	%	ASTM D6304	>0.05	0.001		
ppm Water	ppm	ASTM D6304	>500	1.6		
FLUID CLEANLIN	NESS	method	limit/base	current	history1	history2
Particles >4μm		ASTM D7647		79002		
Particles >6µm		ASTM D7647	>1300	<u> </u>		
Particles >14μm		ASTM D7647	>80	473		
Particles >21µm		ASTM D7647	>20	<u> </u>		
Particles >38µm		ASTM D7647	>4	14		
Particles >71μm		ASTM D7647	>3	1		
Oil Cleanliness		ISO 4406 (c)	>/17/13	23/21/16		
FLUID DEGRADA	ATION	method	limit/base	current	history1	history2
Acid Number (AN)	ma 1/011/a	ACTM DODAE		0.46		


Acid Number (AN)

mg KOH/g ASTM D8045

0.46



OIL ANALYSIS REPORT

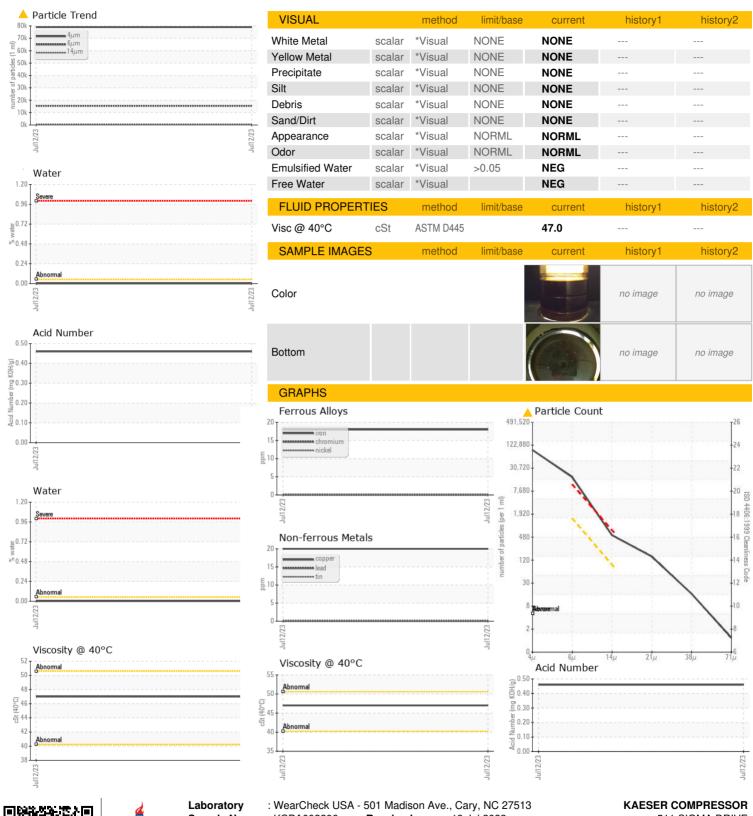



ANABA C C R E D I T E D

TESTING LABORATORY

Laboratory Sample No. Lab Number Unique Number

b. : KCPA002206 er : 05902333 liber : 10563689

Received : 19 Jul 2023
Diagnosed : 25 Jul 2023
Diagnostician : Doug Bogart

Certificate L2367 **Test Package**: IND 2 (Additional Tests: KF, PrtCount)

To discuss this sample report, contact Customer Service at 1-800-237-1369.

* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

511 SIGMA DRIVE FREDERICKSBURG, VA US 22408

Contact: Warranty Department warranty.us@kaeser.com

T: (540)898-5500 F: (540)898-5520