

## **PROBLEM SUMMARY**

Sample Rating Trend


ISO

# Refrigeration Compressor Machine Id FRICK TYSLEX 6 FRK (S/N S0094)


Component

**Refrigeration Compressor** 

USPI 1009-68 SC (--- GAL)

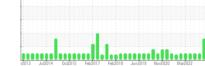

#### **COMPONENT CONDITION SUMMARY**

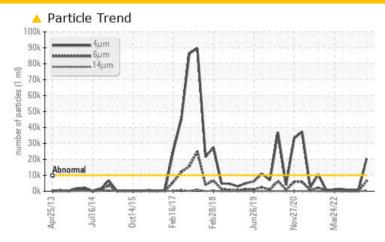

#### RECOMMENDATION

We recommend you service the filters on this component. Resample at the next service interval to monitor.

PROBLEMATIC TEST RESULTS									
Sample Status			ABNORMAL	NORMAL	NORMAL				
Particles >4μm	ASTM D7647	>10000	<u>^</u> 20488	917	753				
Particles >6μm	ASTM D7647	>2500	<b>△</b> 6418	182	123				
Particles >14µm	ASTM D7647	>320	<b>330</b>	5	5				
Oil Cleanliness	ISO 4406 (c)	>20/18/15	<b>22/20/16</b>	17/15/10	17/14/10				

Customer Id: IBPLEX01 Sample No.: USP183537 Lab Number: 05903755 Test Package: IND 2



To manage this report scan the QR code

To discuss the diagnosis or test data: Doug Bogart +1 (800)237-1369 x4016 dougb@wearcheckusa.com

To change component or sample information: Customer Service +1 1-800-237-1369 customerservice@wearcheck.com

#### **RECOMMENDED ACTIONS**

Action	Status	Date	Done By	Description
Change Filter			?	We recommend you service the filters on this component.

#### HISTORICAL DIAGNOSIS

#### 23 Feb 2023 Diag: Doug Bogart

#### NORMAL



Resample at the next service interval to monitor. All component wear rates are normal. There is no indication of any contamination in the component. The amount and size of particulates present in the system is acceptable. The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.



#### 19 Sep 2022 Diag: Doug Bogart

#### NORMAL



Resample at the next service interval to monitor. All component wear rates are normal. There is no indication of any contamination in the component. The amount and size of particulates present in the system is acceptable. The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

# view report

#### 16 Jun 2022 Diag: Doug Bogart

#### NORMAL



Resample at the next service interval to monitor. All component wear rates are normal. There is no indication of any contamination in the component. The amount and size of particulates present in the system is acceptable. The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.





# **OIL ANALYSIS REPORT**


Sample Rating Trend

ISO

# Refrigeration Compressor FRICK TYSLEX 6 FRK (S/N S0094)

**Refrigeration Compressor** 

USPI 1009-68 SC (--- GAL)

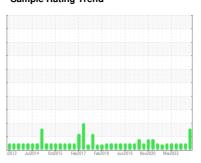



#### **DIAGNOSIS**

#### Recommendation

We recommend you service the filters on this component. Resample at the next service interval to monitor.

All component wear rates are normal.

#### Contamination

There is a high amount of particulates present in the oil.


#### **Fluid Condition**

The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

		r2013 Jul20	14 Oct2015 Feb2017	Feb2018 Jun2019 Nov2020	Mar2022	
SAMPLE INFORM	MATION	method	limit/base	current	history1	history2
Sample Number		Client Info		USP183537	USP241169	USP234241
Sample Date		Client Info		18 Jul 2023	23 Feb 2023	19 Sep 2022
Machine Age	hrs	Client Info		18079	96536	93778
Oil Age	hrs	Client Info		0	0	0
Oil Changed		Client Info		N/A	N/A	N/A
Sample Status				ABNORMAL	NORMAL	NORMAL
WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>8	0	<1	0
Chromium	ppm	ASTM D5185m	>2	0	0	0
Nickel	ppm	ASTM D5185m		0	0	<1
Titanium	ppm	ASTM D5185m		0	0	0
Silver	ppm	ASTM D5185m	>2	0	0	<1
Aluminum	ppm	ASTM D5185m	>3	0	0	0
Lead	ppm	ASTM D5185m	>2	0	0	0
Copper	ppm	ASTM D5185m	>8	0	0	0
Tin	ppm	ASTM D5185m	>4	0	0	<1
Vanadium	ppm	ASTM D5185m		0	0	0
Cadmium	ppm	ASTM D5185m		0	0	0
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m		0	0	0
Barium	ppm	ASTM D5185m		0	1	0
Molybdenum	ppm	ASTM D5185m		0	0	0
Manganese	ppm	ASTM D5185m		0	0	0
Magnesium	ppm	ASTM D5185m		0	0	0
Calcium	ppm	ASTM D5185m		0	0	0
Phosphorus	ppm	ASTM D5185m		0	0	0
Zinc	ppm	ASTM D5185m		0	0	0
Sulfur	ppm	ASTM D5185m	50	15	10	0
CONTAMINANTS		method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>15	2	3	3
Sodium	ppm	ASTM D5185m		0	0	<1
Potassium	ppm	ASTM D5185m	>20	0	<1	<1
Water	%	ASTM D6304	>0.01	0.004	0.005	0.001
ppm Water	ppm	ASTM D6304	>100	47.7	54.4	6.0
FLUID CLEANLIN	IESS	method	limit/base	current	history1	history2
Particles >4µm		ASTM D7647	>10000	<b>20488</b>	917	753
Particles >6µm		ASTM D7647	>2500	<b>6418</b>	182	123
Particles >14µm		ASTM D7647	>320	<b>330</b>	5	5
Particles >21µm		ASTM D7647	>80	34	1	1
Particles >38µm		ASTM D7647	>20	0	0	0
Particles >71μm		ASTM D7647	>4	0	0	0
Oil Cleanliness		ISO 4406 (c)	>20/18/15	<b>22/20/16</b>	17/15/10	17/14/10
FLUID DEGRADA	TION	method	limit/base	current	history1	history2
Acid Number (AN)	mg KOH/g	ASTM D974	0.005	0.014	0.013	0.015



### **OIL ANALYSIS REPORT**

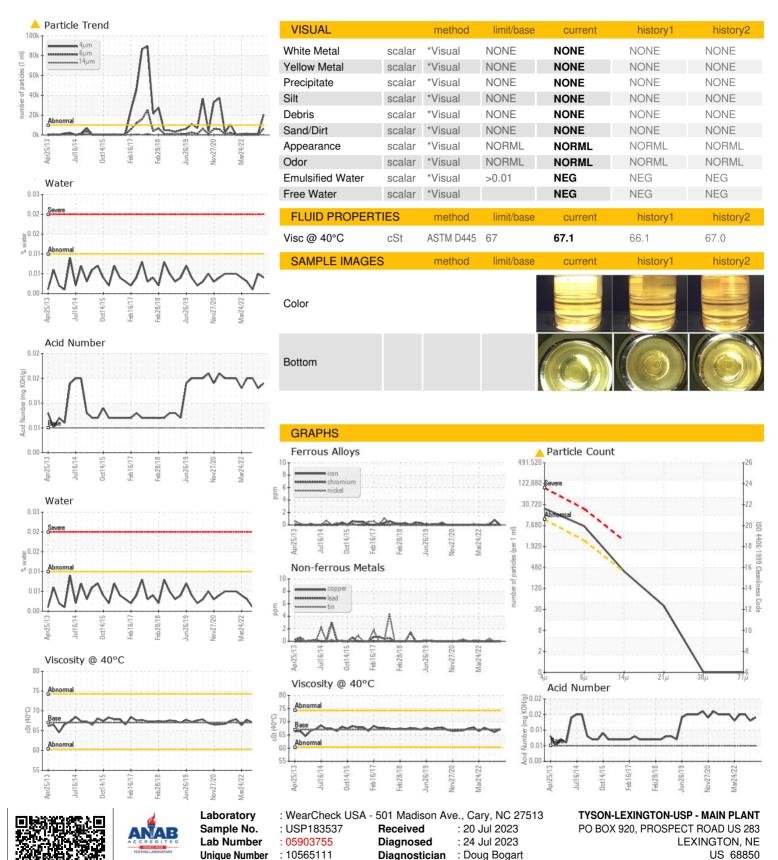

Report Id: IBPLEX01 [WUSCAR] 05903755 (Generated: 07/24/2023 09:25:13) Rev: 1

Certificate L2367

Test Package

: IND 2

To discuss this sample report, contact Customer Service at 1-800-237-1369.

\* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

Contact/Location: SCOTT NIERMAN - IBPLEX01

T: (308)324-8221

F: (308)324-8233

Contact: SCOTT NIERMAN