

PROBLEM SUMMARY

Sample Rating Trend

ISO


5257251 (S/N 1091)

Component

Compressor

FG ADVANTAGE PLUS (--- GAL)

COMPONENT CONDITION SUMMARY

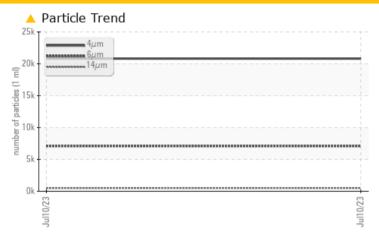

RECOMMENDATION

Oil and filter change at the time of sampling has been noted. Resample at the next service interval to monitor.

PROBLEMATIC TEST RESULTS									
Sample Status			ABNORMAL						
Particles >6µm	ASTM D7647	>1300	△ 7104						
Particles >14µm	ASTM D7647	>80	△ 502						
Particles >21µm	ASTM D7647	>20	104						
Oil Cleanliness	ISO 4406 (c)	>/17/13	22/20/16						

Customer Id: VWRAUR Sample No.: KC108214 Lab Number: 05903806 Test Package: IND 2

To manage this report scan the QR code

To discuss the diagnosis or test data: Angela Borella +1 800-237-1369 angela.borella@wearcheckusa.com

To change component or sample information: Customer Service +1 1-800-237-1369 customerservice@wearcheck.com

RECOMMENDED ACTIONS							
Action	Status	Date	Done By	Description			
Change Fluid			?	Oil and filter change at the time of sampling has been noted.			
Change Filter			?	Oil and filter change at the time of sampling has been noted.			

HISTORICAL DIAGNOSIS




OIL ANALYSIS REPORT

5257251 (S/N 1091)

Component

Compressor

FG ADVANTAGE PLUS (--- GAL)

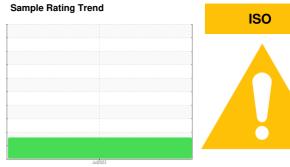

DIAGNOSIS

Recommendation

Oil and filter change at the time of sampling has been noted. Resample at the next service interval to monitor.

Wear

All component wear rates are normal.

Contamination

There is a high amount of particulates present in the oil.


Fluid Condition

The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

				Jul2023		
SAMPLE INFORM	MATION	method	limit/base	current	history1	history2
Sample Number		Client Info		KC108214		
Sample Date		Client Info		10 Jul 2023		
Machine Age	hrs	Client Info		56938		
Oil Age	hrs	Client Info		0		
Oil Changed		Client Info		Changed		
Sample Status				ABNORMAL		
WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>50	<1		
Chromium	ppm	ASTM D5185m	>10	0		
Nickel	ppm	ASTM D5185m	>3	0		
Titanium	ppm	ASTM D5185m	>3	0		
Silver	ppm	ASTM D5185m	>2	0		
Aluminum	ppm	ASTM D5185m	>10	<1		
Lead	ppm	ASTM D5185m	>10	0		
Copper	ppm	ASTM D5185m	>50	<1		
Tin	ppm	ASTM D5185m	>10	0		
Vanadium	ppm	ASTM D5185m		0		
Cadmium	ppm	ASTM D5185m		0		
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m		0		
Barium	ppm	ASTM D5185m		0		
Molybdenum	ppm	ASTM D5185m		0		
Manganese	ppm	ASTM D5185m		0		
Magnesium	ppm	ASTM D5185m		0		
Calcium	ppm	ASTM D5185m		0		
Phosphorus	ppm	ASTM D5185m		27		
Zinc	ppm	ASTM D5185m		5		
CONTAMINANTS		method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>25	0		
Sodium	ppm	ASTM D5185m		<1		
Potassium	ppm	ASTM D5185m	>20	0		
Water	%	ASTM D6304	>0.05	0.002		
ppm Water	ppm	ASTM D6304	>500	22.9		
FLUID CLEANLIN	IESS	method	limit/base	current	history1	history2
Particles >4μm		ASTM D7647		20812		
Particles >6µm		ASTM D7647	>1300	<u> </u>		
Particles >14µm		ASTM D7647	>80	△ 502		
Particles >21µm		ASTM D7647	>20	<u> </u>		
Particles >38μm		ASTM D7647	>4	2		
Particles >71μm		ASTM D7647	>3	0		
Oil Cleanliness		ISO 4406 (c)	>/17/13	<u>22/20/16</u>		
FLUID DEGRADA	TION	method	limit/base	current	history1	history2
Acid Number (AN)	mg KOH/g	ASTM D8045		0.20		



OIL ANALYSIS REPORT

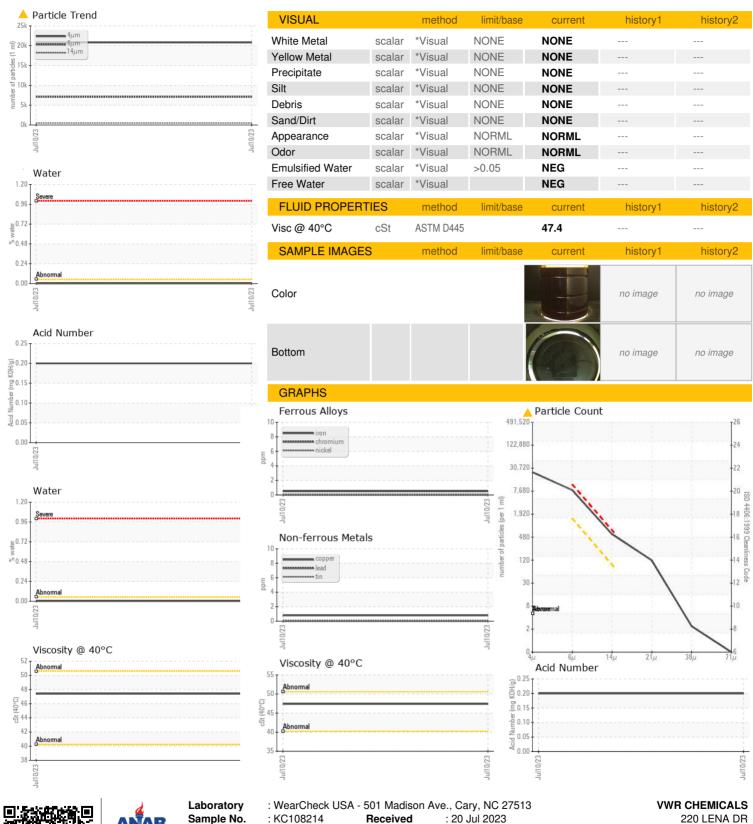



Certificate L2367

Sample No. Lab Number **Unique Number**

: 05903806

: KC108214 : 10565162 Test Package : IND 2

: 20 Jul 2023 Received Diagnosed : 24 Jul 2023

: Angela Borella Diagnostician

Contact: Service Manager

To discuss this sample report, contact Customer Service at 1-800-237-1369.

* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

AURORA, OH

US 44202

T: F: