

PROBLEM SUMMARY

Sample Rating Trend

SEDIMENT

TE6 (S/N 19P2821)

Agitator Gearbox Fluid NOT GIVEN (--- GAL)

COMPONENT CONDITION SUMMARY

No relevant graphs to display

RECOMMENDATION

Resample at the next service interval to monitor.

PROBLEMATIC TEST RESULTS										
Sample Status			ABNORMAL							
Silt	scalar	*Visual	NONE	▲ HEAVY						

Customer Id: AVEMIL Sample No.: WC05905426 Lab Number: 05905426 Test Package: IND 2

To manage this report scan the QR code

To discuss the diagnosis or test data: Angela Borella +1 800-237-1369 angela.borella@wearcheckusa.com

To change component or sample information: Customer Service +1 1-800-237-1369 customerservice@wearcheck.com


RECOMMENDED ACTIONS

There are no recommended actions for this sample.

HISTORICAL DIAGNOSIS



OIL ANALYSIS REPORT

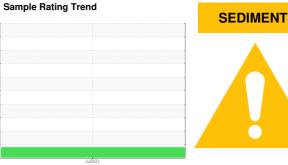

TE6 (S/N 19P2821)

Agitator Gearbox

NOT GIVEN (--- GAL)

DIAGNOSIS

Recommendation

Resample at the next service interval to monitor.

All component wear rates are normal.

Contamination

There is a high amount of visible silt present in the sample.


Fluid Condition

The AN level is acceptable for this fluid. The condition of the oil is acceptable for the time in service.

				Jul2023		
SAMPLE INFORM	MATION	method	limit/base	current	history1	history2
	VII) (1101 4	Client Info	III III Daoc	WC05905426		1110101 92
Sample Number Sample Date		Client Info		23 Jul 2023		
Machine Age	mths	Client Info		0		
Oil Age	mths	Client Info		0		
Oil Changed	111(113	Client Info		N/A		
Sample Status		Olletti IIIIO		ABNORMAL		
		un a de a al	line:#//e===			
WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>150	10		
Chromium	ppm	ASTM D5185m	>10	0		
Nickel	ppm	ASTM D5185m	>10	0		
Titanium	ppm	ASTM D5185m		0		
Silver	ppm	ASTM D5185m		<1		
Aluminum	ppm		>25	0		
Lead	ppm	ASTM D5185m	>100	0		
Copper	ppm		>50	<1		
Tin	ppm	ASTM D5185m	>10	0		
Vanadium	ppm	ASTM D5185m		0		
Cadmium	ppm	ASTM D5185m		0		
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m		0		
Barium	ppm	ASTM D5185m		<1		
Molybdenum	ppm	ASTM D5185m		2		
Manganese	ppm	ASTM D5185m		<1		
Magnesium	ppm	ASTM D5185m		<1		
Calcium	ppm	ASTM D5185m		635		
Phosphorus	ppm	ASTM D5185m		235		
Zinc	ppm	ASTM D5185m		0		
Sulfur	ppm	ASTM D5185m		13048		
CONTAMINANTS	3	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>50	3		
Sodium	ppm	ASTM D5185m		0		
Potassium	ppm	ASTM D5185m	>20	1		
FLUID DEGRADA	ATION	method	limit/base	current	history1	history2
Acid Number (AN)	mg KOH/g	ASTM D8045		0.64		
VISUAL		method	limit/base	current	history1	history2
White Metal	scalar	*Visual	NONE	NONE		
Yellow Metal	scalar	*Visual	NONE	NONE		
Precipitate	scalar	*Visual	NONE	NONE		
Silt	scalar	*Visual	NONE	▲ HEAVY		
Debris	scalar	*Visual	NONE	NONE		
Sand/Dirt	scalar	*Visual	NONE	NONE		
Appearance	scalar	*Visual	NORML	NORML		
Odor	scalar	*Visual	NORML	NORML		
Emulsified Water	scalar	*Visual	>0.1	NEG		
Free Water	scalar	*Visual		NEG		



OIL ANALYSIS REPORT

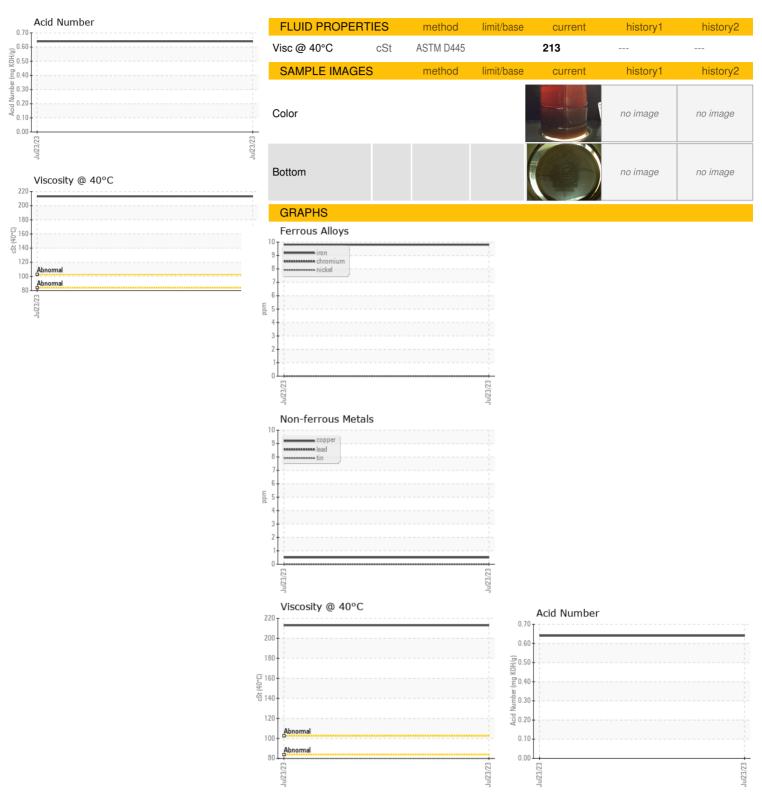





Certificate L2367

Laboratory Sample No. Lab Number

: 05905426 Unique Number : 10566782

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 : WC05905426 Received : 24 Jul 2023 : 25 Jul 2023

Diagnosed

Diagnostician : Angela Borella

Test Package : IND 2 (Additional Tests: PrtCount)

To discuss this sample report, contact Customer Service at 1-800-237-1369.

* - Denotes test methods that are outside of the ISO 17025 scope of accreditation. Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

AVERY DENNISON CHEMICAL DIVISION

171 DRAKETOWN RD

MILL HALL, PA US 17751

Contact: DONALD EYER DONALD.EYER@AVERYDENNISON.COM

F: (570)748-1813

Contact/Location: DONALD EYER - AVEMIL