

PROBLEM SUMMARY

NUPRO NUPRO EATON EATON

Component **Hydraulic System**

AW HYDRAULIC OIL ISO 46 (--- QTS)

Sample Rating Trend **VIS DEBRIS**

COMPONENT CONDITION SUMMARY

No relevant graphs to display

RECOMMENDATION

We recommend you service the filters on this component. Resample at the next service interval to monitor.

PROBLEMATIC T	EST RE	SULTS			
Sample Status				ABNORMAL	
Debris	scalar	*Visual	NONE	▲ MODER	

Customer Id: DENMILDE Sample No.: BRI006802 Lab Number: 05923847 Test Package: IND 1

To manage this report scan the QR code

To discuss the diagnosis or test data:

Don Baldridge +1 don.b505@comcast.net

To change component or sample information: Customer Service +1 1-800-237-1369 customerservice@wearcheck.com

RECOMMENDED ACTIONS						
Action	Status	Date	Done By	Description		
Change Filter			?	We recommend you service the filters on this component.		

HISTORICAL DIAGNOSIS



OIL ANALYSIS REPORT

NUPRO NUPRO **EATON EATON**

Hydraulic System

AW HYDRAULIC OIL ISO 46 (--- QTS)

Sample Rating Trend **VIS DEBRIS**

DIAGNOSIS

Recommendation

We recommend you service the filters on this component. Resample at the next service interval to monitor.

All component wear rates are normal.

Contamination

Moderate concentration of visible dirt/debris present in the oil.

Fluid Condition

The condition of the oil is acceptable for the time in service.

				Jan2023		
SAMPLE INFOR	MATION	method	limit/base	current	history1	history2
Sample Number		Client Info		BRI006802		
Sample Date		Client Info		16 Jan 2023		
Machine Age	days	Client Info		0		
Oil Age	days	Client Info		0		
Oil Changed		Client Info		N/A		
Sample Status				ABNORMAL		
WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>20	2		
Chromium	ppm	ASTM D5185m	>20	0		
Nickel	ppm	ASTM D5185m	>20	0		
Titanium	ppm	ASTM D5185m		0		
Silver	ppm	ASTM D5185m		0		
Aluminum	ppm	ASTM D5185m	>20	<1		
Lead	ppm	ASTM D5185m	>20	0		
Copper	ppm	ASTM D5185m	>20	4		
Tin	ppm	ASTM D5185m	>20	0		
Vanadium	ppm	ASTM D5185m		0		
Cadmium	ppm	ASTM D5185m		0		
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m	5	0		
Barium	ppm	ASTM D5185m	5	0		
Molybdenum	ppm	ASTM D5185m	5	0		
Manganese	ppm	ASTM D5185m		0		
Magnesium	ppm	ASTM D5185m	25	0		
Calcium	ppm	ASTM D5185m	200	2		
Phosphorus	ppm	ASTM D5185m	300	746		
Zinc	ppm	ASTM D5185m	370	257		
Sulfur	ppm	ASTM D5185m	2500	1972		
CONTAMINANTS	3	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>15	<1		
Sodium	ppm	ASTM D5185m		0		
Potassium	ppm	ASTM D5185m	>20	<1		
VISUAL		method	limit/base	current	history1	history2
White Metal	scalar	*Visual	NONE	NONE		
Yellow Metal	scalar	*Visual	NONE	NONE		
Precipitate	scalar	*Visual	NONE	NONE		
Silt	scalar	*Visual	NONE	NONE		
Debris	scalar	*Visual	NONE	MODER		
Sand/Dirt	scalar	*Visual	NONE	NONE		
Appearance	scalar	*Visual	NORML	NORML		
Odor	scalar	*Visual	NORML	NORML		
Emulsified Water	scalar	*Visual	>0.05	NEG		
Free Water	scalar	*Visual		NEG		
FLUID PROPERT	ΓIES	method	limit/base	current	history1	history2

Visc @ 40°C


cSt

ASTM D445 46

42.3




OIL ANALYSIS REPORT

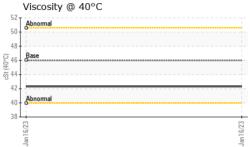





GRAPHS

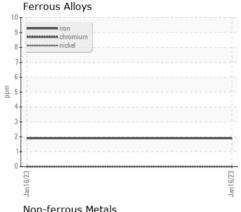

Non-ferrous Metals

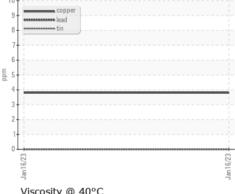

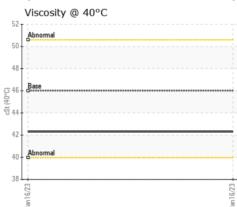





Certificate L2367

Laboratory Sample No. Lab Number

: BRI006802 : 05923847 Unique Number : 10603794 Test Package : IND 1

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 Received Diagnosed Diagnostician : Don Baldridge

: 14 Aug 2023 : 15 Aug 2023

38 W CLARKE AVE MILFORD, DE US 19963 Contact: LOUIS WINGATE louis.wingate@dentsply.com

T: (302)422-4511 F: (302)422-3832

DENTSPLY SIRONA

To discuss this sample report, contact Customer Service at 1-800-237-1369. * - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)