

PROBLEM SUMMARY

Sample Rating Trend



SC-10 SINGLE SCREW (S/N 10241F03085736)

Refrigeration Compressor

CHEVRON CAPELLA OIL WF 68 (--- GAL)

COMPONENT CONDITION SUMMARY

No relevant graphs to display

RECOMMENDATION

We recommend you service the filters on this component. Resample at the next service interval to monitor. We were unable to perform a particle count due to a high concentration of particles present in this sample.

PROBLEMATIC T	EST RE	SULTS				
Sample Status				ABNORMAL	ABNORMAL	NORMAL
Silt	scalar	*Visual	NONE	▲ MODER	NONE	NONE

Customer Id: PINJAC Sample No.: USP248653 Lab Number: 05924895 Test Package: IND 2



To manage this report scan the QR code

To discuss the diagnosis or test data: Doug Bogart +1 (800)237-1369 x4016 dougb@wearcheckusa.com

To change component or sample information: Customer Service +1 1-800-237-1369 customerservice@wearcheck.com

RECOMMENDED ACTIONS

Action	Status	Date	Done By	Description
Change Filter			?	We recommend you service the filters on this component.
Alert			?	We were unable to perform a particle count due to a high concentration of particles present in this sample.

HISTORICAL DIAGNOSIS

29 Sep 2022 Diag: Doug Bogart





We recommend you service the filters on this component. Resample at the next service interval to monitor. All component wear rates are normal. There is a high amount of particulates present in the oil. The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.



25 Mar 2021 Diag: Doug Bogart

NORMAL



Resample at the next service interval to monitor. All component wear rates are normal. There is no indication of any contamination in the oil. The amount and size of particulates present in the system are acceptable. The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.





OIL ANALYSIS REPORT

Sample Rating Trend

SEDIMENT

Machine Id

SC-10 SINGLE SCREW (S/N 10241F03085736)

Component

Refrigeration Compressor

CHEVRON CAPELLA OIL WF 68 (--- GAL)

DIAGNOSIS

Recommendation

We recommend you service the filters on this component. Resample at the next service interval to monitor. We were unable to perform a particle count due to a high concentration of particles present in this sample.

Wear

All component wear rates are normal.

Contamination

There is a moderate amount of visible silt present in the sample.

Fluid Condition

The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.


		Ma	2021	Sep 2022 Jun 2023		
SAMPLE INFORM	MATION	method	limit/base	current	history1	history2
Sample Number		Client Info		USP248653	USP242933	USP215866
Sample Date		Client Info		04 Jun 2023	29 Sep 2022	25 Mar 2021
Machine Age	hrs	Client Info		0	0	0
Oil Age	hrs	Client Info		0	0	0
Oil Changed		Client Info		N/A	N/A	N/A
Sample Status				ABNORMAL	ABNORMAL	NORMAL
WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>8	1	3	3
Chromium	ppm	ASTM D5185m	>2	0	0	0
Nickel	ppm	ASTM D5185m		<1	0	0
Titanium	ppm	ASTM D5185m		0	0	0
Silver	ppm	ASTM D5185m	>2	0	0	0
Aluminum	ppm	ASTM D5185m	>3	0	0	<1
Lead	ppm	ASTM D5185m	>2	0	0	0
Copper	ppm	ASTM D5185m	>8	<1	0	<1
Tin	ppm	ASTM D5185m	>4	0	0	4
Antimony	ppm	ASTM D5185m				2
Vanadium	ppm	ASTM D5185m		0	0	0
Cadmium	ppm	ASTM D5185m		0	0	0
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m		0	0	<1
Barium	ppm	ASTM D5185m		0	0	0
Molybdenum	ppm	ASTM D5185m		0	0	<1
Manganese	ppm	ASTM D5185m		0	0	0
Magnesium	ppm	ASTM D5185m	0	0	0	0
Calcium	ppm	ASTM D5185m		0	0	0
Phosphorus	ppm	ASTM D5185m		0	0	0
Zinc	ppm	ASTM D5185m		4	3	4
Sulfur	ppm	ASTM D5185m		0	42	170
CONTAMINANTS	3	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>15	0	0	0
Sodium	ppm	ASTM D5185m		0	0	0
Potassium	ppm	ASTM D5185m	>20	<1	0	1
Water	%	ASTM D6304	>0.01	0.002	0.007	0.003
ppm Water	ppm	ASTM D6304	>100	20.7	74.5	31.8
FLUID CLEANLIN	IESS	method	limit/base	current	history1	history2
Particles >4µm		ASTM D7647	>10000		▲ 70752	8841
Particles >6µm		ASTM D7647	>2500		<u>▲</u> 15281	2364
Particles >14μm		ASTM D7647	>320		△ 624	183
Particles >21μm		ASTM D7647	>80		78	50
Particles >38μm		ASTM D7647	>20		3	3
Particles >71μm		ASTM D7647	>4		0	0
Oil Cleanliness		ISO 4406 (c)	>20/18/15		<u>\$\lambda\$\$ 23/21/16</u>	20/18/15
FLUID DEGRADA	ATION	method	limit/base	current	history1	history2


0.014





OIL ANALYSIS REPORT



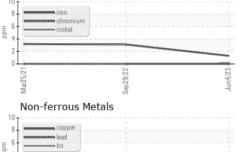

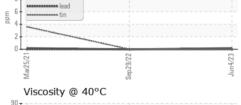

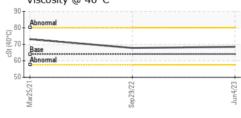

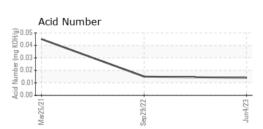





Certificate L2367

Laboratory Sample No. Lab Number **Unique Number** Test Package : IND 2

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 : 05924895

: USP248653 : 10604842

: 15 Aug 2023 Received Diagnosed : 16 Aug 2023 : Doug Bogart Diagnostician

PINNACLE FOODS - CAGJAC

JACKSON, TN US Contact:

> T: F:

To discuss this sample report, contact Customer Service at 1-800-237-1369.

* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)