


PROBLEM SUMMARY


KAESER SK 15T 4847605 (S/N 1339)

Compressor

KAESER SIGMA (OEM) M-460 (--- QTS)

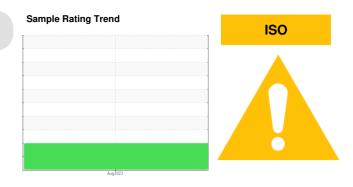

COMPONENT CONDITION SUMMARY

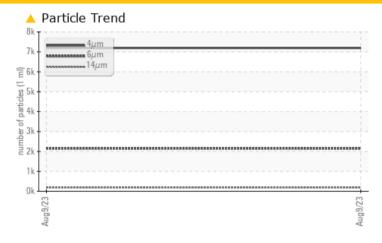

RECOMMENDATION

The filter change at the time of sampling has been noted. Resample at the next service interval to monitor.

PROBLEMATIC TEST RESULTS									
Sample Status			ABNORMAL						
Particles >6µm	ASTM D7647	>1300	<u>2149</u>						
Particles >14µm	ASTM D7647	>80	189						
Particles >21µm	ASTM D7647	>20	<u> </u>						
Particles >38µm	ASTM D7647	>4	<u> </u>						
Oil Cleanliness	ISO 4406 (c)	>/17/13	<u>^</u> 20/18/15						

Customer Id: EMPADA Sample No.: KCPA005212 Lab Number: 05925462 Test Package: IND 2

To manage this report scan the QR code

To discuss the diagnosis or test data: Jonathan Hester +1 919-379-4092 x4092 jhester@wearcheckusa.com

To change component or sample information: Customer Service +1 1-800-237-1369 customerservice@wearcheck.com

RECOMMENDED ACTIONS

There are no recommended actions for this sample.

HISTORICAL DIAGNOSIS



OIL ANALYSIS REPORT

Sample Rating Trend

ISO

Machine Id

KAESER SK 15T 4847605 (S/N 1339)

Component

Compressor

KAESER SIGMA (OEM) M-460 (--- QTS)

DIAGNOSIS

Recommendation

The filter change at the time of sampling has been noted. Resample at the next service interval to monitor.

Wear

All component wear rates are normal.

Contamination

There is a high amount of particulates present in the oil.

Fluid Condition

The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

				Aug2023		
SAMPLE INFORM	MATION	method	limit/base	current	history1	history2
Sample Number		Client Info		KCPA005212		
Sample Date		Client Info		09 Aug 2023		
Machine Age	hrs	Client Info		18362		
Oil Age	hrs	Client Info		0		
Oil Changed		Client Info		N/A		
Sample Status				ABNORMAL		
WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>50	0		
Chromium	ppm	ASTM D5185m	>10	0		
Nickel	ppm	ASTM D5185m	>3	0		
Titanium	ppm	ASTM D5185m	>3	0		
Silver	ppm	ASTM D5185m	>2	0		
Aluminum	ppm	ASTM D5185m	>10	<1		
Lead	ppm	ASTM D5185m	>10	0		
Copper	ppm	ASTM D5185m	>50	17		
Tin	ppm	ASTM D5185m	>10	0		
Vanadium	ppm	ASTM D5185m		0		
Cadmium	ppm	ASTM D5185m		0		
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m	0	0		
Barium	ppm	ASTM D5185m	90	0		
Molybdenum	ppm	ASTM D5185m	0	0		
Manganese	ppm	ASTM D5185m		0		
Magnesium	ppm	ASTM D5185m	100	0		
Calcium	ppm	ASTM D5185m	0	0		
Phosphorus	ppm	ASTM D5185m	0	<1		
Zinc	ppm	ASTM D5185m	0	11		
Sulfur	ppm	ASTM D5185m	23500	21925		
CONTAMINANTS	}	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>25	0		
Sodium	ppm	ASTM D5185m		0		
Potassium	ppm	ASTM D5185m	>20	<1		
Water	%	ASTM D6304	>0.05	0.011		
ppm Water	ppm	ASTM D6304	>500	113.6		
FLUID CLEANLIN	IESS	method	limit/base	current	history1	history2
Particles >4µm		ASTM D7647		7195		
Particles >6µm		ASTM D7647	>1300	<u>^</u> 2149		
Particles >14μm		ASTM D7647	>80	<u> </u>		
Particles >21µm		ASTM D7647	>20	<u>▲</u> 58		
Particles >38μm		ASTM D7647	>4	<u> </u>		
Particles >71μm		ASTM D7647	>3	0		
Oil Cleanliness		ISO 4406 (c)	>/17/13	<u>^</u> 20/18/15		
FLUID DEGRADA	ATION	method	limit/base	current	history1	history2
Acid Number (AN)	ma I/OII/a	ACTM DODAE	1.0	0.42		


Acid Number (AN)

mg KOH/g ASTM D8045 1.0

0.43



OIL ANALYSIS REPORT

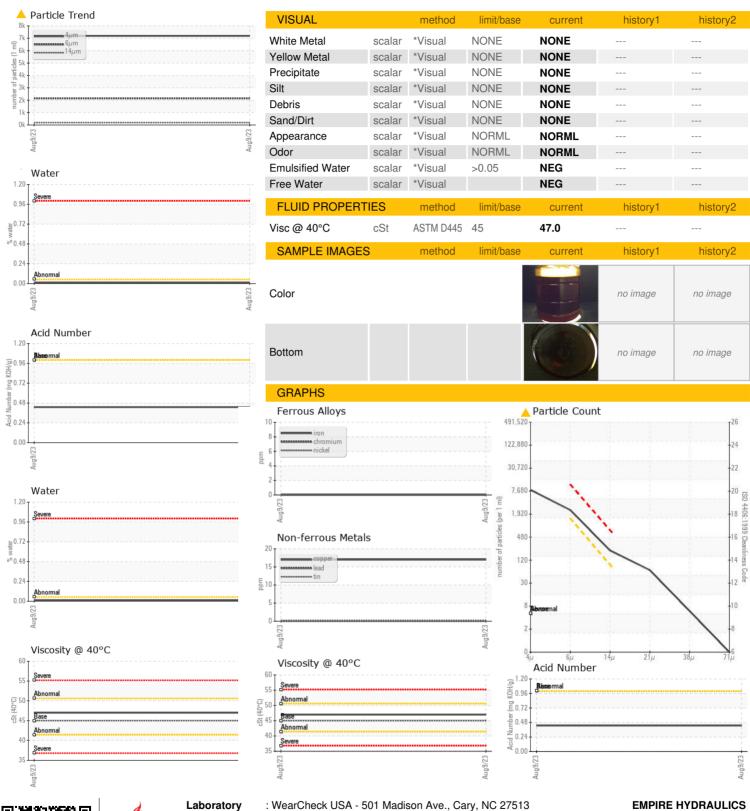





Certificate L2367

Laboratory Sample No. Lab Number **Unique Number**

: 05925462

: KCPA005212 : 10605409

Received Diagnosed

: 15 Aug 2023 : 17 Aug 2023 Diagnostician : Jonathan Hester

ADAMS CENTER, NY

Contact: Service Manager

13428 VICTORY LN

Test Package : IND 2 (Additional Tests: KF, PrtCount) To discuss this sample report, contact Customer Service at 1-800-237-1369.

* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

US 13606

T: F: