

PROBLEM SUMMARY


Paper Machine Refiner #2

Component Bearing Lube

MOBIL SHC 630 (--- GAL)

Sample Rating Trend ISO

COMPONENT CONDITION SUMMARY

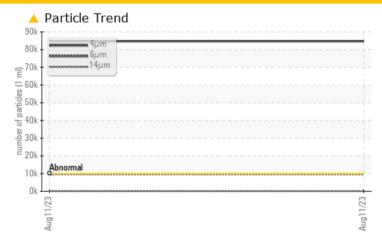

RECOMMENDATION

No corrective action is recommended at this time. Resample at the next service interval to monitor.

PROBLEMATIC TEST RESULTS										
Sample Status			ABNORMAL							
Particles >4μm	ASTM D7647	>10000	A 84742							
Particles >6µm	ASTM D7647	>2500	<u> </u>							
Oil Cleanliness	ISO 4406 (c)	>20/18/14	24/20/14							

Customer Id: CASASH Sample No.: WC0776564 Lab Number: 05927240 Test Package: PLANT



To manage this report scan the QR code

To discuss the diagnosis or test data:

Don Baldridge +1 don.b505@comcast.net

To change component or sample information: Customer Service +1 1-800-237-1369 customerservice@wearcheck.com

RECOMMENDED ACTIONS

There are no recommended actions for this sample.

HISTORICAL DIAGNOSIS



OIL ANALYSIS REPORT

Paper Machine Refiner #2

Bearing Lube

MOBIL SHC 630 (--- GAL)

Sample Rating Trend ISO

DIAGNOSIS

Recommendation

No corrective action is recommended at this time. Resample at the next service interval to monitor.

All component wear rates are normal.

Contamination

There is a high amount of silt (particulates < 14 microns in size) present in the oil.

Fluid Condition

The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

				Aug 2023		
SAMPLE INFORM	MATION	method	limit/base	current	history1	history2
Sample Number		Client Info		WC0776564		
Sample Date		Client Info		11 Aug 2023		
Machine Age	hrs	Client Info		0		
Oil Age	hrs	Client Info		0		
Oil Changed		Client Info		N/A		
Sample Status				ABNORMAL		
WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>120	37		
Chromium	ppm	ASTM D5185m	>5	<1		
Nickel	ppm	ASTM D5185m	>20	0		
Titanium	ppm	ASTM D5185m		<1		
Silver	ppm	ASTM D5185m		0		
Aluminum	ppm	ASTM D5185m	>4	<1		
Lead	ppm	ASTM D5185m	>30	1		
Copper	ppm	ASTM D5185m	>17	1		
Tin	ppm	ASTM D5185m	>10	0		
Vanadium	ppm	ASTM D5185m		<1		
Cadmium	ppm	ASTM D5185m		0		
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m		0		
Barium	ppm	ASTM D5185m		0		
Molybdenum	ppm	ASTM D5185m		0		
Manganese	ppm	ASTM D5185m		2		
Magnesium	ppm	ASTM D5185m		2		
Calcium	ppm	ASTM D5185m		2		
Phosphorus	ppm	ASTM D5185m		468		
Zinc	ppm	ASTM D5185m		1		
Sulfur	ppm	ASTM D5185m		330		
CONTAMINANTS	}	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>25	14		
Sodium	ppm	ASTM D5185m		3		
Potassium	ppm	ASTM D5185m	>20	2		
Water	%	ASTM D6304	>0.2	0.004		
ppm Water	ppm	ASTM D6304	>2000	42.7		
FLUID CLEANLIN	IESS	method	limit/base	current	history1	history2
Particles >4µm		ASTM D7647	>10000	A 84742		
Particles >6µm		ASTM D7647	>2500	<u> </u>		
Particles >14µm		ASTM D7647	>160	115		
Particles >21µm		ASTM D7647	>40	13		
Particles >38µm		ASTM D7647	>10	1		
Particles >71µm		ASTM D7647	>3	0		
Oil Cleanliness		ISO 4406 (c)	>20/18/14	24/20/14		
FLUID DEGRADA	ATION	method	limit/base	current	history1	history2
Acid Number (AN)	mg KOH/g	ASTM D8045		0.37		



OIL ANALYSIS REPORT







Certificate L2367

Sample No. Lab Number **Unique Number**

: WC0776564 : 05927240 : 10607187 Test Package : PLANT

Received

Diagnosed Diagnostician

: 17 Aug 2023 : 18 Aug 2023 : Don Baldridge 10026 OLD RIDGE ROAD ASHLAND, VA US 23005

Contact: MARC-ANDRE HUBERT marc-andre hubert@cascades.com T:

To discuss this sample report, contact Customer Service at 1-800-237-1369. * - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

F: