

PROBLEM SUMMARY


ENGINE ROOM [PR1375366] MYCOM C08-1 (S/N 2519367)

Refrigeration Compressor

MYCOM MYCOLD AB68 (--- PNT)

Sample Rating Trend ISO

COMPONENT CONDITION SUMMARY

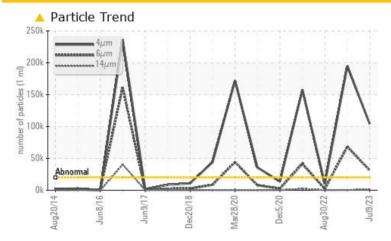

RECOMMENDATION

We recommend you service the filters on this component. Resample at the next service interval to monitor.

PROBLEMATIC TEST RESULTS									
Sample Status			ABNORMAL	ABNORMAL	NORMAL				
Particles >4µm	ASTM D7647	>20000	<u> </u>	<u>▲</u> 194847	10139				
Particles >6µm	ASTM D7647	>2500	1200	△ 68460	2297				
Particles >14μm	ASTM D7647	>320	1048	△ 391	86				
Particles >21μm	ASTM D7647	>80	134	18	7				
Oil Cleanliness	ISO 4406 (c)	>21/18/15	24/22/17	<u>\$\lambda\$</u> 25/23/16	21/18/14				

Customer Id: PERPERUSP Sample No.: USP245925 Lab Number: 05929654 Test Package: IND 2



To manage this report scan the QR code

To discuss the diagnosis or test data: Doug Bogart +1 (800)237-1369 x4016 dougb@wearcheckusa.com

To change component or sample information: Customer Service +1 1-800-237-1369 customerservice@wearcheck.com

RECOMMENDED ACTIONS

Action	Status	Date	Done By	Description
Change Filter			?	We recommend you service the filters on this component.

HISTORICAL DIAGNOSIS

09 Apr 2023 Diag: Doug Bogart





We recommend you service the filters on this component. Resample at the next service interval to monitor. All component wear rates are normal. There is a high amount of particulates present in the oil. The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.



30 Aug 2022 Diag: Doug Bogart

NORMAL



Resample at the next service interval to monitor. All component wear rates are normal. There is no indication of any contamination in the oil. The amount and size of particulates present in the system are acceptable. The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

view report

24 May 2022 Diag: Doug Bogart

150



We recommend you service the filters on this component. Resample at the next service interval to monitor. All component wear rates are normal. There is a high amount of particulates present in the oil. The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.






OIL ANALYSIS REPORT

ENGINE ROOM [PR1375366] MYCOM C08-1 (S/N 2519367)

Refrigeration Compressor

MYCOM MYCOLD AB68 (--- PNT)

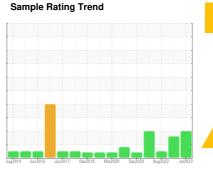



DIAGNOSIS

Recommendation

We recommend you service the filters on this component. Resample at the next service interval to monitor.

All component wear rates are normal.

Contamination

There is a high amount of particulates present in the oil.

Fluid Condition

The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

		\ug2014 Ju	n2016 Jun2017 Dec20	8 Mar2020 Dec2020 Aug20	022 Jul2023	
SAMPLE INFORM	MATION	method	limit/base	current	history1	history2
Sample Number		Client Info		USP245925	USP218709	USP241507
Sample Date		Client Info		09 Jul 2023	09 Apr 2023	30 Aug 2022
Machine Age	hrs	Client Info		0	0	46885
Oil Age	hrs	Client Info		0	0	0
Oil Changed		Client Info		Not Changd	N/A	N/A
Sample Status				ABNORMAL	ABNORMAL	NORMAL
WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>8	4	1	3
Chromium	ppm	ASTM D5185m	>2	0	0	0
Nickel	ppm	ASTM D5185m		0	0	0
Titanium	ppm	ASTM D5185m		<1	0	0
Silver	ppm	ASTM D5185m	>2	0	0	<1
Aluminum	ppm	ASTM D5185m	>3	0	0	<1
Lead	ppm	ASTM D5185m	>2	0	0	<1
Copper	ppm	ASTM D5185m	>8	0	0	<1
Tin	ppm	ASTM D5185m	>4	0	0	<1
Vanadium	ppm	ASTM D5185m		<1	0	0
Cadmium	ppm	ASTM D5185m		0	0	0
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m		0	0	0
Barium	ppm	ASTM D5185m		0	0	0
Molybdenum	ppm	ASTM D5185m		0	0	0
Manganese	ppm	ASTM D5185m		0	0	0
Magnesium	ppm	ASTM D5185m		<1	0	<1
Calcium	ppm	ASTM D5185m		0	0	1
Phosphorus	ppm	ASTM D5185m	2.3	0	0	0
Zinc	ppm	ASTM D5185m		0	0	0
Sulfur	ppm	ASTM D5185m	26	<1	0	20
CONTAMINANTS	}	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>15	0	0	<1
Sodium	ppm	ASTM D5185m		<1	0	0
Potassium	ppm	ASTM D5185m	>20	0	0	1
Water	%	ASTM D6304	>0.01	0.002	0.001	0.002
ppm Water	ppm	ASTM D6304	>100	22.4	9.7	22.7
FLUID CLEANLIN	IESS	method	limit/base	current	history1	history2
Particles >4µm		ASTM D7647	>20000	<u> </u>	▲ 194847	10139
Particles >6µm		ASTM D7647	>2500	A 31200	<u></u> ▲ 68460	2297
Particles >14µm		ASTM D7647	>320	<u> </u>	△ 391	86
Particles >21µm		ASTM D7647	>80	<u> </u>	18	7
Particles >38μm		ASTM D7647	>20	1	0	0
Particles >71μm		ASTM D7647	>4	0	0	0
Oil Cleanliness		ISO 4406 (c)	>21/18/15	<u>4</u> 24/22/17	△ 25/23/16	21/18/14
FLUID DEGRADA	TION	method	limit/base	current	history1	history2
Acid Number (AN)	mg KOH/g	ASTM D974		0.014	0.015	0.012



OIL ANALYSIS REPORT





Certificate L2367

Sample No. Lab Number **Unique Number**

Test Package

: USP245925 . 05929654 : 10609601 : IND 2

Received : 21 Aug 2023 Diagnosed Diagnostician

: 22 Aug 2023 : Doug Bogart

To discuss this sample report, contact Customer Service at 1-800-237-1369.

* - Denotes test methods that are outside of the ISO 17025 scope of accreditation. Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

Contact/Location: JAMES EAST - PERPERUSP

250 GEORGIA HWY 247 SPUR

Contact: JAMES EAST

T: (478)988-6048

james.east@perdue.com

PERRY, GA

US 31069

F: