

PROBLEM SUMMARY

KAESER 1015


Component

Compressor

KAESER SIGMA (OEM) S-460 (--- QTS)

Sample Rating Trend ISO

COMPONENT CONDITION SUMMARY

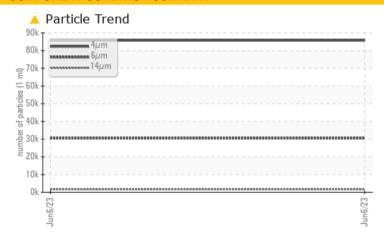

RECOMMENDATION

No corrective action is recommended at this time. The filter change at the time of sampling has been noted. Resample at the next service interval to monitor.

PROBLEMATIC TEST RESULTS									
Sample Status			ABNORMAL						
Particles >6µm	ASTM D7647	>1300	△ 30482						
Particles >14μm	ASTM D7647	>80	1646						
Particles >21µm	ASTM D7647	>20	4 339						
Particles >38μm	ASTM D7647	>4	<u> </u>						
Oil Cleanliness	ISO 4406 (c)	>/17/13	<u>4</u> 24/22/18						

Customer Id: POMRED Sample No.: KCPA002645 Lab Number: 05933659 Test Package: IND 2



To manage this report scan the QR code

To discuss the diagnosis or test data: Doug Bogart +1 (800)237-1369 x4016 dougb@wearcheckusa.com

To change component or sample information: Customer Service +1 1-800-237-1369 customerservice@wearcheck.com

RECOMMENDED ACTIONS

There are no recommended actions for this sample.

HISTORICAL DIAGNOSIS



OIL ANALYSIS REPORT



ISO



KAESER 1015

Component

Compressor

KAESER SIGMA (OEM) S-460 (--- QTS)

DIAGNOSIS

Recommendation

No corrective action is recommended at this time. The filter change at the time of sampling has been noted. Resample at the next service interval to monitor.

Wear

All component wear rates are normal.

Contamination

There is a high amount of particulates present in the oil.


Fluid Condition

The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

				Jun2023		
SAMPLE INFORM	AATION	mathad			historyd	biotom/0
07 mm 22 mm 01 m	MATION	method	limit/base	current	history1	history2
Sample Number		Client Info		KCPA002645		
Sample Date		Client Info		06 Jun 2023		
Machine Age	hrs	Client Info		66610		
Oil Age	hrs	Client Info		0		
Oil Changed		Client Info		N/A		
Sample Status				ABNORMAL		
WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>50	<1		
Chromium	ppm	ASTM D5185m	>10	0		
Nickel	ppm	ASTM D5185m	>3	0		
Titanium	ppm	ASTM D5185m	>3	0		
Silver	ppm	ASTM D5185m	>2	0		
Aluminum	ppm	ASTM D5185m	>10	0		
Lead	ppm	ASTM D5185m	>10	0		
Copper	ppm	ASTM D5185m	>50	5		
Tin	ppm	ASTM D5185m	>10	0		
Vanadium	ppm	ASTM D5185m		0		
Cadmium	ppm	ASTM D5185m		0		
ADDITIVES	ррпп	method	limit/base	current	historya	hiotory?
			IIIIII/Dase		history1	history2
Boron	ppm	ASTM D5185m		0		
Barium	ppm	ASTM D5185m	90	0		
Molybdenum	ppm	ASTM D5185m		0		
Manganese	ppm	ASTM D5185m		0		
Magnesium	ppm	ASTM D5185m	90	1		
Calcium	ppm	ASTM D5185m	2	2		
Phosphorus	ppm	ASTM D5185m		122		
Zinc	ppm	ASTM D5185m		25		
Sulfur	ppm	ASTM D5185m		16563		
CONTAMINANTS	1	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>25	<1		
Sodium	ppm	ASTM D5185m		1		
Potassium	ppm	ASTM D5185m	>20	0		
Water	%	ASTM D6304	>0.05	0.003		
ppm Water	ppm	ASTM D6304	>500	39.6		
FLUID CLEANLIN	IESS	method	limit/base	current	history1	history2
Particles >4μm		ASTM D7647		85764		
Particles >6µm		ASTM D7647	>1300	<u>▲</u> 30482		
Particles >14μm		ASTM D7647	>80	1646		
Particles >21µm		ASTM D7647	>20	△ 339		
Particles >38μm		ASTM D7647	>4	<u> </u>		
Particles >71µm		ASTM D7647	>3	0		
Oil Cleanliness		ISO 4406 (c)	>/17/13	24/22/18		
FLUID DEGRADA	TION	method	limit/base	current	history1	history2
Acid Number (AN)	mg KOH/g	ASTM D8045	0.4	0.38		



OIL ANALYSIS REPORT

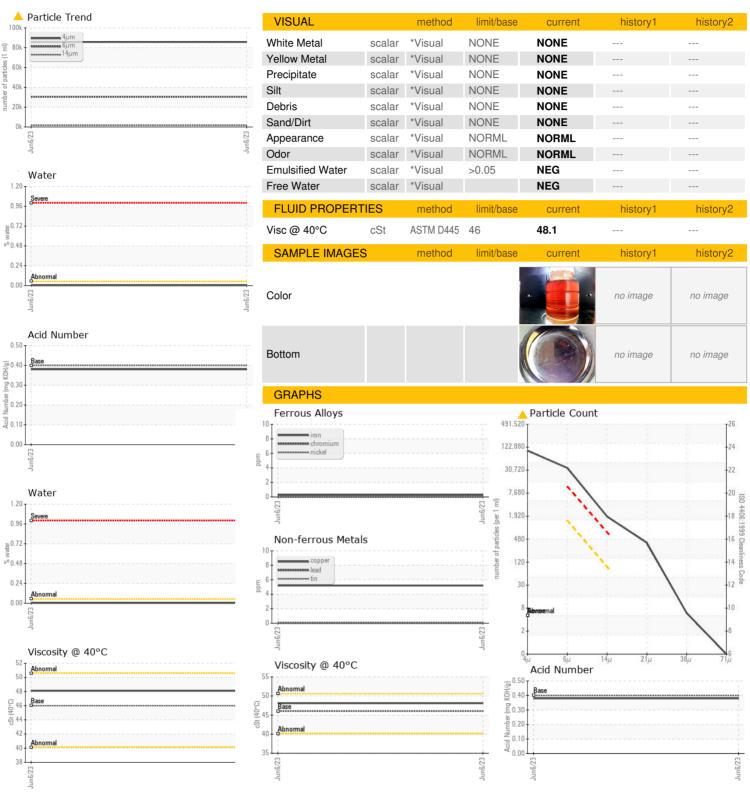



Laboratory Sample No. Lab Number **Unique Number**

: KCPA002645 : 05933659

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 Received : 24 Aug 2023 Diagnosed

: 25 Aug 2023 Diagnostician : Doug Bogart : 10618930 Test Package : IND 2 (Additional Tests: KF, PrtCount)

Certificate L2367 To discuss this sample report, contact Customer Service at 1-800-237-1369.

* - Denotes test methods that are outside of the ISO 17025 scope of accreditation. Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

POMPS 12606 INKSTER RD REDFORD, MI US 48239

Contact: Service Manager

T:

F: