


PROBLEM SUMMARY

Area CS-46 [PM6-288712] Machine Id ATLAS COPCO API304848 - NGP BLUE MOUNAIN Component

Compressor

COMPONENT CONDITION SUMMARY

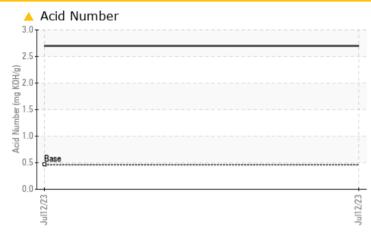

RECOMMENDATION

Oil and filter change at the time of sampling has been noted. Resample at the next service interval to monitor.

PROBLEMATIC TEST RESULTS							
Sample Status				ATTENTION			
Acid Number (AN)	mg KOH/g	ASTM D8045	0.463	<u> </u>			


Customer Id: UCCISSAC Sample No.: UCH05933772 Lab Number: 05933772 Test Package: IND 2



To manage this report scan the QR code

To discuss the diagnosis or test data: Doug Bogart +1 (800)237-1369 x4016 <u>dougb@wearcheckusa.com</u>

To change component or sample information: Customer Service +1 1-800-237-1369 customerservice@wearcheck.com

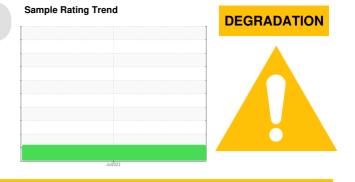

RECOMMENDED ACTIONS					
Action	Status	Date	Done By	Description	
Change Fluid			?	Oil and filter change at the time of sampling has been noted.	
Change Filter			?	Oil and filter change at the time of sampling has been noted.	

HISTORICAL DIAGNOSIS



OIL ANALYSIS REPORT

Area CS-46 [PM6-288712] Machine Id ATLAS COPCO API304848 - NGP BLUE MOUNAIN Component

Compressor

DIAGNOSIS

A Recommendation

Oil and filter change at the time of sampling has been noted. Resample at the next service interval to monitor.

Wear

All component wear rates are normal.

Contamination

There is no indication of any contamination in the oil.

Fluid Condition

The AN level is above the recommended limit.


		_				
				Jul2023		
SAMPLE INFOR	MATION	method	limit/base	current	history1	history2
Sample Number		Client Info		UCH05933772		
Sample Date		Client Info		12 Jul 2023		
Machine Age	hrs	Client Info		86632		
Dil Age	hrs	Client Info		0		
Oil Changed	1115	Client Info		0 Changed		
Sample Status				ATTENTION		
WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>50	0		
Chromium		ASTM D5185m	>5	0		
Nickel	ppm	ASTM D5185m	>0	0		
Titanium	ppm	ASTM D5185m		-		
	ppm			0		
Silver	ppm	ASTM D5185m	. 15	0		
Aluminum	ppm	ASTM D5185m	>15	0		
Lead	ppm	ASTM D5185m	>65	0		
Copper	ppm	ASTM D5185m	>65	0		
Tin	ppm	ASTM D5185m	>10	0		
Vanadium	ppm	ASTM D5185m		0		
Cadmium	ppm	ASTM D5185m		0		
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m	1.5	0		
Barium	ppm	ASTM D5185m	0	0		
Molybdenum	ppm	ASTM D5185m	0	0		
Manganese	ppm	ASTM D5185m	0.3	0		
Magnesium	ppm	ASTM D5185m	0	<1		
Calcium	ppm	ASTM D5185m	0	3		
Phosphorus	ppm	ASTM D5185m	406	11		
Zinc	ppm	ASTM D5185m	0	0		
Sulfur	ppm	ASTM D5185m	1283	65		
CONTAMINANTS	S	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>35	1		
Sodium	ppm	ASTM D5185m	200	0		
Potassium		ASTM D5185m	>20	0		
				•	bistowal	bister 0
FLUID DEGRAD		method ASTM D8045	limit/base	current	history1	history2
VISUAL	mg KOH/g					
		method	limit/base		history1	history2
White Metal	scalar	*Visual	NONE	NONE		
Yellow Metal	scalar	*Visual	NONE	NONE		
Precipitate	scalar	*Visual	NONE	NONE		
Silt	scalar	*Visual	NONE	NONE		
Debris	scalar	*Visual	NONE	NONE		
Sand/Dirt	scalar	*Visual	NONE	NONE		
Appearance	scalar	*Visual	NORML	NORML		
Odor	scalar	*Visual	NORML	NORML		
Emulsified Water	scalar	*Visual	>0.1	NEG		
Free Water	scalar	*Visual		NEG		

Sample Rating Trend

DEGRADATION



OIL ANALYSIS REPORT

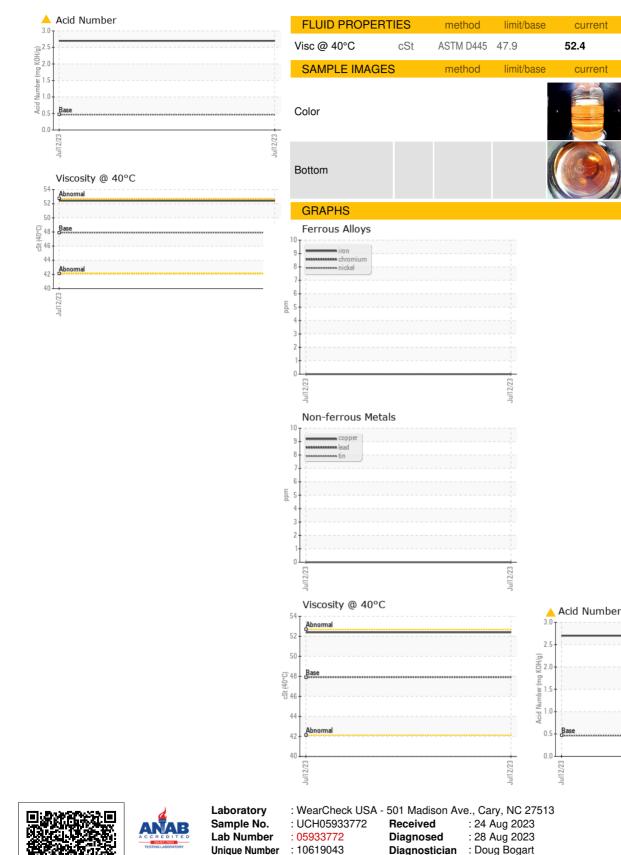

Test Package : IND 2

To discuss this sample report, contact Customer Service at 1-800-237-1369.

* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

CISCO AIR SYSTEMS 214 27TH ST SACRAMENTO, CA US 95816 Contact: BARRY FRKOVICH barryfrkovich@ciscoair.com T: (916)444-2525 Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012) F: x:

history1

history1

no image

no image

history2

history2

no image

no image

Certificate L2367

Contact/Location: BARRY FRKOVICH - UCCISSAC