

PROBLEM SUMMARY

Sample Rating Trend

ISO


^{Machine Id} **2786992 (S/N 1133)**

Component

Compressor

KAESER SIGMA (OEM) M-460 (--- GAL)

COMPONENT CONDITION SUMMARY

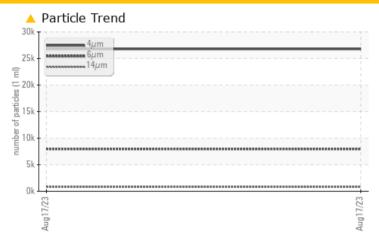

RECOMMENDATION

No corrective action is recommended at this time. Oil and filter change at the time of sampling has been noted. Resample at the next service interval to monitor.

PROBLEMATIC TEST RESULTS									
Sample Status		ABNORMAL							
Particles >6µm	ASTM D7647 >1	300 ^ 7966							
Particles >14µm	ASTM D7647 >8	0 🔺 806							
Particles >21µm	ASTM D7647 >2	0 🔺 233							
Particles >38µm	ASTM D7647 >4	<u> </u>							
Oil Cleanliness	ISO 4406 (c) >	-/17/13 🔺 22/20/17							

Customer Id: BLEAUR Sample No.: KCP32342 Lab Number: 05938318 Test Package: IND 2

To manage this report scan the QR code

To discuss the diagnosis or test data: Doug Bogart +1 (800)237-1369 x4016 dougb@wearcheckusa.com

To change component or sample information: Customer Service +1 1-800-237-1369 customerservice@wearcheck.com

RECOMMENDED ACTIONS								
Action	Status	Date	Done By	Description				
Change Fluid			?	Oil and filter change at the time of sampling has been noted.				
Change Filter			?	Oil and filter change at the time of sampling has been noted.				

HISTORICAL DIAGNOSIS




OIL ANALYSIS REPORT

2786992 (S/N 1133)

Compressor

KAESER SIGMA (OEM) M-460 (--- GAL)

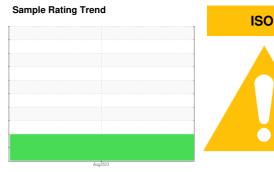

DIAGNOSIS

Recommendation

No corrective action is recommended at this time. Oil and filter change at the time of sampling has been noted. Resample at the next service interval to monitor.

Wear

All component wear rates are normal.

Contamination

There is a high amount of particulates present in the oil.


Fluid Condition

The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

				Aug2023		
SAMPLE INFORM	MATION	method	limit/base	current	history1	history2
Sample Number		Client Info		KCP32342		
Sample Date		Client Info		17 Aug 2023		
Machine Age	hrs	Client Info		36454		
Oil Age	hrs	Client Info		2000		
Oil Changed		Client Info		Changed		
Sample Status				ABNORMAL		
WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>50	<1		
Chromium	ppm	ASTM D5185m	>10	0		
Nickel	ppm	ASTM D5185m	>3	0		
Titanium	ppm	ASTM D5185m	>3	0		
Silver	ppm	ASTM D5185m	>2	0		
Aluminum	ppm	ASTM D5185m	>10	<1		
Lead	ppm	ASTM D5185m	>10	0		
Copper	ppm	ASTM D5185m	>50	7		
Tin	ppm	ASTM D5185m	>10	0		
Vanadium	ppm	ASTM D5185m		0		
Cadmium	ppm	ASTM D5185m		0		
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m	0	0		
Barium	ppm	ASTM D5185m	90	2		
Molybdenum	ppm	ASTM D5185m	0	0		
Manganese	ppm	ASTM D5185m		<1		
Magnesium	ppm	ASTM D5185m	100	49		
Calcium	ppm	ASTM D5185m	0	0		
Phosphorus	ppm	ASTM D5185m	0	<1		
Zinc	ppm	ASTM D5185m	0	4		
Sulfur	ppm	ASTM D5185m	23500	21479		
CONTAMINANTS	1	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>25	<1		
Sodium	ppm	ASTM D5185m		8		
Potassium	ppm	ASTM D5185m	>20	1		
Water	%	ASTM D6304	>0.05	0.043		
ppm Water	ppm	ASTM D6304	>500	436.0		
FLUID CLEANLIN	IESS	method	limit/base	current	history1	history2
Particles >4µm		ASTM D7647		26783		
Particles >6µm		ASTM D7647	>1300	^ 7966		
Particles >14μm		ASTM D7647	>80	A 806		
Particles >21µm		ASTM D7647	>20	<u>^</u> 233		
Particles >38μm		ASTM D7647	>4	<u> </u>		
Particles >71µm		ASTM D7647	>3	0		
Oil Cleanliness		ISO 4406 (c)	>/17/13	<u>22/20/17</u>		
FLUID DEGRADA	TION	method	limit/base	current	history1	history2
Acid Number (AN)	mg KOH/g	ASTM D8045	1.0	0.36		



OIL ANALYSIS REPORT

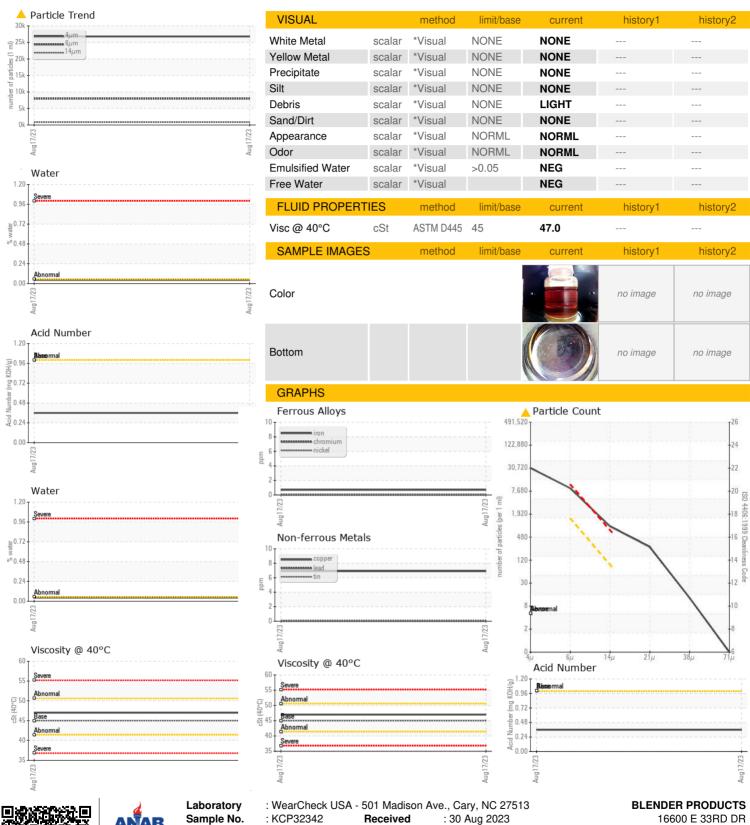



Sample No. Lab Number **Unique Number**

: KCP32342 : 05938318

: 10628930

Diagnosed Diagnostician : Doug Bogart

: 31 Aug 2023

Contact/Location: Service Manager - BLEAUR

Contact: Service Manager

Test Package : IND 2 (Additional Tests: KF, PrtCount) Certificate L2367 To discuss this sample report, contact Customer Service at 1-800-237-1369.

* - Denotes test methods that are outside of the ISO 17025 scope of accreditation. Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

AURORA, CO

US 80011

T: F: