

OIL ANALYSIS REPORT

Area **88-19** AFP5 - TS SECONDARY (S/N SC006914)

Gearbox

RENOLIN PG 220 (7 LTR)

Sample Rating Trend



Recommendation

Resample at the next service interval to monitor.

All component wear rates are normal.

Contamination

There is no indication of any contamination in the


Fluid Condition


The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

		INIBYZUZU	Sepzuzu Marzuzi	JUI2021 N6V2021	Aug2023	
SAMPLE INFORM	IATION	method	limit/base	current	history1	history2
Sample Number		Client Info		WC0845488	WC0565779	WC05303860
Sample Date		Client Info		24 Aug 2023	01 Nov 2021	14 Jul 2021
Machine Age	hrs	Client Info		0	0	0
Oil Age	hrs	Client Info		0	0	0
Oil Changed		Client Info		N/A	N/A	N/A
Sample Status				NORMAL	NORMAL	NORMAL
WEAR METALS		method	limit/base	current	history1	history2
PQ		ASTM D8184		38		
Iron	ppm	ASTM D5185m	>200	<1	0	2
Chromium	ppm	ASTM D5185m	>15	<1	0	0
Nickel	ppm	ASTM D5185m	>15	0	0	0
Titanium	ppm	ASTM D5185m		0	0	0
Silver	ppm	ASTM D5185m		0	0	0
Aluminum	ppm	ASTM D5185m	>25	<1	0	0
Lead	ppm	ASTM D5185m	>100	<1	<1	0
Copper	ppm	ASTM D5185m	>200	<1	0	0
Tin	ppm	ASTM D5185m	>25	<1	<1	0
Antimony	ppm	ASTM D5185m	>5		0	0
Vanadium	ppm	ASTM D5185m		<1	0	0
Cadmium	ppm	ASTM D5185m		0	0	0
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m		0	<1	<1
Barium	ppm	ASTM D5185m		<1	0	0
Molybdenum	ppm	ASTM D5185m		0	0	0
Manganese	ppm	ASTM D5185m		0	0	0
Magnesium	ppm	ASTM D5185m		0	0	0
Calcium	ppm	ASTM D5185m		0	0	0
Phosphorus	ppm	ASTM D5185m		587	452	475
Zinc	ppm	ASTM D5185m		0	0	0
Sulfur	ppm	ASTM D5185m		778	466	532
CONTAMINANTS		method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>50	2	0	0
Sodium	ppm	ASTM D5185m		5	0	<1
Potassium	ppm	ASTM D5185m	>20	<1	0	0
FLUID DEGRADA	TION	method	limit/base	current	history1	history2
Acid Number (AN)	mg KOH/g	ASTM D8045		0.28	0.285	0.264



OIL ANALYSIS REPORT

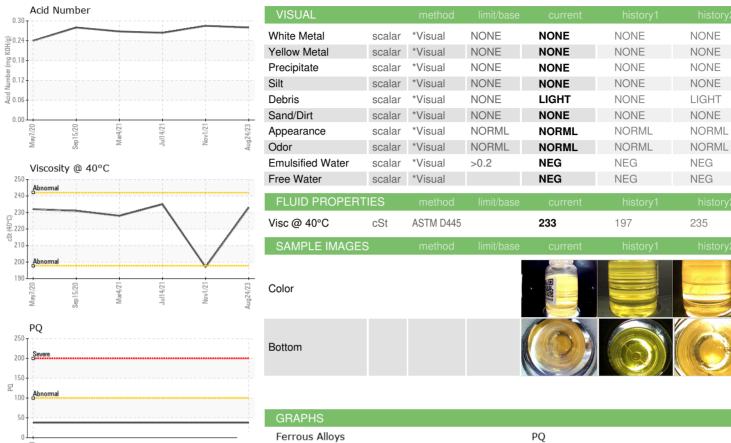

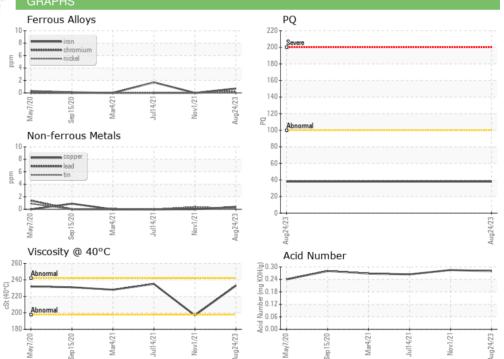





Certificate L2367

Laboratory Sample No. Lab Number **Unique Number** Test Package : PLANT

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 : WC0845488 : 05938373 : 10628985

Received Diagnosed Diagnostician

: 30 Aug 2023 : 31 Aug 2023 : Angela Borella THE BOEING COMPANY 5400 AIRFRAME DR

NORTH CHARLESTON, SC US 29418

Contact: DAN HARRIS

DANIEL.R.HARRIS2@BOEING.COM T: (843)730-0805

To discuss this sample report, contact Customer Service at 1-800-237-1369.

* - Denotes test methods that are outside of the ISO 17025 scope of accreditation. Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

F: