




OIL ANALYSIS REPORT

Sample Rating Trend

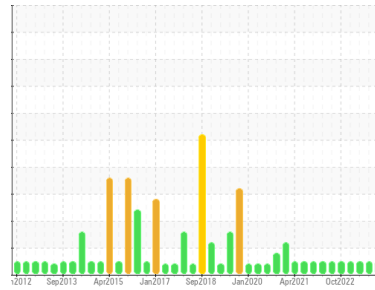

NORMAL



Area

Refrigeration Compressor

Machine Id
FRICK TYSCJ 13FRK (S/N S0014EFPPTHCA3)

Component

Refrigeration Compressor

Fluid

USPI 1009-68 SC (--- QTS)

DIAGNOSIS

Recommendation

Resample at the next service interval to monitor.

Wear

All component wear rates are normal.

Contamination

There is no indication of any contamination in the oil. The amount and size of particulates present in the system are acceptable.

Fluid Condition

The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

SAMPLE INFORMATION

	method	limit/base	current	history1	history2
Sample Number	Client Info		USP249555	USP217370	USP244298
Sample Date	Client Info		26 Aug 2023	28 Jun 2023	10 Mar 2023
Machine Age	hrs	Client Info	14075	0	0
Oil Age	hrs	Client Info	0	0	0
Oil Changed	Client Info		N/A	N/A	N/A
Sample Status			NORMAL	NORMAL	NORMAL

WEAR METALS

	method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m >8	0	0	1
Chromium	ppm	ASTM D5185m >2	0	0	0
Nickel	ppm	ASTM D5185m	0	0	0
Titanium	ppm	ASTM D5185m	0	0	0
Silver	ppm	ASTM D5185m >2	0	0	0
Aluminum	ppm	ASTM D5185m >3	<1	<1	0
Lead	ppm	ASTM D5185m >2	0	0	0
Copper	ppm	ASTM D5185m >8	0	0	0
Tin	ppm	ASTM D5185m >4	0	0	0
Vanadium	ppm	ASTM D5185m	0	0	0
Cadmium	ppm	ASTM D5185m	0	0	0

ADDITIVES

	method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m	0	0	0
Barium	ppm	ASTM D5185m	0	0	0
Molybdenum	ppm	ASTM D5185m	0	0	0
Manganese	ppm	ASTM D5185m	0	0	0
Magnesium	ppm	ASTM D5185m	0	0	0
Calcium	ppm	ASTM D5185m	0	0	0
Phosphorus	ppm	ASTM D5185m	0	0	0
Zinc	ppm	ASTM D5185m	0	0	0
Sulfur	ppm	ASTM D5185m 50	0	0	0

CONTAMINANTS






	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m >15	0	0	0
Sodium	ppm	ASTM D5185m	0	<1	0
Potassium	ppm	ASTM D5185m >20	0	<1	<1
Water	%	ASTM D6304 >0.01	0.001	0.001	0.00
ppm Water	ppm	ASTM D6304 >100	4.6	8.7	0.00

FLUID CLEANLINESS

	method	limit/base	current	history1	history2
Particles >4µm	ASTM D7647		1367	9957	1409
Particles >6µm	ASTM D7647 >2500		277	1701	462
Particles >14µm	ASTM D7647 >320		41	32	20
Particles >21µm	ASTM D7647 >80		11	5	3
Particles >38µm	ASTM D7647 >20		1	0	0
Particles >71µm	ASTM D7647 >4		0	0	0
Oil Cleanliness	ISO 4406 (c)	>--/18/15	18/15/13	20/18/12	18/16/11

FLUID DEGRADATION


	method	limit/base	current	history1	history2
Acid Number (AN)	mg KOH/g	ASTM D974 0.005	0.013	0.015	0.015

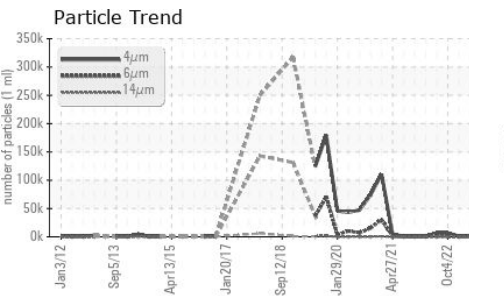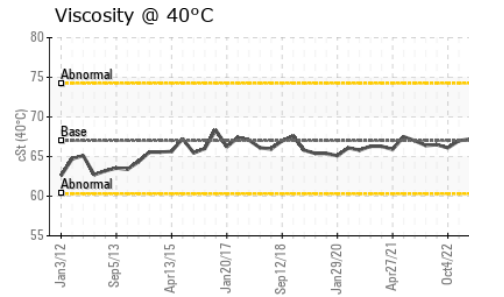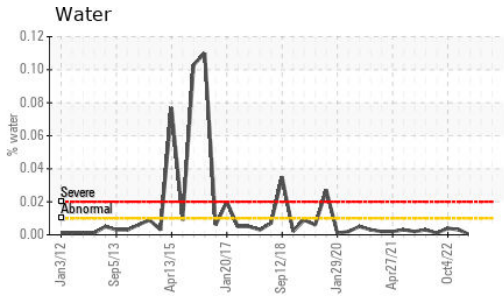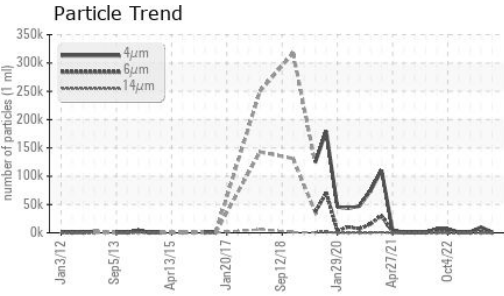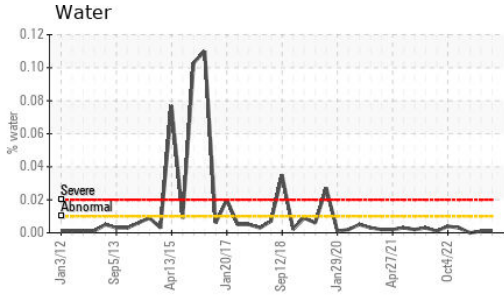






VISUAL	method	limit/base	current	history1	history2
White Metal	scalar	*Visual	NONE	NONE	NONE
Yellow Metal	scalar	*Visual	NONE	NONE	NONE
Precipitate	scalar	*Visual	NONE	NONE	NONE
Silt	scalar	*Visual	NONE	NONE	NONE
Debris	scalar	*Visual	NONE	LIGHT	NONE
Sand/Dirt	scalar	*Visual	NONE	NONE	NONE
Appearance	scalar	*Visual	NORML	NORML	NORML
Odor	scalar	*Visual	NORML	NORML	NORML
Emulsified Water	scalar	*Visual	>0.01	NEG	NEG
Free Water	scalar	*Visual		NEG	NEG

FLUID PROPERTIES	method	limit/base	current	history1	history2
Visc @ 40°C	cSt	ASTM D445	67	65.7	65.3

SAMPLE IMAGES	method	limit/base	current	history1	history2
---------------	--------	------------	---------	----------	----------

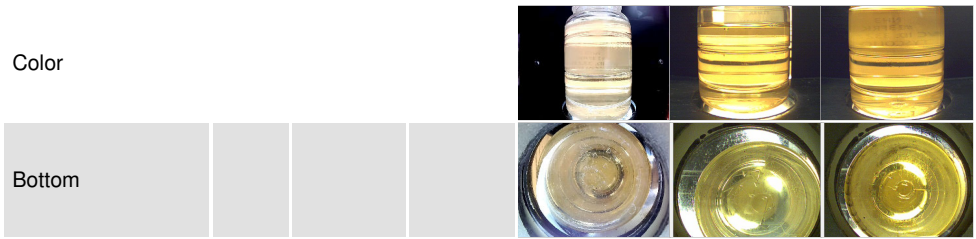

GRAPHS

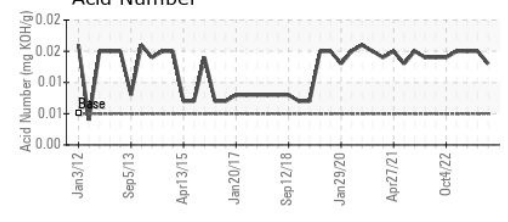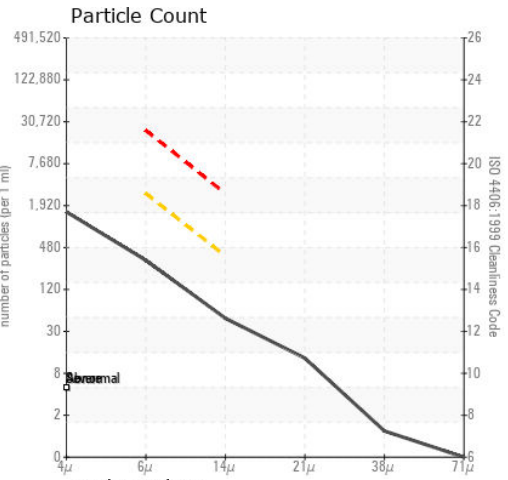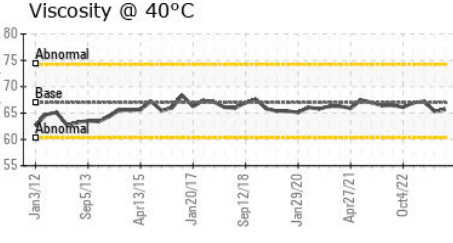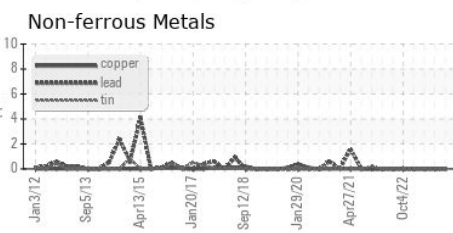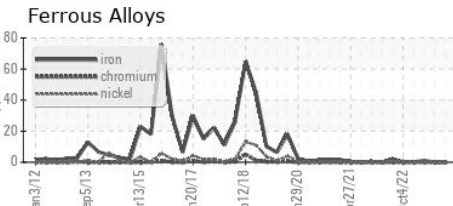

Laboratory : WearCheck USA - 501 Madison Ave., Cary, NC 27513
Sample No. : USP249555 **Received** : 30 Aug 2023
Lab Number : 05938944 **Diagnosed** : 31 Aug 2023
Unique Number : 10629556 **Diagnostician** : Doug Bogart
Test Package : IND 2

TYSON-Columbus Junction-USP
 HWY 70 North, P.O. Box 272
 Columbus Junction, IA
 US 52738
 Contact: THOMAS SCHREIBER
 thomas.schreiber@tyson.com
 T:
 F: (319)753-6235

To discuss this sample report, contact Customer Service at 1-800-237-1369.
 * - Denotes test methods that are outside of the ISO 17025 scope of accreditation.
 Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)