

PROBLEM SUMMARY

Sample Rating Trend


ISO

KAESER 6439383 (S/N 1192)

Compressor

KAESER SIGMA (OEM) M-460 (--- GAL)

COMPONENT CONDITION SUMMARY

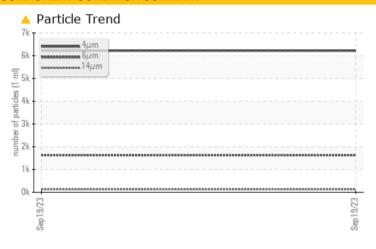

RECOMMENDATION

No corrective action is recommended at this time. The filter change at the time of sampling has been noted. Resample at the next service interval to monitor.

PROBLEMATIC TEST RESULTS									
Sample Status			ATTENTION						
Particles >6µm	ASTM D7647	>1300	1632						
Particles >14µm	ASTM D7647	>80	128						
Particles >21µm	ASTM D7647	>20	A 37						
Oil Cleanliness	ISO 4406 (c)	>/17/13	20/18/14						

Customer Id: RECSANKC Sample No.: KCPA004987 Lab Number: 05960656 Test Package: IND 2



To manage this report scan the QR code

To discuss the diagnosis or test data: Angela Borella +1 800-237-1369 angela.borella@wearcheckusa.com

To change component or sample information: Customer Service +1 1-800-237-1369 customerservice@wearcheck.com

RECOMMENDED ACTIONS

There are no recommended actions for this sample.

HISTORICAL DIAGNOSIS




OIL ANALYSIS REPORT

KAESER 6439383 (S/N 1192)

Compressor

KAESER SIGMA (OEM) M-460 (--- GAL)

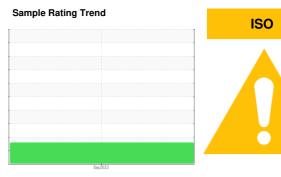

DIAGNOSIS

Recommendation

No corrective action is recommended at this time. The filter change at the time of sampling has been noted. Resample at the next service interval to monitor.

Wear

All component wear rates are normal.

Contamination

There is a moderate amount of particulates present in the oil.

Fluid Condition

The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

				Sep2023		
SAMPLE INFORM	MATION	method	limit/base	current	history1	history2
Sample Number		Client Info		KCPA004987		
Sample Date		Client Info		19 Sep 2023		
Machine Age	hrs	Client Info		14722		
Oil Age	hrs	Client Info		0		
Oil Changed		Client Info		N/A		
Sample Status				ATTENTION		
WEAR METALS		method	limit/base	current	history1	history2
ron	ppm	ASTM D5185m	>50	<1		
Chromium	ppm	ASTM D5185m	>10	0		
Nickel	ppm	ASTM D5185m	>3	0		
Titanium	ppm	ASTM D5185m	>3	0		
Silver	ppm	ASTM D5185m	>2	0		
Aluminum	ppm	ASTM D5185m	>10	0		
_ead	ppm	ASTM D5185m	>10	0		
Copper	ppm	ASTM D5185m	>50	5		
Γin	ppm	ASTM D5185m	>10	<1		
/anadium	ppm	ASTM D5185m		0		
Cadmium	ppm	ASTM D5185m		0		
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m	0	0		
Barium	ppm	ASTM D5185m	90	8		
Molybdenum	ppm	ASTM D5185m	0	<1		
Manganese	ppm	ASTM D5185m		<1		
Magnesium	ppm	ASTM D5185m	100	50		
Calcium	ppm	ASTM D5185m	0	3		
Phosphorus	ppm	ASTM D5185m	0	4		
Zinc	ppm	ASTM D5185m	0	2		
Sulfur	ppm	ASTM D5185m	23500	24391		
CONTAMINANTS	3	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>25	2		
Sodium	ppm	ASTM D5185m		22		
Potassium	ppm	ASTM D5185m	>20	5		
Vater	%	ASTM D6304	>0.05	0.015		
opm Water	ppm	ASTM D6304	>500	156.3		
FLUID CLEANLIN	NESS	method	limit/base	current	history1	history2
Particles >4µm		ASTM D7647		6219		
Particles >6µm		ASTM D7647	>1300	1632		
Particles >14µm		ASTM D7647	>80	<u> </u>		
Particles >21µm		ASTM D7647	>20	A 37		
Particles >38µm		ASTM D7647	>4	2		
Particles >71µm		ASTM D7647	>3	1		
Dil Cleanliness		ISO 4406 (c)	>/17/13	<u>^</u> 20/18/14		
FLUID DEGRADA	ATION	method	limit/base	current	history1	history2
Acid Number (AN)	I/OLI/-	ACTM DOOM	1.0	0.37		


Acid Number (AN)

mg KOH/g ASTM D8045 1.0

0.37



OIL ANALYSIS REPORT

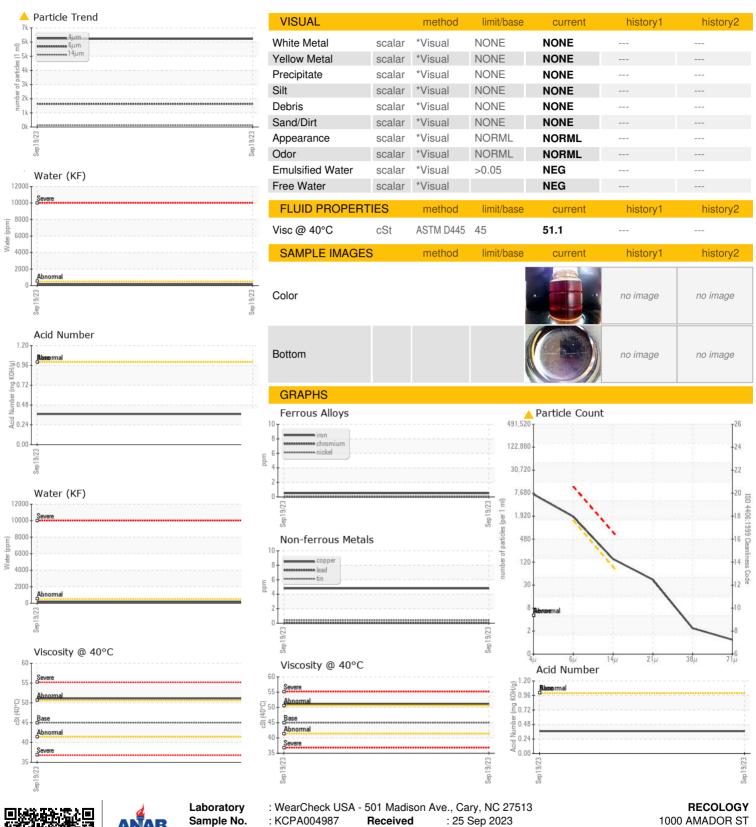



Certificate L2367

Sample No. Lab Number **Unique Number**

: KCPA004987 : 05960656

Received : 10661869

Diagnosed

: 27 Sep 2023 Diagnostician : Angela Borella

Test Package : IND 2 (Additional Tests: KF, PrtCount)

To discuss this sample report, contact Customer Service at 1-800-237-1369. * - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

Contact/Location: Service Manager - RECSANKC

US 94124

T: F:

SAN FRANCISCO, CA

Contact: Service Manager

ESTRACENER@RECOLOGY.COM