

PROBLEM SUMMARY

Sample Rating Trend

ISO


3403404 (S/N 1225)

Component

Compressor

KAESER SIGMA (OEM) M-460 (--- GAL)

COMPONENT CONDITION SUMMARY

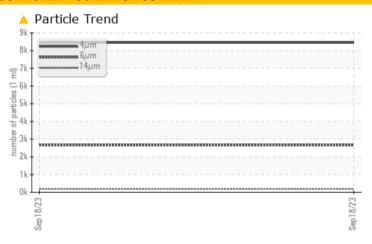

RECOMMENDATION

Oil and filter change at the time of sampling has been noted. No corrective action is recommended at this time. Resample at the next service interval to monitor.

PROBLEMATIC TEST RESULTS							
Sample Status			ABNORMAL				
Particles >6μm	ASTM D7647	>1300	^ 2664				
Particles >14μm	ASTM D7647	>80	189				
Particles >21µm	ASTM D7647	>20	42				
Oil Cleanliness	ISO 4406 (c)	>/17/13	20/19/15				

Customer Id: MAGSANCA Sample No.: KCP40094D Lab Number: 05964212 Test Package: IND 2



To manage this report scan the QR code

To discuss the diagnosis or test data:

Don Baldridge +1 don.b505@comcast.net

To change component or sample information: Customer Service +1 1-800-237-1369 customerservice@wearcheck.com

RECOMMENDED ACTIONS							
Action	Status	Date	Done By	Description			
Change Fluid			?	Oil and filter change at the time of sampling has been noted.			
Change Filter			?	Oil and filter change at the time of sampling has been noted.			

HISTORICAL DIAGNOSIS




OIL ANALYSIS REPORT

3403404 (S/N 1225)

Compressor

KAESER SIGMA (OEM) M-460 (--- GAL)

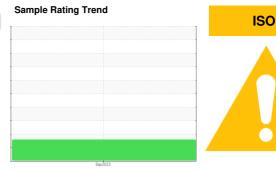

DIAGNOSIS

Recommendation

Oil and filter change at the time of sampling has been noted. No corrective action is recommended at this time. Resample at the next service interval to monitor.

Wear

All component wear rates are normal.

Contamination

There is a high amount of particulates present in the oil.

Fluid Condition

The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

				Sep2023		
SAMPLE INFORM	MATION	method	limit/base	current	history1	history2
Sample Number		Client Info		KCP40094D		
Sample Date		Client Info		18 Sep 2023		
Machine Age	hrs	Client Info		84690		
Oil Age	hrs	Client Info		0		
Oil Changed		Client Info		Changed		
Sample Status				ABNORMAL		
WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>50	0		
Chromium	ppm	ASTM D5185m	>10	0		
Nickel	ppm	ASTM D5185m	>3	0		
Titanium	ppm	ASTM D5185m	>3	0		
Silver	ppm	ASTM D5185m	>2	0		
Aluminum	ppm	ASTM D5185m	>10	0		
Lead	ppm	ASTM D5185m	>10	0		
Copper	ppm	ASTM D5185m	>50	2		
Tin	ppm	ASTM D5185m	>10	0		
Vanadium	ppm	ASTM D5185m		0		
Cadmium	ppm	ASTM D5185m		0		
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m	0	0		
Barium	ppm	ASTM D5185m	90	51		
Molybdenum	ppm	ASTM D5185m	0	0		
Manganese	ppm	ASTM D5185m		<1		
Magnesium	ppm	ASTM D5185m	100	70		
Calcium	ppm	ASTM D5185m	0	1		
Phosphorus	ppm	ASTM D5185m	0	0		
Zinc	ppm	ASTM D5185m	0	0		
Sulfur	ppm	ASTM D5185m	23500	20301		
CONTAMINANTS)	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>25	<1		
Sodium	ppm	ASTM D5185m		1		
Potassium	ppm	ASTM D5185m	>20	1		
Water	%	ASTM D6304	>0.05	0.027		
ppm Water	ppm	ASTM D6304	>500	277.6		
FLUID CLEANLIN	IESS	method	limit/base	current	history1	history2
Particles >4μm		ASTM D7647		8451		
Particles >6µm		ASTM D7647	>1300	^ 2664		
Particles >14μm		ASTM D7647	>80	<u> </u>		
Particles >21μm		ASTM D7647	>20	42		
Particles >38μm		ASTM D7647	>4	2		
Particles >71μm		ASTM D7647	>3	0		
Oil Cleanliness		ISO 4406 (c)	>/17/13	<u>^</u> 20/19/15		
FLUID DEGRADA	TION	method	limit/base	current	history1	history2
Acid Number (AN)	mg KOH/g	ASTM D8045	1.0	0.43		



OIL ANALYSIS REPORT





Certificate L2367

Sample No. Lab Number **Unique Number**

: KCP40094D : 05964212 : 10670763

Received : 28 Sep 2023 Diagnosed

: 01 Oct 2023

Diagnostician : Don Baldridge Test Package : IND 2 (Additional Tests: KF, PrtCount)

To discuss this sample report, contact Customer Service at 1-800-237-1369.

Contact: Service Manager MAGICSPRAY@SBCGLOBAL.NET

* - Denotes test methods that are outside of the ISO 17025 scope of accreditation. Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

Contact/Location: Service Manager - MAGSANCA

US 95054

T:

F:

SANTA CLARA, CA