

# **PROBLEM SUMMARY**

Sample Rating Trend

**VISCOSITY** 

# TECO-WESTINGHOUSE 501 MOTOR (S/N WZFD149324T1-2)


**Rear Pump** 

**ROYAL PURPLE SYNFILM 32 (--- QTS)** 





# **COMPONENT CONDITION SUMMARY**

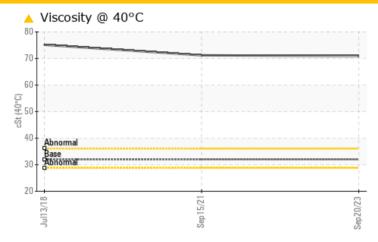

# RECOMMENDATION

No corrective action is recommended at this time. Resample at the next service interval to monitor.

PROBLEMATIC TEST RESULTS										
Sample Status				ATTENTION	ATTENTION	ATTENTION				
Visc @ 40°C	cSt	ASTM D445	32	<b>^</b> 70.9	<u>^</u> 71.2	<b>△</b> 75.17				

Customer Id: KINSMI Sample No.: RP0026762 Lab Number: 05964258 Test Package: IND 2

To manage this report scan the QR code

To discuss the diagnosis or test data:

Don Baldridge +1 don.b505@comcast.net

To change component or sample information: Customer Service +1 1-800-237-1369 customerservice@wearcheck.com

# **RECOMMENDED ACTIONS**

There are no recommended actions for this sample.

# HISTORICAL DIAGNOSIS

# 15 Sep 2021 Diag: Don Baldridge

### VISCOSITY



No corrective action is recommended at this time. Resample at the next service interval to monitor. All component wear rates are normal. There is no indication of any contamination in the oil. Viscosity of sample indicates oil is within ISO 68 range, advise investigate. Confirm oil type. The AN level is acceptable for this fluid.



# 13 Jul 2018 Diag: Jonathan Hester

### VISCOSITY



No corrective action is recommended at this time. Resample at the next service interval to monitor. All component wear rates are normal. There is no indication of any contamination in the oil. Viscosity of sample indicates oil is within ISO 68 range, advise investigate. Confirm oil type. The AN level is acceptable for this fluid.





# **OIL ANALYSIS REPORT**

## Sample Rating Trend

# **VISCOSITY**

# TECO-WESTINGHOUSE 501 MOTOR (S/N WZFD149324T1-2)

**Rear Pump** 

**ROYAL PURPLE SYNFILM 32 (--- QTS)** 

# **DIAGNOSIS**

### Recommendation

No corrective action is recommended at this time. Resample at the next service interval to monitor.

All component wear rates are normal.

# Contamination

There is no indication of any contamination in the


### ▲ Fluid Condition

Viscosity of sample indicates oil is within ISO 68 range, advise investigate. Confirm oil type. The AN level is acceptable for this fluid.

	Jui2018 Sep.2021 Sep.2023					
SAMPLE INFORM	MATION	method	limit/base	current	history1	history2
Sample Number		Client Info		RP0026762	RP0005020	RP156626
Sample Date		Client Info		20 Sep 2023	15 Sep 2021	13 Jul 2018
Machine Age	hrs	Client Info		10637	8061	3808
Oil Age	hrs	Client Info		0	0	1888
Oil Changed		Client Info		Not Changd	N/A	N/A
Sample Status				ATTENTION	ATTENTION	ATTENTION
WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>90	0	<1	<1
Chromium	ppm	ASTM D5185m	>5	0	0	0
Nickel	ppm	ASTM D5185m	>5	0	0	0
Titanium	ppm	ASTM D5185m	>3	<1	0	0
Silver	ppm	ASTM D5185m	>3	0	<1	0
Aluminum	ppm	ASTM D5185m	>7	2	<1	<1
Lead	ppm	ASTM D5185m	>12	0	0	0
Copper	ppm	ASTM D5185m	>30	0	0	0
Tin	ppm	ASTM D5185m	>9	0	0	0
Antimony	ppm	ASTM D5185m			0	0
Vanadium	ppm	ASTM D5185m		0	0	0
Cadmium	ppm	ASTM D5185m		0	0	0
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m		0	<1	<1
Barium	ppm	ASTM D5185m		0	0	0
Molybdenum	ppm	ASTM D5185m		0	0	0
Manganese	ppm	ASTM D5185m		0	0	0
Magnesium	ppm	ASTM D5185m	90	74	77	77
Calcium	ppm	ASTM D5185m		0	0	<1
Phosphorus	ppm	ASTM D5185m		0	4	<1
Zinc	ppm	ASTM D5185m		0	0	1
CONTAMINANTS	;	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>60	<1	<1	2
Sodium	ppm	ASTM D5185m		<1	0	<1
Potassium	ppm	ASTM D5185m	>20	0	0	<1
Water	%	ASTM D6304	>.1	0.009	0.022	0.028
ppm Water	ppm	ASTM D6304	>1000	94.0	229.9	280
FLUID DEGRADA	NOITA	method	limit/base	current	history1	history2
Acid Number (AN)	mg KOH/g	ASTM D8045		0.38	0.350	0.311



# **OIL ANALYSIS REPORT**

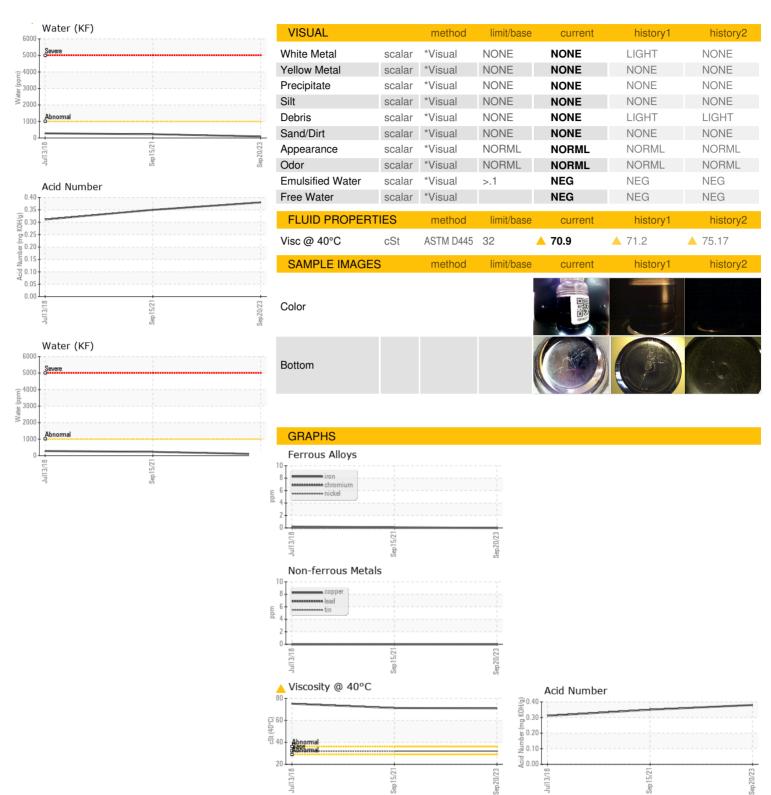





Certificate L2367

Laboratory Sample No. Lab Number **Unique Number** Test Package : IND 2

: 05964258

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 : RP0026762 : 10670809

Received : 28 Sep 2023 : 01 Oct 2023 Diagnosed Diagnostician : Don Baldridge KINDER MORGAN 5877 CR 210

SMILEY, TX US 78159

Contact: JOHN EVANS john\_evans@kindermorgan.com

To discuss this sample report, contact Customer Service at 1-800-237-1369. \* - Denotes test methods that are outside of the ISO 17025 scope of accreditation. Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

F:

T: