

# **PROBLEM SUMMARY**

KAESER 7019122


Component

Compressor

KAESER SIGMA (OEM) S-460 (--- QTS)

# Sample Rating Trend ISO

### **COMPONENT CONDITION SUMMARY**

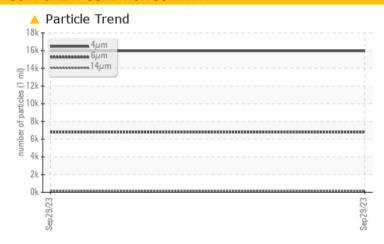

### RECOMMENDATION

No corrective action is recommended at this time. The filter change at the time of sampling has been noted. Resample at the next service interval to monitor.

PROBLEMATIC TEST RESULTS									
Sample Status			ABNORMAL						
Particles >6μm	ASTM D7647	>1300	<u>▲</u> 6781						
Particles >14µm	ASTM D7647	>80	<b>149</b>						
Particles >21µm	ASTM D7647	>20	<b>4</b> 24						
Oil Cleanliness	ISO 4406 (c)	>/17/13	<b>21/20/14</b>						

Customer Id: DUNBUF Sample No.: KCPA006152 Lab Number: 05967090 Test Package: IND 2



To manage this report scan the QR code

To discuss the diagnosis or test data:

Don Baldridge +1 don.b505@comcast.net

To change component or sample information: Customer Service +1 1-800-237-1369 customerservice@wearcheck.com

## RECOMMENDED ACTIONS

There are no recommended actions for this sample.

## HISTORICAL DIAGNOSIS



# **OIL ANALYSIS REPORT**

# **KAESER 7019122**

Component

Compressor

KAESER SIGMA (OEM) S-460 (--- QTS)

# Sample Rating Trend ISO

## **DIAGNOSIS**

### Recommendation

No corrective action is recommended at this time. The filter change at the time of sampling has been noted. Resample at the next service interval to monitor.

### Wear

All component wear rates are normal.

### Contamination

There is a high amount of particulates present in the oil.

### **Fluid Condition**

The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

				Sep 2023		
SAMPLE INFORM	MATION	method	limit/base	current	history1	history2
Sample Number		Client Info		KCPA006152		
Sample Date		Client Info		29 Sep 2023		
Machine Age	hrs	Client Info		9415		
Oil Age	hrs	Client Info		0		
Oil Changed		Client Info		N/A		
Sample Status				ABNORMAL		
WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>50	0		
Chromium	ppm	ASTM D5185m	>10	0		
Nickel	ppm	ASTM D5185m	>3	0		
Titanium	ppm	ASTM D5185m	>3	0		
Silver	ppm	ASTM D5185m	>2	0		
Aluminum	ppm	ASTM D5185m	>10	1		
Lead	ppm	ASTM D5185m	>10	0		
Copper	ppm	ASTM D5185m	>50	24		
Tin	ppm	ASTM D5185m	>10	0		
Vanadium	ppm	ASTM D5185m		0		
Cadmium	ppm	ASTM D5185m		0		
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m		0		
Barium	ppm	ASTM D5185m	90	0		
Molybdenum	ppm	ASTM D5185m		0		
Manganese	ppm	ASTM D5185m		0		
Magnesium	ppm	ASTM D5185m	90	11		
Calcium	ppm	ASTM D5185m	2	0		
Phosphorus	ppm	ASTM D5185m		2		
Zinc	ppm	ASTM D5185m		15		
Sulfur	ppm	ASTM D5185m		20217		
CONTAMINANTS	3	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>25	0		
Sodium	ppm	ASTM D5185m		0		
Potassium	ppm	ASTM D5185m	>20	2		
Water	%	ASTM D6304	>0.05	0.007		
ppm Water	ppm	ASTM D6304	>500	71.6		
FLUID CLEANLIN	IESS	method	limit/base	current	history1	history2
Particles >4μm		ASTM D7647		15967		
Particles >6µm		ASTM D7647	>1300	<u>^</u> 6781		
Particles >14μm		ASTM D7647	>80	<u> </u>		
Particles >21µm		ASTM D7647	>20	<u>^</u> 24		
Particles >38µm		ASTM D7647	>4	1		
Particles >71µm		ASTM D7647	>3	0		
Oil Cleanliness		ISO 4406 (c)	>/17/13	<u>^</u> 21/20/14		
FLUID DEGRADA	ATION	method	limit/base	current	history1	history2
Acid Number (AN)	mg KOH/g	ASTM D8045	0.4	0.28		



## **OIL ANALYSIS REPORT**





Certificate L2367

Sample No. Lab Number **Unique Number** 

: KCPA006152

: 05967090 : 10673641

Received Diagnosed

: 04 Oct 2023 Diagnostician : Don Baldridge

Test Package : IND 2 ( Additional Tests: KF, PrtCount ) To discuss this sample report, contact Customer Service at 1-800-237-1369.

\* - Denotes test methods that are outside of the ISO 17025 scope of accreditation. Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012) 3424 SHERIDAN DR BUFFALO, NY US 14226

Contact: Service Manager

T:

F: