

PROBLEM SUMMARY

Sample Rating Trend


ISO

US119315 (S/N CP86813)

Hydraulic System

AW HYDRAULIC OIL ISO 32 (--- GAL)



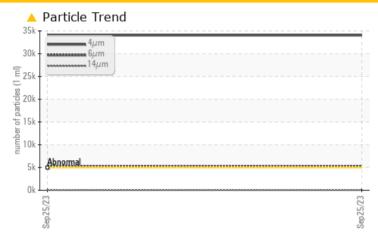

RECOMMENDATION

We recommend you service the filters on this component. Resample at the next service interval to monitor.

PROBLEMATIC TEST RESULTS								
Sample Status			ABNORMAL					
Particles >4μm	ASTM D7647	>5000	4 34044					
Particles >6µm	ASTM D7647	>1300	5197					
Oil Cleanliness	ISO 4406 (c)	>19/17/14	A 22/20/13					

Customer Id: TKEKIR Sample No.: BB0000015 Lab Number: 05967743 Test Package: PLANT

To manage this report scan the QR code

To discuss the diagnosis or test data: Angela Borella +1 800-237-1369 angela.borella@wearcheckusa.com

To change component or sample information: Customer Service +1 1-800-237-1369 customerservice@wearcheck.com

RECOMMENDED ACTIONS							
Action	Status	Date	Done By	Description			
Change Filter			?	We recommend you service the filters on this component.			

HISTORICAL DIAGNOSIS



OIL ANALYSIS REPORT

Sample Rating Trend

ISO

US119315 (S/N CP86813)

Component

Hydraulic System

AW HYDRAULIC OIL ISO 32 (--- GAL)

DIAGNOSIS

Recommendation

We recommend you service the filters on this component. Resample at the next service interval to monitor.

Wear

All component wear rates are normal.

Contamination

There is a high amount of silt (particulates < 14 microns in size) present in the oil.

Fluid Condition

The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.


				Sep2023		
SAMPLE INFORM	MATION	method	limit/base	current	history1	history2
Sample Number		Client Info		BB0000015		
Sample Date		Client Info		25 Sep 2023		
Machine Age	hrs	Client Info		0		
Oil Age	hrs	Client Info		0		
Oil Changed		Client Info		N/A		
Sample Status				ABNORMAL		
WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>20	2		
Chromium	ppm	ASTM D5185m	>20	0		
Nickel	ppm	ASTM D5185m	>20	0		
Titanium	ppm	ASTM D5185m		0		
Silver	ppm	ASTM D5185m		0		
Aluminum	ppm	ASTM D5185m	>20	0		
Lead	ppm	ASTM D5185m	>20	0		
Copper	ppm	ASTM D5185m	>20	<1		
Tin	ppm	ASTM D5185m	>20	<1		
Vanadium	ppm	ASTM D5185m		0		
Cadmium	ppm	ASTM D5185m		0		
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m	5	0		
Barium	ppm	ASTM D5185m	5	0		
Molybdenum	ppm	ASTM D5185m	5	0		
Manganese	ppm	ASTM D5185m		0		
Magnesium	ppm	ASTM D5185m	25	<1		
Calcium	ppm	ASTM D5185m	200	61		
Phosphorus	ppm	ASTM D5185m	300	334		
Zinc	ppm	ASTM D5185m	370	414		
Sulfur	ppm	ASTM D5185m	2500	4577		
CONTAMINANTS	;	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>15	2		
Sodium	ppm	ASTM D5185m		0		
Potassium	ppm	ASTM D5185m	>20	1		
FLUID CLEANLIN	IESS	method	limit/base	current	history1	history2
Particles >4µm		ASTM D7647	>5000	▲ 34044		
Particles >6µm		ASTM D7647	>1300	<u> </u>		
Particles >14µm		ASTM D7647	>160	55		
Particles >21µm		ASTM D7647	>40	4		
Particles >38µm		ASTM D7647	>10	0		
Particles >71µm		ASTM D7647	>3	0		
Oil Cleanliness		ISO 4406 (c)	>19/17/14	<u>22/20/13</u>		
FLUID DEGRADA	ATION	method	limit/base	current	history1	history2

Acid Number (AN) mg KOH/g ASTM D8045 0.57

0.28



OIL ANALYSIS REPORT

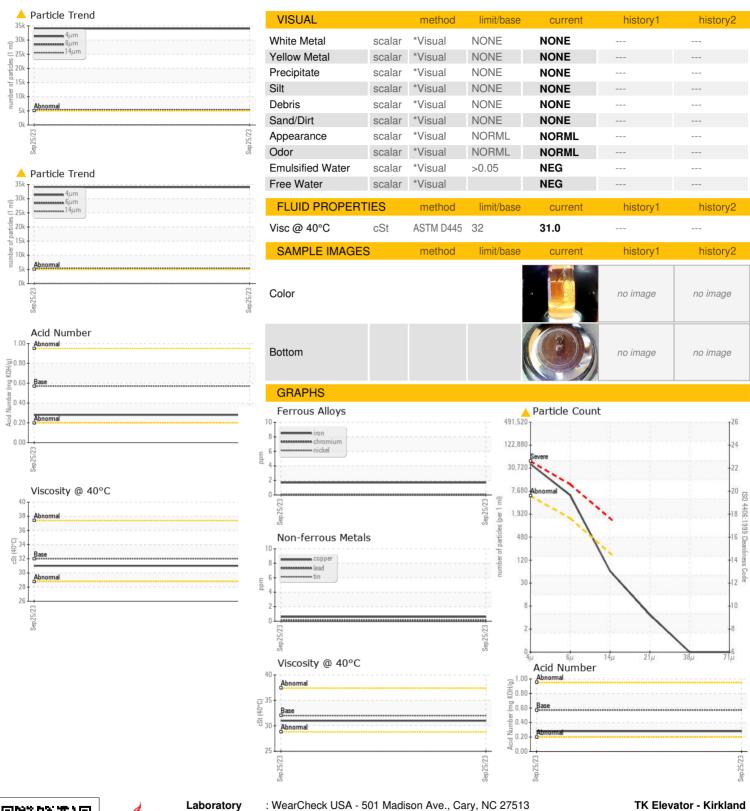



Certificate L2367

Laboratory Sample No. Lab Number Unique Number

: BB0000015 : 05967743 : 10674294

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 Test Package : PLANT

Received : 03 Oct 2023 Diagnosed : 05 Oct 2023 : Angela Borella Diagnostician

Kirkland, WA US 98034 Contact: Chuck Rife chuck.rife@tkelevator.com

To discuss this sample report, contact Customer Service at 1-800-237-1369. * - Denotes test methods that are outside of the ISO 17025 scope of accreditation. Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

Report Id: TKEKIR [WUSCAR] 05967743 (Generated: 10/05/2023 13:52:30) Rev: 1

Contact/Location: Chuck Rife - TKEKIR

T:

F:

12530 135th Ave NE