

### **PROBLEM SUMMARY**

Sample Rating Trend

**WATER** 

## 5711806 (S/N NOT GIVEN)


Component

Compressor

KAESER SIGMA (OEM) FG-460 (--- GAL)



### **COMPONENT CONDITION SUMMARY**

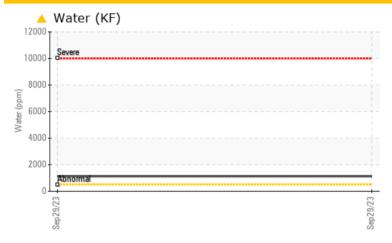

### RECOMMENDATION

The filter change at the time of sampling has been noted. We advise that you stop the unit and follow the water drain-off procedure for this component. We recommend an early resample in 500 hours to monitor this condition.

PROBLEMATIC TEST RESULTS										
Sample Status				ABNORMAL						
Water	%	ASTM D6304	>0.05	<b>△</b> 0.113						
ppm Water	ppm	ASTM D6304	>500	<b>1130</b>						

Customer Id: MORSIL Sample No.: KCPA002885 Lab Number: 05969669 Test Package: IND 2

To manage this report scan the QR code

To discuss the diagnosis or test data: Doug Bogart +1 (800)237-1369 x4016 dougb@wearcheckusa.com

To change component or sample information: Customer Service +1 1-800-237-1369 customerservice@wearcheck.com

### RECOMMENDED ACTIONS

There are no recommended actions for this sample.

### HISTORICAL DIAGNOSIS



**OIL ANALYSIS REPORT** 

### 5711806 (S/N NOT GIVEN)

Compressor

KAESER SIGMA (OEM) FG-460 (--- GAL)

# Sample Rating Trend **WATER**

### **DIAGNOSIS**

### Recommendation

The filter change at the time of sampling has been noted. We advise that you stop the unit and follow the water drain-off procedure for this component. We recommend an early resample in 500 hours to monitor this condition.

### Wear

All component wear rates are normal.

### Contamination

There is a light concentration of water present in the oil. The amount and size of particulates present in the system are acceptable.

### **Fluid Condition**

The AN level is acceptable for this fluid. The condition of the oils additive package is suitable for further service.

0.44.54.5.4.5				Sep2023		
SAMPLE INFORM	MATION	method	limit/base	current	history1	history2
Sample Number		Client Info		KCPA002885		
Sample Date		Client Info		29 Sep 2023		
Machine Age	hrs	Client Info		21699		
Oil Age	hrs	Client Info		0		
Oil Changed		Client Info		N/A		
Sample Status				ABNORMAL		
WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>50	<1		
Chromium	ppm	ASTM D5185m	>10	0		
Nickel	ppm	ASTM D5185m	>3	0		
Titanium	ppm	ASTM D5185m	>3	0		
Silver	ppm	ASTM D5185m	>2	0		
Aluminum	ppm	ASTM D5185m	>10	4		
Lead	ppm	ASTM D5185m	>10	0		
Copper	ppm	ASTM D5185m	>50	3		
Tin	ppm	ASTM D5185m	>10	0		
Vanadium	ppm	ASTM D5185m		0		
Cadmium	ppm	ASTM D5185m		0		
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m		0		
Barium	ppm	ASTM D5185m		0		
Molybdenum	ppm	ASTM D5185m		0		
Manganese	ppm	ASTM D5185m		0		
Magnesium	ppm	ASTM D5185m		<1		
Calcium	ppm	ASTM D5185m		0		
Phosphorus	ppm	ASTM D5185m	500	96		
Zinc	ppm	ASTM D5185m	000	26		
Sulfur		ASTM D5185m		87		
	ppm			67		
CONTAMINANTS		method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>25	<1		
Sodium	ppm	ASTM D5185m		3		
Potassium	ppm	ASTM D5185m	>20	2		
Water	%	ASTM D6304	>0.05	<b>△</b> 0.113		
ppm Water	ppm	ASTM D6304	>500	<b>▲</b> 1130		
FLUID CLEANLIN	IESS	method	limit/base	current	history1	history2
Particles >4µm		ASTM D7647		1563		
Particles >6µm		ASTM D7647	>1300	278		
Particles >14µm		ASTM D7647	>80	36		
Particles >21µm		ASTM D7647	>20	14		
Particles >38µm		ASTM D7647	>4	0		
Particles >71µm		ASTM D7647	>3	0		
Oil Cleanliness		ISO 4406 (c)	>/17/13	18/15/12		
FLUID DEGRADA	TION	method	limit/base	current	history1	history2
Acid Number (AN)	mg KOH/g	ASTM D8045	1.5	1.70		



### **OIL ANALYSIS REPORT**





Certificate L2367

Sample No. Lab Number **Unique Number** 

: KCPA002885 : 05969669 : 10676220

Received Diagnosed

: 17 Oct 2023 Diagnostician : Doug Bogart

Test Package : IND 2 ( Additional Tests: KF, PrtCount ) To discuss this sample report, contact Customer Service at 1-800-237-1369.

\* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

US 14550 Contact: Service Manager

T: F: