


# **PROBLEM SUMMARY**

# Sample Rating Trend

### Machine Id 8501474 (S/N 1209) Component

Compressor Fluid KAESER SIGMA (OEM) M-460 (--- GAL)

### COMPONENT CONDITION SUMMARY

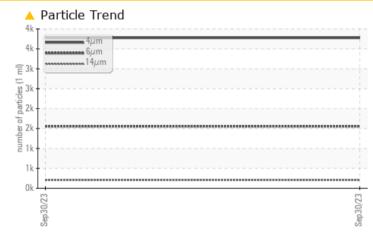

### RECOMMENDATION

No corrective action is recommended at this time. The filter change at the time of sampling has been noted. Resample at the next service interval to monitor.

### PROBLEMATIC TEST RESULTS

Sample Status		ABNORMAL	 
Particles >6µm	ASTM D7647 >		 
l l			
Particles >14µm	ASTM D7647 >		 
Particles >21µm	ASTM D7647 >	>20 🔺 57	 
Oil Cleanliness	ISO 4406 (c) >	>/17/13 🔺 19/18/15	 

Customer Id: TINCON Sample No.: KCPA006213 Lab Number: 05978940 Test Package: IND 2



To manage this report scan the QR code

*To discuss the diagnosis or test data:* Don Baldridge +1 <u>don.b505@comcast.net</u>

*To change component or sample information:* Customer Service +1 1-800-237-1369 <u>customerservice@wearcheck.com</u> There are no recommended actions for this sample.

HISTORICAL DIAGNOSIS



## **OIL ANALYSIS REPORT**





Machine Id 8501474 (S/N 1209) Component

Compressor Fluid KAESER SIGMA (OEM) M-460 (--- GAL)

### DIAGNOSIS

### Recommendation

No corrective action is recommended at this time. The filter change at the time of sampling has been noted. Resample at the next service interval to monitor.

### Wear

All component wear rates are normal.

### Contamination

There is a high amount of particulates present in the oil.


### Fluid Condition


The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.


SAMPLE INFORM	<b>IATION</b>	method	limit/base	current	history1	history2
Sample Number		Client Info		KCPA006213		
Sample Date		Client Info		30 Sep 2023		
Machine Age	hrs	Client Info		1805		
Oil Age	hrs	Client Info		0		
Oil Changed		Client Info		N/A		
Sample Status				ABNORMAL		
WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>50	0		
Chromium	ppm	ASTM D5185m	>10	0		
Nickel	ppm	ASTM D5185m	>3	0		
Titanium	ppm	ASTM D5185m	>3	0		
Silver	ppm	ASTM D5185m	>2	0		
Aluminum	ppm	ASTM D5185m	>10	<1		
Lead	ppm	ASTM D5185m	>10	0		
Copper	ppm	ASTM D5185m	>50	3		
Tin	ppm	ASTM D5185m	>10	0		
Vanadium	ppm	ASTM D5185m		0		
Cadmium	ppm	ASTM D5185m		0		
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m	0	0		
Barium	ppm	ASTM D5185m	90	0		
Molybdenum	ppm	ASTM D5185m	0	0		
Manganese	ppm	ASTM D5185m		<1		
Magnesium	ppm	ASTM D5185m	100	39		
Calcium	ppm	ASTM D5185m	0	2		
Phosphorus	ppm	ASTM D5185m	0	<1		
Zinc	ppm	ASTM D5185m	0	4		
Sulfur	ppm	ASTM D5185m	23500	17362		
CONTAMINANTS	5	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>25	0		
Sodium	ppm	ASTM D5185m		12		
Potassium	ppm	ASTM D5185m	>20	15		
Water	%	ASTM D6304	>0.05	0.020		
ppm Water	ppm	ASTM D6304	>500	204.7		
FLUID CLEANLIN	IESS	method	limit/base	current	history1	history2
Particles >4µm		ASTM D7647		3774		
Particles >6µm		ASTM D7647	>1300	<u> </u>		
Particles >14µm		ASTM D7647	>80	<u> </u>		
Particles >21µm		ASTM D7647	>20	<u> </u>		
Particles >38µm		ASTM D7647	>4	3		
Particles >71µm		ASTM D7647	>3	0		
Oil Cleanliness		ISO 4406 (c)	>/17/13	<b>A</b> 19/18/15		
FLUID DEGRADA	TION	method	limit/base	current	history1	history2
Acid Number (AN)	mg KOH/g	ASTM D8045	1.0	0.33		




# **OIL ANALYSIS REPORT**

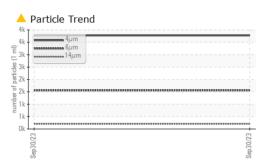

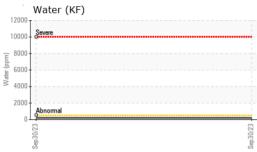

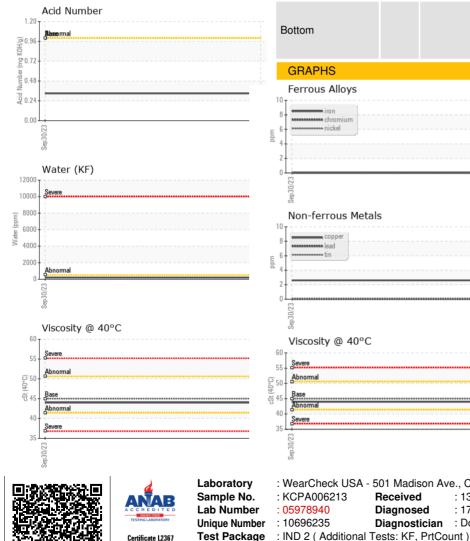

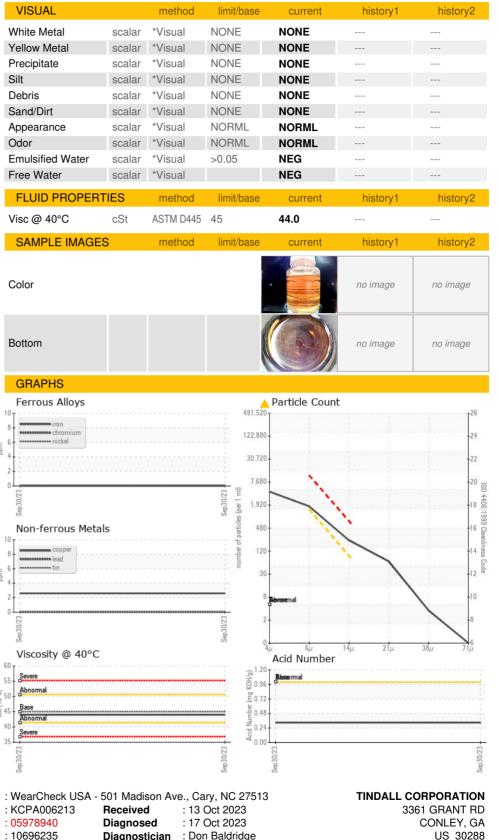

markocunningham@tindallcorp.com To discuss this sample report, contact Customer Service at 1-800-237-1369. \* - Denotes test methods that are outside of the ISO 17025 scope of accreditation. Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

Contact: MARKO CUNNINGHAM

T: F: