

## **PROBLEM SUMMARY**

Sample Rating Trend

ISO


# **KAESER AIRTOWER 7.5C 7280023 (S/N 1077)**

Component

Compressor

KAESER SIGMA (OEM) M-460 (--- GAL)

### **COMPONENT CONDITION SUMMARY**

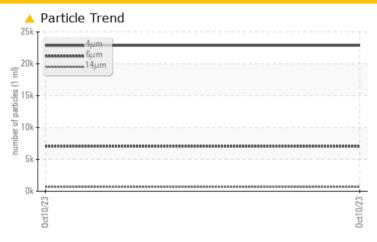

### RECOMMENDATION

The filter change at the time of sampling has been noted. Resample at the next service interval to monitor.

PROBLEMATIC TEST RESULTS									
Sample Status			ABNORMAL						
Particles >6µm	ASTM D7647	>1300	<b>^</b> 7039						
Particles >14µm	ASTM D7647	>80	<b>△</b> 682						
Particles >21µm	ASTM D7647	>20	<b>186</b>						
Particles >38µm	ASTM D7647	>4	<u>^</u> 7						
Oil Cleanliness	ISO 4406 (c)	>/17/13	<u>22/20/17</u>						

Customer Id: UCLLOS Sample No.: KCPA005723 Lab Number: 05981250 Test Package: IND 2



To manage this report scan the QR code

To discuss the diagnosis or test data: Jonathan Hester +1 919-379-4092 x4092 jhester@wearcheckusa.com

To change component or sample information: Customer Service +1 1-800-237-1369 customerservice@wearcheck.com

## RECOMMENDED ACTIONS

There are no recommended actions for this sample.

## HISTORICAL DIAGNOSIS



## **OIL ANALYSIS REPORT**

Sample Rating Trend

ISO

## KAESER AIRTOWER 7.5C 7280023 (S/N 1077)

Compressor

KAESER SIGMA (OEM) M-460 (--- GAL)



## **DIAGNOSIS**

### Recommendation

The filter change at the time of sampling has been noted. Resample at the next service interval to monitor.

All component wear rates are normal.

## Contamination

There is a high amount of particulates present in the oil.


### **Fluid Condition**

The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

				Oct2023		
SAMPLE INFORM	MATION	method	limit/base	current	history1	history2
Sample Number		Client Info		KCPA005723		
Sample Date		Client Info		10 Oct 2023		
Machine Age	hrs	Client Info		18114		
Oil Age	hrs	Client Info		0		
Oil Changed		Client Info		N/A		
Sample Status				ABNORMAL		
WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>50	0		
Chromium	ppm	ASTM D5185m	>10	0		
Nickel	ppm	ASTM D5185m	>3	0		
Titanium	ppm	ASTM D5185m	>3	0		
Silver	ppm	ASTM D5185m	>2	0		
Aluminum	ppm	ASTM D5185m	>10	0		
Lead	ppm	ASTM D5185m	>10	0		
Copper	ppm	ASTM D5185m	>50	17		
Tin	ppm	ASTM D5185m	>10	0		
Vanadium	ppm	ASTM D5185m		0		
Cadmium	ppm	ASTM D5185m		0		
ADDITIVES		method	limit/base	current	history1	history2
Boron	nnm	ASTM D5185m	0	0		
Barium	ppm	ASTM D5185m	90	0		
	ppm			0		
Molybdenum	ppm	ASTM D5185m	0	0		
Manganese	ppm	ASTM D5185m	100	_		
Magnesium	ppm	ASTM D5185m	100	22		
Calcium	ppm	ASTM D5185m	0	0		
Phosphorus	ppm	ASTM D5185m	0	0		
Zinc	ppm	ASTM D5185m	0	2		
Sulfur	ppm	ASTM D5185m	23500	16265		
CONTAMINANTS	3	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>25	0		
Sodium	ppm	ASTM D5185m		6		
Potassium	ppm	ASTM D5185m		0		
Water	%	ASTM D6304	>0.05	0.020		
ppm Water	ppm	ASTM D6304	>500	204.3		
FLUID CLEANLIN	NESS	method	limit/base	current	history1	history2
Particles >4μm		ASTM D7647		22871		
Particles >6μm		ASTM D7647		<u>^</u> 7039		
Particles >14μm		ASTM D7647	>80	<b>▲</b> 682		
Particles >21μm		ASTM D7647	>20	<u> </u>		
Particles >38μm		ASTM D7647	>4	<u>^</u> 7		
Particles >71µm		ASTM D7647	>3	0		
Oil Cleanliness		ISO 4406 (c)	>/17/13	<u>22/20/17</u>		
FLUID DEGRADA	NOITA	method	limit/base	current	history1	history2
Acid Number (AN)	mg KOH/g	ASTM D8045	1.0	0.37		



## **OIL ANALYSIS REPORT**

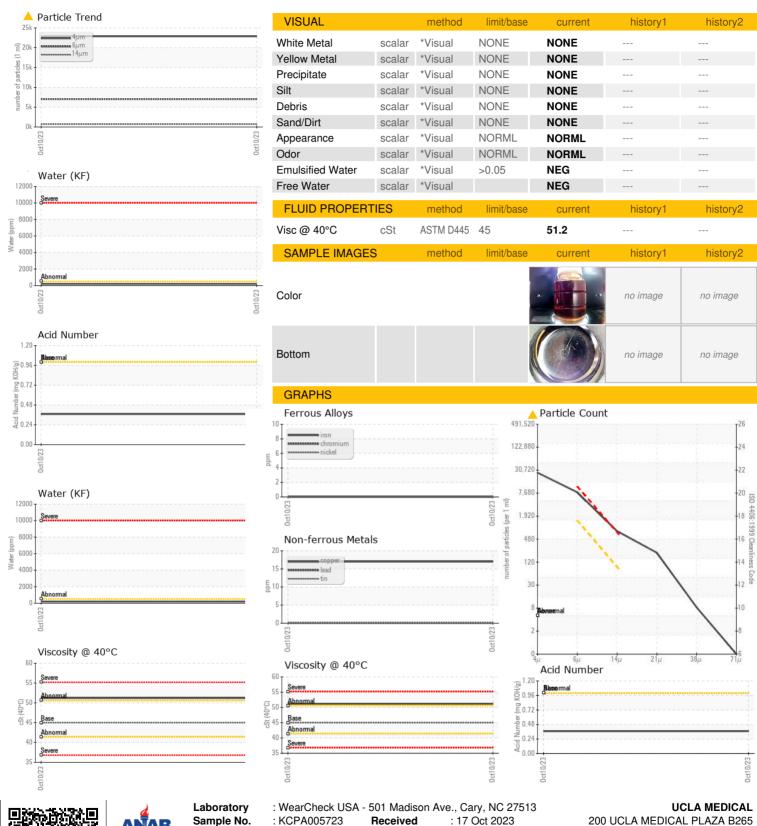



Certificate L2367

Sample No. Lab Number **Unique Number** 

: 05981250

: KCPA005723

Received : 10698545

Diagnosed : 19 Oct 2023

Diagnostician : Jonathan Hester

Test Package : IND 2 ( Additional Tests: KF, PrtCount ) To discuss this sample report, contact Customer Service at 1-800-237-1369.

\* - Denotes test methods that are outside of the ISO 17025 scope of accreditation. Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

200 UCLA MEDICAL PLAZA B265 LOS ANGELOS, CA

US 90095

Contact: Service Manager

T: F: