


PROBLEM SUMMARY


7349445 (S/N 1548)

Component Compressor

KAESER SIGMA (OEM) M-460 (--- GAL)

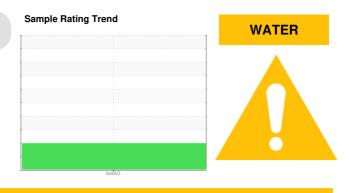

COMPONENT CONDITION SUMMARY

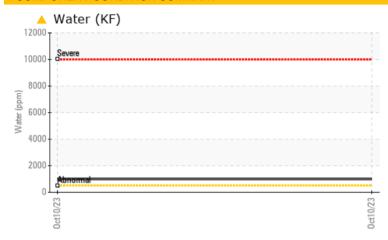

RECOMMENDATION

We advise that you stop the unit and follow the water drain-off procedure for this component. We were unable to perform a particle count due to a high concentration of particles present in this sample. We recommend an early resample in 500 hours to monitor this condition.

PROBLEMATIC TEST RESULTS								
Sample Status				ABNORMAL				
Water	%	ASTM D6304	>0.05	△ 0.098				
ppm Water	ppm	ASTM D6304	>500	980				
Debris	scalar	*Visual	NONE	▲ MODER				

Customer Id: PACKSAN Sample No.: KCPA007850 Lab Number: 05981256 Test Package: IND 2



To manage this report scan the QR code

To discuss the diagnosis or test data: Jonathan Hester +1 919-379-4092 x4092 jhester@wearcheckusa.com

To change component or sample information: Customer Service +1 1-800-237-1369 customerservice@wearcheck.com

RECOMMENDED ACTIONS							
Action	Status	Date	Done By	Description			
Alert			?	We were unable to perform a particle count due to a high concentration of particles present in this sample.			



OIL ANALYSIS REPORT

Sample Rating Trend

WATER



7349445 (S/N 1548)

Compressor

KAESER SIGMA (OEM) M-460 (--- GAL)

DIAGNOSIS

Recommendation

We advise that you stop the unit and follow the water drain-off procedure for this component. We were unable to perform a particle count due to a high concentration of particles present in this sample. We recommend an early resample in 500 hours to monitor this condition.

Wear

All component wear rates are normal.

Contamination

There is a light concentration of water present in the oil. Moderate concentration of visible dirt/debris present in the oil.

Fluid Condition

The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

				Oct2023		
SAMPLE INFORM	MATION	method	limit/base	current	history1	history2
Sample Number		Client Info		KCPA007850		
Sample Date		Client Info		10 Oct 2023		
Machine Age	hrs	Client Info		2396		
Oil Age	hrs	Client Info		0		
Oil Changed		Client Info		N/A		
Sample Status				ABNORMAL		
WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>50	0		
Chromium	ppm	ASTM D5185m	>10	0		
Nickel	ppm	ASTM D5185m	>3	0		
Titanium	ppm	ASTM D5185m	>3	0		
Silver	ppm	ASTM D5185m	>2	0		
Aluminum	ppm	ASTM D5185m	>10	0		
Lead	ppm	ASTM D5185m	>10	0		
Copper	ppm	ASTM D5185m	>50	9		
Tin	ppm	ASTM D5185m	>10	0		
Vanadium	ppm	ASTM D5185m		0		
Cadmium	ppm	ASTM D5185m		0		
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m	0	0		
Barium	ppm	ASTM D5185m	90	0		
Molybdenum	ppm	ASTM D5185m	0	0		
Manganese	ppm	ASTM D5185m		0		
Magnesium	ppm	ASTM D5185m	100	12		
Calcium	ppm	ASTM D5185m	0	0		
Phosphorus	ppm	ASTM D5185m	0	0		
Zinc	ppm	ASTM D5185m	0	0		
Sulfur	ppm	ASTM D5185m	23500	14758		
CONTAMINANTS		method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>25	0		
Sodium	ppm	ASTM D5185m		3		
Potassium	ppm	ASTM D5185m	>20	0		
Water	%	ASTM D6304	>0.05	△ 0.098		
ppm Water	ppm	ASTM D6304	>500	△ 980		
FLUID DEGRADA	TION	method	limit/base	current	history1	history2


0.33

Acid Number (AN)

mg KOH/g ASTM D8045 1.0



OIL ANALYSIS REPORT

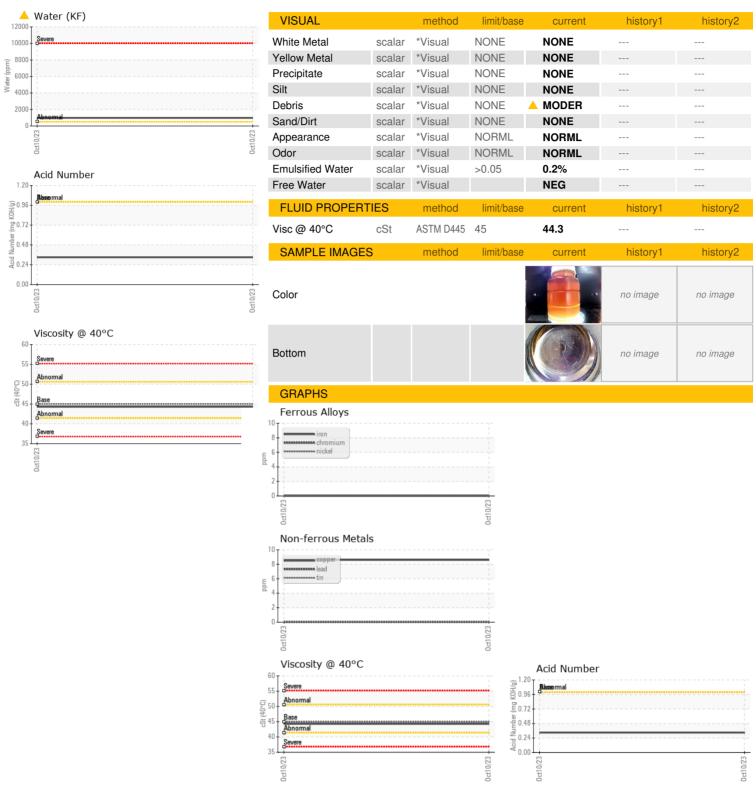





Certificate L2367

Laboratory Sample No. Lab Number **Unique Number**

: KCPA007850 : 05981256 : 10698551

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 Received

Diagnosed : 24 Oct 2023 Diagnostician : Jonathan Hester

: 17 Oct 2023

Test Package : IND 2 (Additional Tests: KF, PrtCount)

To discuss this sample report, contact Customer Service at 1-800-237-1369. * - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

PACK YOUR FOODS 3744 WARNER AVE SANTA ANA, CA

US 92704

Contact: Service Manager

T:

F: