




KAESER 2830132

Component Compressor Fluid KAESER SIGMA (OEM) M-460 (--- GAL)

COMPONENT CONDITION SUMMARY

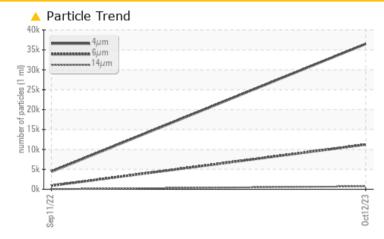

RECOMMENDATION

No corrective action is recommended at this time. The filter change at the time of sampling has been noted. Resample at the next service interval to monitor.

PROBLEMATIC TEST RESULTS

Sample Status		ABNORMAL	NORMAL						
Particles >6µm	ASTM D7647 >13	00 🔺 11230	899						
Particles >14µm	ASTM D7647 >80	A 732	29						
Particles >21µm	ASTM D7647 >20	<u> </u>	3						
Oil Cleanliness	ISO 4406 (c) >/	17/13 🔺 22/21/17	19/17/12						


Customer Id: CLEFRE Sample No.: KCPA007856 Lab Number: 05981900 Test Package: IND 2



To manage this report scan the QR code

To discuss the diagnosis or test data: Don Baldridge +1 don.b505@comcast.net

To change component or sample information: Customer Service +1 1-800-237-1369 customerservice@wearcheck.com

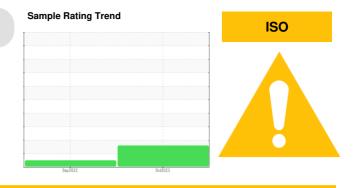

There are no recommended actions for this sample.

HISTORICAL DIAGNOSIS

11 Sep 2022 Diag: Don Baldridge



Resample at the next service interval to monitor.All component wear rates are normal. The amount and size of particulates present in the system are acceptable. There is no indication of any contamination in the oil. The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.





OIL ANALYSIS REPORT

Sample Rating Trend

ISO

Machine Id KAESER 2830132 Component

Compressor Fluid KAESER SIGMA (OEM) M-460 (--- GAL)

DIAGNOSIS

Recommendation

No corrective action is recommended at this time. The filter change at the time of sampling has been noted. Resample at the next service interval to monitor.

Wear

All component wear rates are normal.

Contamination

There is a high amount of particulates present in the oil.

Fluid Condition


The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.


			Sep2022	Oct2023		
SAMPLE INFORM	/IATION	method	limit/base	current	history1	history2
Sample Number		Client Info		KCPA007856	KCP37318	
Sample Date		Client Info		12 Oct 2023	11 Sep 2022	
Machine Age	hrs	Client Info		33954	30735	
Oil Age	hrs	Client Info		0	2000	
Oil Changed		Client Info		N/A	Changed	
Sample Status				ABNORMAL	NORMAL	
WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>50	0	<1	
Chromium	ppm	ASTM D5185m	>10	0	0	
Nickel	ppm	ASTM D5185m	>3	0	0	
Titanium	ppm	ASTM D5185m	>3	0	0	
Silver	ppm	ASTM D5185m	>2	0	0	
Aluminum	ppm	ASTM D5185m	>10	1	1	
Lead	ppm	ASTM D5185m	>10	0	0	
Copper	ppm	ASTM D5185m		3	3	
Tin	ppm		>10	0	0	
Vanadium	ppm	ASTM D5185m	-	0	0	
Cadmium	ppm	ASTM D5185m		0	0	
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m	0	0	0	
Barium	ppm	ASTM D5185m	90	4	2	
Molybdenum	ppm	ASTM D5185m	0	0	0	
Manganese	ppm	ASTM D5185m		0	0	
Magnesium	ppm	ASTM D5185m	100	3	<1	
Calcium	ppm	ASTM D5185m	0	0	0	
Phosphorus	ppm	ASTM D5185m	0	24	84	
Zinc	ppm	ASTM D5185m	0	11	<1	
Sulfur	ppm	ASTM D5185m	23500	16578	6460	
CONTAMINANTS	;	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>25	<1	<1	
Sodium	ppm	ASTM D5185m		2	<1	
Potassium	ppm	ASTM D5185m	>20	1	0	
Water	%	ASTM D6304	>0.05	0.006	0.011	
ppm Water	ppm	ASTM D6304	>500	66.7	112.4	
FLUID CLEANLIN	IESS	method	limit/base	current	history1	history2
Particles >4µm		ASTM D7647		36484	4397	
Particles >6µm		ASTM D7647	>1300	<u> </u>	899	
Particles >14µm		ASTM D7647	>80	732	29	
Particles >21µm		ASTM D7647	>20	<u> </u>	3	
Particles >38μm		ASTM D7647	>4	3	0	
Particles >71µm		ASTM D7647		0	0	
Oil Cleanliness		ISO 4406 (c)	>/17/13	<u> </u>	19/17/12	
FLUID DEGRADA	TION	method	limit/base	current	history1	history2
Acid Number (AN)	mg KOH/g	ASTM D8045	1.0	0.39	0.30	
· /	J					


Contact/Location: GREG JIMENEZ - CLEFRE




OIL ANALYSIS REPORT

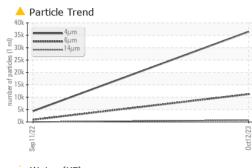

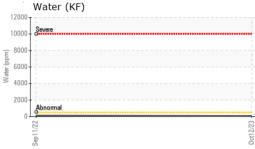

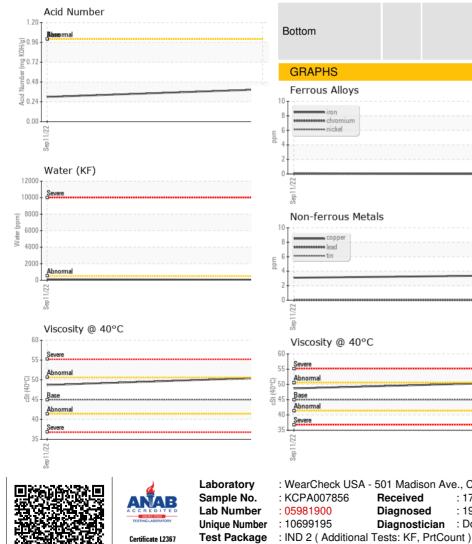

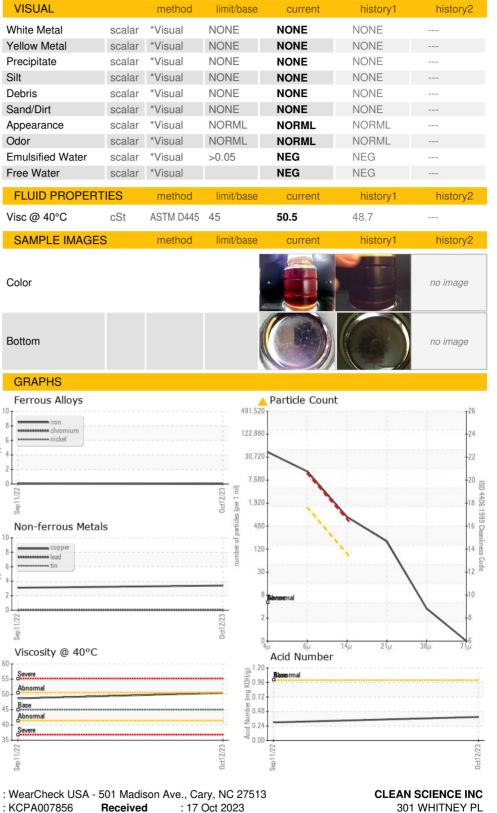

To discuss this sample report, contact Customer Service at 1-800-237-1369. * - Denotes test methods that are outside of the ISO 17025 scope of accreditation. Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

Diagnosed

: 19 Oct 2023

Diagnostician : Don Baldridge

T:

F:

FREMONT, CA US 94539

Contact: GREG JIMENEZ

gregjimenez60@gmail.com