

PROBLEM SUMMARY

Machine Id **2443407 (S/N 1880)**


Component

Compressor

KAESER SIGMA (OEM) M-460 (--- GAL)

Sample Rating Trend ISO

COMPONENT CONDITION SUMMARY

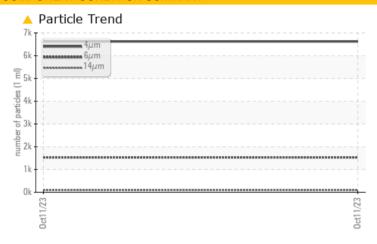

RECOMMENDATION

No corrective action is recommended at this time. The filter change at the time of sampling has been noted. Resample at the next service interval to monitor.

PROBLEMATIC TEST RESULTS									
Sample Status		ATTENTION							
Particles >6µm	ASTM D7647 >13	300 A 1531							
Particles >14µm	ASTM D7647 >80	88 🔺							
Oil Cleanliness	ISO 4406 (c) >	17/13 ^ 20/18/14							

Customer Id: AXCHAL Sample No.: KCPA007942 Lab Number: 05981902 Test Package: IND 2



To manage this report scan the QR code

To discuss the diagnosis or test data:

Don Baldridge +1 don.b505@comcast.net

To change component or sample information: Customer Service +1 1-800-237-1369 customerservice@wearcheck.com

RECOMMENDED ACTIONS

There are no recommended actions for this sample.

HISTORICAL DIAGNOSIS




OIL ANALYSIS REPORT

2443407 (S/N 1880)

Compressor

KAESER SIGMA (OEM) M-460 (--- GAL)

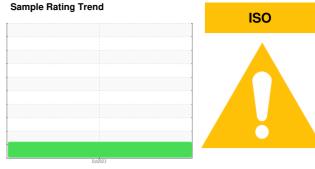

DIAGNOSIS

Recommendation

No corrective action is recommended at this time. The filter change at the time of sampling has been noted. Resample at the next service interval to monitor.

Wear

All component wear rates are normal.

Contamination

There is a moderate amount of particulates present in the oil.

Fluid Condition

The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

				Oct2023		
SAMPLE INFORM	MATION	method	limit/base	current	history1	history2
Sample Number		Client Info		KCPA007942		
Sample Date		Client Info		11 Oct 2023		
Machine Age	hrs	Client Info		9540		
Oil Age	hrs	Client Info		0		
Oil Changed		Client Info		N/A		
Sample Status				ATTENTION		
WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>50	0		
Chromium	ppm	ASTM D5185m	>10	0		
Nickel	ppm	ASTM D5185m	>3	0		
Titanium	ppm	ASTM D5185m	>3	0		
Silver	ppm	ASTM D5185m	>2	0		
Aluminum	ppm	ASTM D5185m	>10	0		
Lead	ppm	ASTM D5185m	>10	0		
Copper	ppm	ASTM D5185m	>50	21		
Tin	ppm	ASTM D5185m	>10	0		
Vanadium	ppm	ASTM D5185m		0		
Cadmium	ppm	ASTM D5185m		0		
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m	0	0		
Barium	ppm	ASTM D5185m	90	3		
Molybdenum	ppm	ASTM D5185m	0	0		
Manganese	ppm	ASTM D5185m		0		
Magnesium	ppm	ASTM D5185m	100	<1		
Calcium	ppm	ASTM D5185m	0	0		
Phosphorus	ppm	ASTM D5185m	0	<1		
Zinc	ppm	ASTM D5185m	0	11		
Sulfur	ppm	ASTM D5185m	23500	16869		
CONTAMINANTS		method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>25	<1		
Sodium	ppm	ASTM D5185m		<1		
Potassium	ppm	ASTM D5185m	>20	2		
Water	%	ASTM D6304	>0.05	0.007		
ppm Water	ppm	ASTM D6304	>500	70.9		
FLUID CLEANLIN	ESS	method	limit/base	current	history1	history2
Particles >4µm		ASTM D7647		6624		
Particles >6µm		ASTM D7647	>1300	<u> </u>		
Particles >14µm		ASTM D7647	>80	▲ 88		
Particles >21µm		ASTM D7647	>20	19		
Particles >38µm		ASTM D7647	>4	1		
Particles >71µm		ASTM D7647	>3	0		
Oil Cleanliness		ISO 4406 (c)	>/17/13	20/18/14		
FLUID DEGRADA	TION	method	limit/base	current	history1	history2
Acid Number (AN)	mg KOH/g	ASTM D8045	1.0	0.30		



OIL ANALYSIS REPORT







Certificate L2367

Laboratory Sample No. Lab Number Unique Number

e No. : KCPA007942 umber : 05981902

: 05981902 : 10699197

Received : 17 Oct 2023

Diagnosed : 19 Oct 2023

Diagnostician : Don Baldridge

Test Package : IND 2 (Additional Tests: KF, PrtCount)

To discuss this sample report, contact Customer Service at 1-800-237-1369.

* - Denotes test methods that are outside of the ISO 17025 scope of accredit.

* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

IXCESS MEDICAL - WEST COAST SURGICAL LLC 141 CALIFORNIA AVE, SUITE 101 HALF MOON BAY, CA

US 94019 Contact: JOHN

Contact: JOHN john@westcoastsurgical.com

T:

106:2012) F:
Contact/Location: JOHN ? - AXCHAL