

PROBLEM SUMMARY


KAESER SFC 18 7904581 (S/N 1005)

Compressor

KAESER SIGMA (OEM) M-460 (--- GAL)

Sample Rating Trend ISO

COMPONENT CONDITION SUMMARY

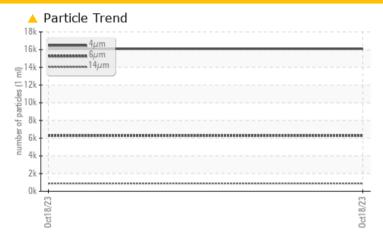

RECOMMENDATION

The filter change at the time of sampling has been noted. Resample at the next service interval to monitor.

PROBLEMATIC TEST RESULTS									
Sample Status			ABNORMAL						
Particles >6µm	ASTM D7647	>1300	<u>△</u> 6281						
Particles >14µm	ASTM D7647	>80	885						
Particles >21µm	ASTM D7647	>20	255						
Particles >38µm	ASTM D7647	>4	<u>^</u> 8						
Oil Cleanliness	ISO 4406 (c)	>/17/13	21/20/17						

Customer Id: SCISIM Sample No.: KCPA007959 Lab Number: 05994377 Test Package: IND 2



To manage this report scan the QR code

To discuss the diagnosis or test data: Angela Borella +1 800-237-1369 angela.borella@wearcheckusa.com

To change component or sample information: Customer Service +1 1-800-237-1369 customerservice@wearcheck.com

RECOMMENDED ACTIONS

There are no recommended actions for this sample.

HISTORICAL DIAGNOSIS



OIL ANALYSIS REPORT

Sample Rating Trend ISO

KAESER SFC 18 7904581 (S/N 1005)

Compressor

KAESER SIGMA (OEM) M-460 (--- GAL)

DIAGNOSIS

Recommendation

The filter change at the time of sampling has been noted. Resample at the next service interval to monitor.

All component wear rates are normal.

Contamination

There is a high amount of particulates present in the oil.

Fluid Condition

The AN level is acceptable for this fluid. The condition of the oil is acceptable for the time in service.

				Oct2023		
SAMPLE INFORM	MATION	method	limit/base	current	history1	history2
Sample Number		Client Info		KCPA007959		
Sample Date		Client Info		18 Oct 2023		
Machine Age	hrs	Client Info		9838		
Oil Age	hrs	Client Info		0		
Oil Changed	1110	Client Info		N/A		
Sample Status		Olletti Ittio		ABNORMAL		
WEAR METALS		method	limit/base	-		
				current	history1	history2
Iron	ppm	ASTM D5185m	>50	0		
Chromium	ppm	ASTM D5185m	>10	<1		
Nickel	ppm	ASTM D5185m	>3	0		
Titanium	ppm		>3	0		
Silver	ppm	ASTM D5185m	>2	0		
Aluminum	ppm	ASTM D5185m	>10	<1		
Lead	ppm	ASTM D5185m	>10	0		
Copper	ppm	ASTM D5185m	>50	13		
Tin	ppm	ASTM D5185m	>10	<1		
Vanadium	ppm	ASTM D5185m		0		
Cadmium	ppm	ASTM D5185m		0		
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m	0	0		
Barium	ppm	ASTM D5185m	90	28		
Molybdenum	ppm	ASTM D5185m	0	0		
Manganese	ppm	ASTM D5185m		<1		
Magnesium	ppm	ASTM D5185m	100	8		
Calcium	ppm	ASTM D5185m	0	0		
Phosphorus	ppm	ASTM D5185m	0	41		
Zinc	ppm	ASTM D5185m	0	28		
Sulfur	ppm	ASTM D5185m	23500	25132		
CONTAMINANTS		method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>25	<1		
Sodium	ppm	ASTM D5185m		5		
Potassium	ppm	ASTM D5185m	>20	0		
Water	%	ASTM D6304	>0.05	0.008		
ppm Water	ppm	ASTM D6304	>500	81.6		
FLUID CLEANLIN	IESS	method	limit/base	current	history1	history2
Particles >4μm		ASTM D7647		16101		
Particles >6µm		ASTM D7647	>1300	<u>^</u> 6281		
Particles >14µm		ASTM D7647	>80	A 885		
Particles >21µm		ASTM D7647	>20	255		
Particles >38µm		ASTM D7647	>4	<u>^</u> 8		
Particles >71µm		ASTM D7647		0		
Oil Cleanliness		ISO 4406 (c)	>/17/13	△ 21/20/17		
FLUID DEGRADA	TION	method	limit/base	current	history1	history2
A : 1 N	1/011/	ACTM DODAE		0.40		


Acid Number (AN)

mg KOH/g ASTM D8045 1.0

0.42



OIL ANALYSIS REPORT

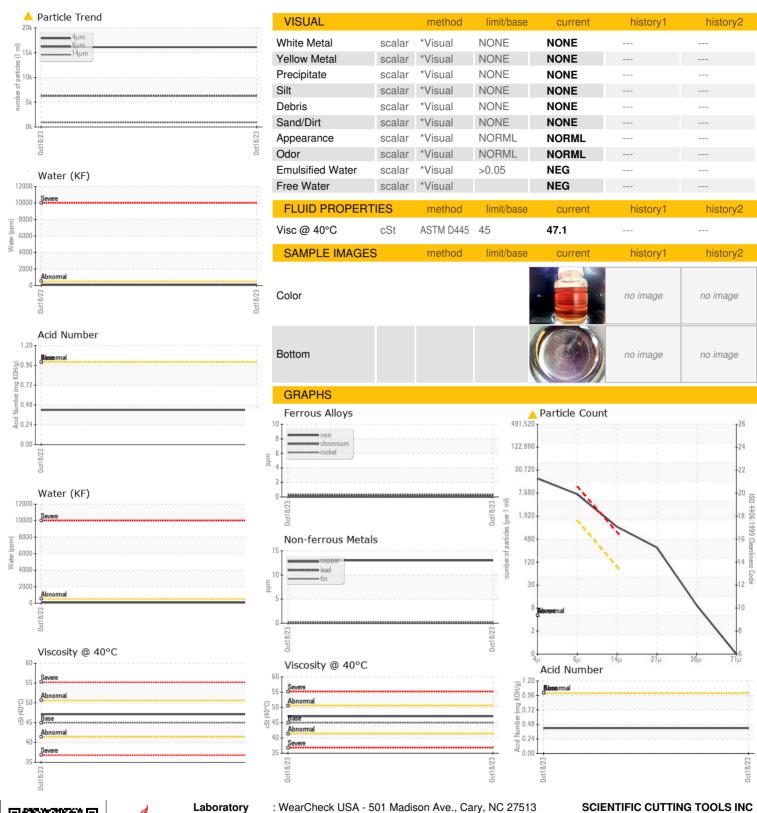



Certificate L2367

Laboratory Sample No. Lab Number **Unique Number**

: KCPA007959 : 05994377

: 10722737

Received : 31 Oct 2023 Diagnosed

: 01 Nov 2023 Diagnostician : Angela Borella

Test Package : IND 2 (Additional Tests: KF, PrtCount)

To discuss this sample report, contact Customer Service at 1-800-237-1369. * - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

SCIENTIFIC CUTTING TOOLS INC

220 W LOS ANGELES AVE SIMI VALLEY, CA

US 93065

Contact: SERVICE MANAGER

T: F: