

# **PROBLEM SUMMARY**

# Sample Rating Trend ISO

# Machine Id **2691915 (S/N 1258)** Component

Compressor Fluid KAESER SIGMA (OEM) M-460 (--- GAL)

# COMPONENT CONDITION SUMMARY



## RECOMMENDATION

No corrective action is recommended at this time. The filter change at the time of sampling has been noted. Resample at the next service interval to monitor.

# PROBLEMATIC TEST RESULTS

Sample Status		ABNORMAL						
Particles >6µm	ASTM D7647 >	1300 🔺 <b>7623</b>						
Particles >14µm	ASTM D7647 >	80 <b>A 798</b>						
Particles >21µm	ASTM D7647 >	20 <b>A 254</b>						
Particles >38µm	ASTM D7647 >	4 🔺 19						
Oil Cleanliness	ISO 4406 (c) >	/17/13 🔺 22/20/17						

Customer Id: BLUHUN Sample No.: KCPA007825 Lab Number: 05994407 Test Package: IND 2



To manage this report scan the QR code

To discuss the diagnosis or test data: Don Baldridge +1 don.b505@comcast.net

To change component or sample information: Customer Service +1 1-800-237-1369 customerservice@wearcheck.com There are no recommended actions for this sample.

HISTORICAL DIAGNOSIS



# **OIL ANALYSIS REPORT**



# ISO

# **2691915 (S/N 1258)** Component

Compressor Fluid KAESER SIGMA (OEM) M-460 (--- GAL)

# DIAGNOSIS

### Recommendation

No corrective action is recommended at this time. The filter change at the time of sampling has been noted. Resample at the next service interval to monitor.

# Wear

All component wear rates are normal.

# Contamination

There is a high amount of particulates present in the oil.

### Fluid Condition


The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.


SAMPLE INFORM	IATION	method	limit/base	current	history1	history2
Sample Number		Client Info		KCPA007825		
Sample Date		Client Info		12 Oct 2023		
Machine Age	hrs	Client Info		35663		
Oil Age	hrs	Client Info		0		
Oil Changed		Client Info		N/A		
Sample Status				ABNORMAL		
WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>50	<1		
Chromium	ppm	ASTM D5185m	>10	<1		
Nickel	ppm	ASTM D5185m	>3	0		
Titanium	ppm	ASTM D5185m	>3	0		
Silver	ppm	ASTM D5185m	>2	0		
Aluminum	ppm	ASTM D5185m	>10	<1		
Lead	ppm	ASTM D5185m	>10	0		
Copper	ppm		>50	5		
Tin	ppm	ASTM D5185m	>10	ر <1		
Vanadium	ppm	ASTM D5185m	~10	0		
Cadmium	ppm	ASTM D5185m		0		
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m	0	0		
Barium	ppm	ASTM D5185m	90	27		
Molybdenum	ppm	ASTM D5185m	0	<1		
Manganese	ppm	ASTM D5185m		<1		
Magnesium	ppm	ASTM D5185m	100	27		
Calcium	ppm	ASTM D5185m	0	0		
Phosphorus	ppm	ASTM D5185m	0	37		
Zinc	ppm	ASTM D5185m	0	30		
Sulfur	ppm	ASTM D5185m	23500	24511		
CONTAMINANTS		method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>25	0		
Sodium	ppm	ASTM D5185m		10		
Potassium	ppm	ASTM D5185m	>20	0		
Water	%	ASTM D6304	>0.05	0.015		
ppm Water	ppm	ASTM D6304	>500	152.6		
FLUID CLEANLIN	ESS	method	limit/base	current	history1	history2
Particles >4µm		ASTM D7647		22849		
Particles >6µm		ASTM D7647	>1300	<u> </u>		
Particles >14µm		ASTM D7647	>80	<b>A</b> 798		
Particles >21µm		ASTM D7647	>20	<u> </u>		
Particles >38µm		ASTM D7647	>4	<u> </u>		
Particles >71µm		ASTM D7647	>3	1		
Oil Cleanliness		ISO 4406 (c)	>/17/13	<b>A</b> 22/20/17		
FLUID DEGRADA	TION	method	limit/base	current	history1	history2
Acid Number (AN)	mg KOH/g	ASTM D8045	1.0	0.35		





Built for a lifetime

# **OIL ANALYSIS REPORT**

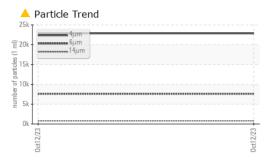

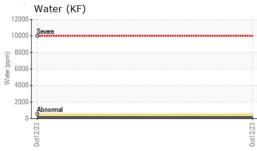

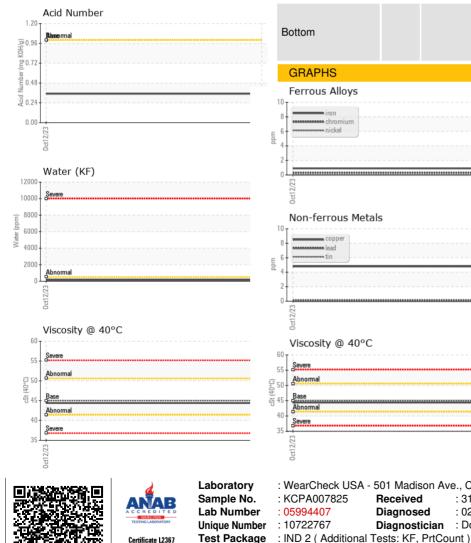

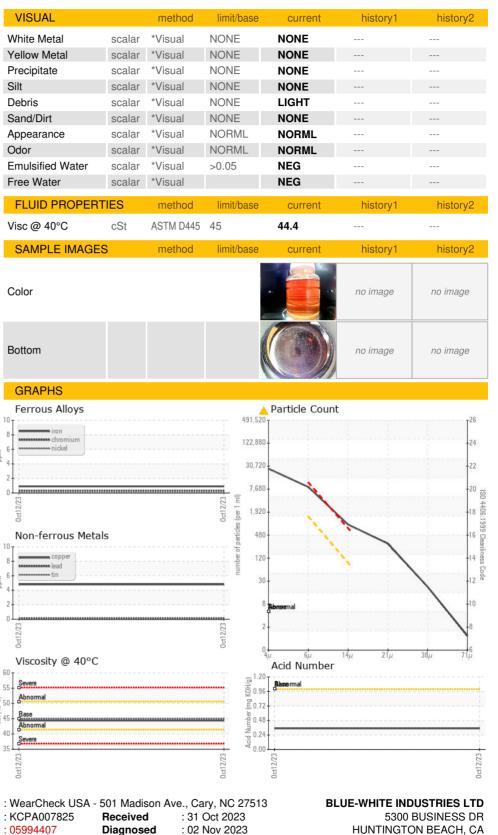

To discuss this sample report, contact Customer Service at 1-800-237-1369. \* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

Diagnostician : Don Baldridge

Contact/Location: Service Manager - BLUHUN

US 92649

T:

F:

Contact: Service Manager