

PROBLEM SUMMARY


PROBLEM SUMMARY

MISSION BELL [9265] Machine Id MYCOM COMP 16 - MISSION BELL (S/N 637844)


Component

Refrigeration Compressor

APCCO ISO 68 (5 GAL)

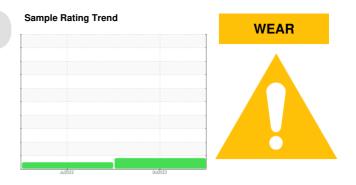

COMPONENT CONDITION SUMMARY

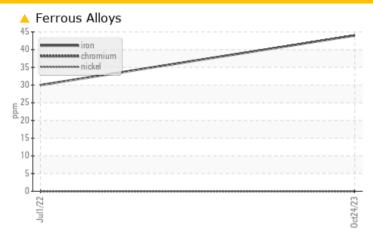

RECOMMENDATION

No corrective action is recommended at this time. We recommend an early resample to monitor this condition.

PROBLEMATIC T	EST RE	SULTS				
Sample Status				ABNORMAL	NORMAL	
Iron	ppm	ASTM D5185m	>8	44	30	

Customer Id: SCHLOD
Sample No.: WC0851607
Lab Number: 05995679
Test Package: PLANT

To manage this report scan the QR code

To discuss the diagnosis or test data:
Jonathan Hester +1 919-379-4092 x4092
jhester@wearcheckusa.com

To change component or sample information:
Customer Service +1 1-800-237-1369
customerservice@wearcheck.com

RECOMMENDED ACTIONS

Action	Status	Date	Done By	Description
Resample			?	We recommend an early resample to monitor this condition.

HISTORICAL DIAGNOSIS

01 Jul 2022 Diag: Doug Bogart

NORMAL



Resample at the next service interval to monitor. All component wear rates are normal. There is no indication of any contamination in the oil. The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.






OIL ANALYSIS REPORT

MISSION BELL [9265] MYCOM COMP 16 - MISSION BELL (S/N 637844)

Refrigeration Compressor

APCCO ISO 68 (5 GAL)

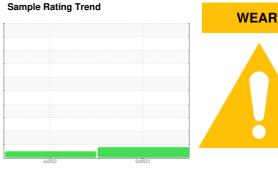

DIAGNOSIS

Recommendation

No corrective action is recommended at this time. We recommend an early resample to monitor this condition.

Wear

The iron level is abnormal. All other component wear rates are normal.

Contamination

There is no indication of any contamination in the


Fluid Condition

The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

SAMPLE INFORM	MATION	method	limit/base	current	history1	history2
Sample Number		Client Info		WC0851607	WC0653515	
Sample Date		Client Info		24 Oct 2023	01 Jul 2022	
Machine Age	hrs	Client Info		28221	28137	
Oil Age	hrs	Client Info		0	0	
Oil Changed		Client Info		N/A	N/A	
Sample Status				ABNORMAL	NORMAL	
WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>8	44	30	
Chromium	ppm	ASTM D5185m	>2	0	0	
Nickel	ppm	ASTM D5185m		0	0	
Titanium	ppm	ASTM D5185m		0	0	
Silver	ppm	ASTM D5185m	>2	0	<1	
Aluminum	ppm	ASTM D5185m	>3	0	<1	
Lead	ppm	ASTM D5185m	>2	0	<1	
Copper	ppm	ASTM D5185m	>8	<1	<1	
Tin	ppm	ASTM D5185m	>4	0	<1	
Vanadium	ppm	ASTM D5185m		0	0	
Cadmium	ppm	ASTM D5185m		0	0	
ADDITIVES		method	limit/base	current	history1	history2
ADDITIVES Boron	ppm	method ASTM D5185m	limit/base	current 0	history1	history2
	ppm ppm		limit/base			
Boron		ASTM D5185m	limit/base	0	0	
Boron Barium	ppm	ASTM D5185m ASTM D5185m	limit/base	0	0 2	
Boron Barium Molybdenum	ppm	ASTM D5185m ASTM D5185m ASTM D5185m	limit/base	0 0 0	0 2 0	
Boron Barium Molybdenum Manganese	ppm ppm	ASTM D5185m ASTM D5185m ASTM D5185m ASTM D5185m	limit/base	0 0 0 <1	0 2 0	
Boron Barium Molybdenum Manganese Magnesium	ppm ppm ppm	ASTM D5185m ASTM D5185m ASTM D5185m ASTM D5185m ASTM D5185m	limit/base	0 0 0 <1 0	0 2 0 0	
Boron Barium Molybdenum Manganese Magnesium Calcium	ppm ppm ppm ppm	ASTM D5185m ASTM D5185m ASTM D5185m ASTM D5185m ASTM D5185m ASTM D5185m	limit/base	0 0 0 <1 0	0 2 0 0 0	
Boron Barium Molybdenum Manganese Magnesium Calcium Phosphorus	ppm ppm ppm ppm ppm	ASTM D5185m ASTM D5185m ASTM D5185m ASTM D5185m ASTM D5185m ASTM D5185m ASTM D5185m	limit/base	0 0 0 <1 0 0	0 2 0 0 0 0 0	
Boron Barium Molybdenum Manganese Magnesium Calcium Phosphorus Zinc	ppm ppm ppm ppm ppm ppm ppm	ASTM D5185m ASTM D5185m ASTM D5185m ASTM D5185m ASTM D5185m ASTM D5185m ASTM D5185m ASTM D5185m	limit/base	0 0 0 <1 0 0	0 2 0 0 0 0 0 10	
Boron Barium Molybdenum Manganese Magnesium Calcium Phosphorus Zinc Sulfur	ppm ppm ppm ppm ppm ppm ppm	ASTM D5185m ASTM D5185m ASTM D5185m ASTM D5185m ASTM D5185m ASTM D5185m ASTM D5185m ASTM D5185m ASTM D5185m		0 0 0 <1 0 0 0	0 2 0 0 0 0 10 2 66	
Boron Barium Molybdenum Manganese Magnesium Calcium Phosphorus Zinc Sulfur CONTAMINANTS	ppm ppm ppm ppm ppm ppm ppm ppm	ASTM D5185m ASTM D5185m ASTM D5185m ASTM D5185m ASTM D5185m ASTM D5185m ASTM D5185m ASTM D5185m ASTM D5185m	limit/base	0 0 0 <1 0 0 0 0	0 2 0 0 0 0 10 2 66 history1	 history2
Boron Barium Molybdenum Manganese Magnesium Calcium Phosphorus Zinc Sulfur CONTAMINANTS	ppm ppm ppm ppm ppm ppm ppm ppm	ASTM D5185m	limit/base	0 0 0 <1 0 0 0 0 0 current	0 2 0 0 0 0 10 2 66 history1	history2
Boron Barium Molybdenum Manganese Magnesium Calcium Phosphorus Zinc Sulfur CONTAMINANTS Silicon Sodium	ppm ppm ppm ppm ppm ppm ppm ppm	ASTM D5185m	limit/base >15 >20	0 0 0 <1 0 0 0 0 0 current 2 <1	0 2 0 0 0 0 10 2 66 history1 2	history2
Boron Barium Molybdenum Manganese Magnesium Calcium Phosphorus Zinc Sulfur CONTAMINANTS Silicon Sodium Potassium	ppm ppm ppm ppm ppm ppm ppm ppm ppm ppm	ASTM D5185m	limit/base >15 >20	0 0 0 <1 0 0 0 0 0 current 2 <1 0	0 2 0 0 0 0 0 10 2 666 history1 2 0 <1	history2
Boron Barium Molybdenum Manganese Magnesium Calcium Phosphorus Zinc Sulfur CONTAMINANTS Silicon Sodium Potassium Water	ppm ppm ppm ppm ppm ppm ppm ppm ppm ppm	ASTM D5185m	limit/base >15 >20 >0.01	0 0 0 0 -<1 0 0 0 0 0 0 current 2 -<1 0 0	0 2 0 0 0 0 0 10 2 66 history1 2 0 <1 0.001	history2



OIL ANALYSIS REPORT

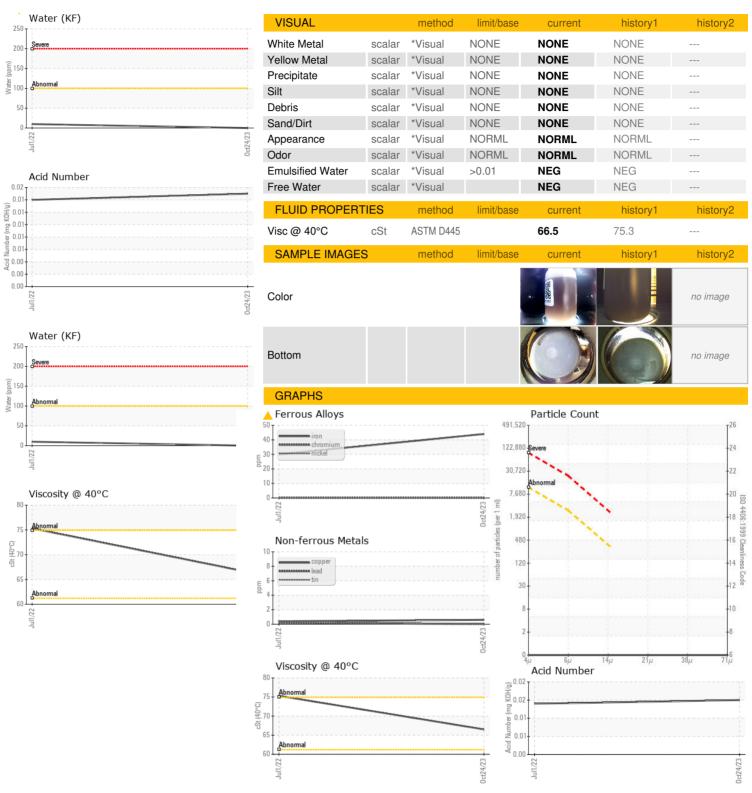





Certificate L2367

Laboratory Sample No. Lab Number

Unique Number

: 05995679 : 10724039 Test Package : PLANT

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 : WC0851607 : 01 Nov 2023 Received Diagnosed : 03 Nov 2023

: Jonathan Hester Diagnostician

To discuss this sample report, contact Customer Service at 1-800-237-1369.

* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

SCHRADER MECHANICAL 1015 BLACK DIAMOND WAY

LODI PROVINCE, CA US 95240

Contact: Schrader Mechanical amanda.h@smiwest.com

T: (209)369-6888

F: x: