


PROBLEM SUMMARY

T-1 BLENDER WEST (SOUTH PLANT)

Gearbox

JAX MAGNA-PLATE 220 FG (--- GAL)

COMPONENT CONDITION SUMMARY

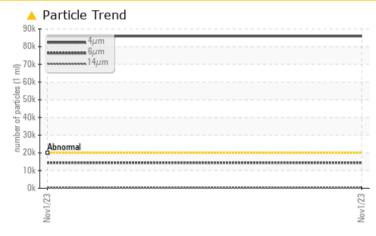

RECOMMENDATION

Resample at the next service interval to monitor.

PROBLEMATIC TEST RESULTS								
Sample Status			ABNORMAL					
Particles >4µm	ASTM D7647	>20000	<u> </u>					
Particles >6µm	ASTM D7647	>5000	🔺 14435					
Oil Cleanliness	ISO 4406 (c)	>21/19/16	<u> </u>					


Customer Id: TYSSAI Sample No.: USP0003039 Lab Number: 05996727 Test Package: IND 2



To manage this report scan the QR code

To discuss the diagnosis or test data: Doug Bogart +1 (800)237-1369 x4016 <u>dougb@wearcheckusa.com</u>

To change component or sample information: Customer Service +1 1-800-237-1369 customerservice@wearcheck.com

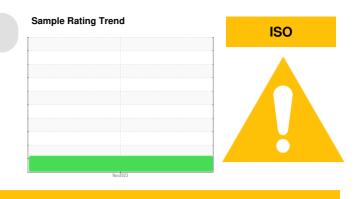

There are no recommended actions for this sample.

HISTORICAL DIAGNOSIS



OIL ANALYSIS REPORT



ISO

Machine Id

T-1 BLENDER WEST (SOUTH PLANT) Component

Gearbox Fluid

JAX MAGNA-PLATE 220 FG (--- GAL)

DIAGNOSIS

Recommendation

Resample at the next service interval to monitor.

Wear

All component wear rates are normal.

Contamination

There is a high amount of silt (particulates < 14 microns in size) present in the oil.


Fluid Condition


The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.


SAMPLE INFORM	ATION	method	limit/base	current	history1	history2
Sample Number		Client Info		USP0003039		
Sample Date		Client Info		01 Nov 2023		
Machine Age	hrs	Client Info		0		
Oil Age	hrs	Client Info		0		
Oil Changed		Client Info		N/A		
Sample Status				ABNORMAL		
WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>200	54		
Chromium	ppm	ASTM D5185m	>15	<1		
Nickel	ppm	ASTM D5185m	>15	0		
Titanium	ppm	ASTM D5185m		0		
Silver	ppm	ASTM D5185m		0		
Aluminum	ppm	ASTM D5185m	>25	<1		
Lead	ppm	ASTM D5185m	>100	0		
Copper	ppm	ASTM D5185m	>200	<1		
Tin	ppm	ASTM D5185m	>25	0		
Vanadium	ppm	ASTM D5185m		0		
Cadmium	ppm	ASTM D5185m		0		
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m		2		
Barium	ppm	ASTM D5185m		0		
Molybdenum	ppm	ASTM D5185m		0		
Manganese	ppm	ASTM D5185m		<1		
Magnesium	ppm	ASTM D5185m		1		
Calcium	ppm	ASTM D5185m		12		
Phosphorus	ppm	ASTM D5185m		568		
Zinc	ppm	ASTM D5185m		6		
Sulfur	ppm	ASTM D5185m		723		
CONTAMINANTS		method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>50	3		
Sodium	ppm	ASTM D5185m		6		
Potassium	ppm	ASTM D5185m	>20	14		
Water	%	ASTM D6304	>0.2	0.020		
ppm Water	ppm	ASTM D6304	>2000	207.2		
FLUID CLEANLIN	IESS	method	limit/base	current	history1	history2
Particles >4µm		ASTM D7647	>20000	<u> </u>		
Particles >6µm		ASTM D7647	>5000	🔺 14435		
Particles >14µm		ASTM D7647	>640	242		
Particles >21µm		ASTM D7647	>160	45		
Particles >38µm		ASTM D7647	>40	3		
Particles >71µm		ASTM D7647	>10	2		
Oil Cleanliness		ISO 4406 (c)	>21/19/16	A 24/21/15		
FLUID DEGRADA	TION	method	limit/base	current	history1	history2
Acid Number (AN)	mg KOH/g	ASTM D8045		0.54		




OIL ANALYSIS REPORT

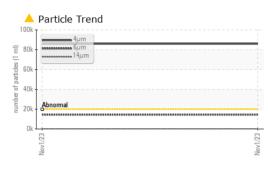

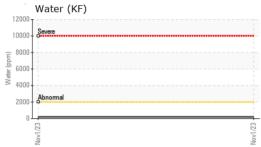

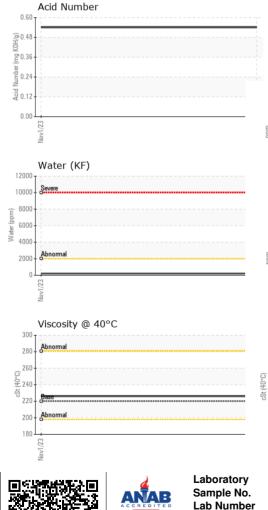

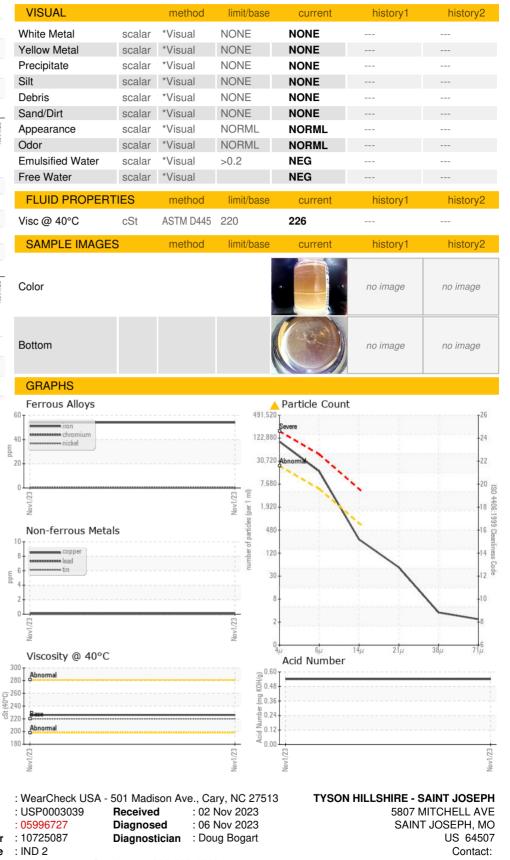

To discuss this sample report, contact Customer Service at 1-800-237-1369.

Unique Number

Test Package

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

T:

F:

Certificate L2367

^{* -} Denotes test methods that are outside of the ISO 17025 scope of accreditation.