

PROBLEM SUMMARY

Sample Rating Trend

ISO




INCLINE PRE-BLEND 1 (SOUTH PLANT)

Gearbox

JAX MAGNA-PLATE 220 FG (--- GAL)

COMPONENT CONDITION SUMMARY

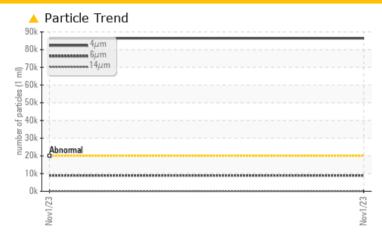

RECOMMENDATION

Resample at the next service interval to monitor.

PROBLEMATIC TEST RESULTS									
Sample Status			ABNORMAL						
Particles >4µm	ASTM D7647	>20000	A 86388						
Particles >6µm	ASTM D7647	>5000	8909						
Oil Cleanliness	ISO 4406 (c)	>21/19/16	24/20/13						

Customer Id: TYSSAI Sample No.: USP0003040 Lab Number: 05996728 Test Package: IND 2



To manage this report scan the QR code

To discuss the diagnosis or test data: Doug Bogart +1 (800)237-1369 x4016 dougb@wearcheckusa.com

To change component or sample information: Customer Service +1 1-800-237-1369 customerservice@wearcheck.com

RECOMMENDED ACTIONS

There are no recommended actions for this sample.

HISTORICAL DIAGNOSIS



OIL ANALYSIS REPORT

Sample Rating Trend

ISO

INCLINE PRE-BLEND 1 (SOUTH PLANT)

Gearbox

JAX MAGNA-PLATE 220 FG (--- GAL)

DIAGNOSIS

Recommendation

Resample at the next service interval to monitor.

All component wear rates are normal.

Contamination

There is a high amount of silt (particulates < 14 microns in size) present in the oil.

Fluid Condition

The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

				Nov2023		
SAMPLE INFORM	MATION	method	limit/base	current	history1	history2
Sample Number		Client Info		USP0003040		
Sample Date		Client Info		01 Nov 2023		
Machine Age	hrs	Client Info		0		
Oil Age	hrs	Client Info		0		
Oil Changed		Client Info		N/A		
Sample Status				ABNORMAL		
WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>200	15		
Chromium	ppm	ASTM D5185m	>15	<1		
Nickel	ppm	ASTM D5185m	>15	0		
Titanium	ppm	ASTM D5185m		0		
Silver	ppm	ASTM D5185m		0		
Aluminum	ppm	ASTM D5185m	>25	<1		
Lead	ppm	ASTM D5185m	>100	0		
Copper	ppm	ASTM D5185m	>200	<1		
Tin	ppm	ASTM D5185m	>25	0		
Vanadium	ppm	ASTM D5185m		0		
Cadmium	ppm	ASTM D5185m		0		
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m		31		
Barium	ppm	ASTM D5185m		<1		
Molybdenum	ppm	ASTM D5185m		<1		
Manganese	ppm	ASTM D5185m		0		
Magnesium	ppm	ASTM D5185m		0		
Calcium	ppm	ASTM D5185m		5		
Phosphorus	ppm	ASTM D5185m		304		
Zinc	ppm	ASTM D5185m		8		
Sulfur	ppm	ASTM D5185m		17536		
CONTAMINANTS	3	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>50	3		
Sodium	ppm	ASTM D5185m		0		
Potassium	ppm	ASTM D5185m	>20	2		
Water	%	ASTM D6304	>0.2	0.009		
ppm Water	ppm	ASTM D6304	>2000	91.7		
FLUID CLEANLIN	IESS	method	limit/base	current	history1	history2
Particles >4μm		ASTM D7647	>20000	<u> </u>		
Particles >6µm		ASTM D7647	>5000	<u>^</u> 8909		
Particles >14μm		ASTM D7647	>640	80		
Particles >21µm		ASTM D7647	>160	17		
Particles >38µm		ASTM D7647	>40	3		
Particles >71µm		ASTM D7647	>10	1		
Oil Cleanliness		ISO 4406 (c)	>21/19/16	<u>4</u> 24/20/13		
FLUID DEGRADA	ATION	method	limit/base	current	history1	history2
Asid Number (ANI)	ma 1/011/a	ACTM DODAE		0.54		


0.54

Acid Number (AN)

mg KOH/g ASTM D8045



OIL ANALYSIS REPORT

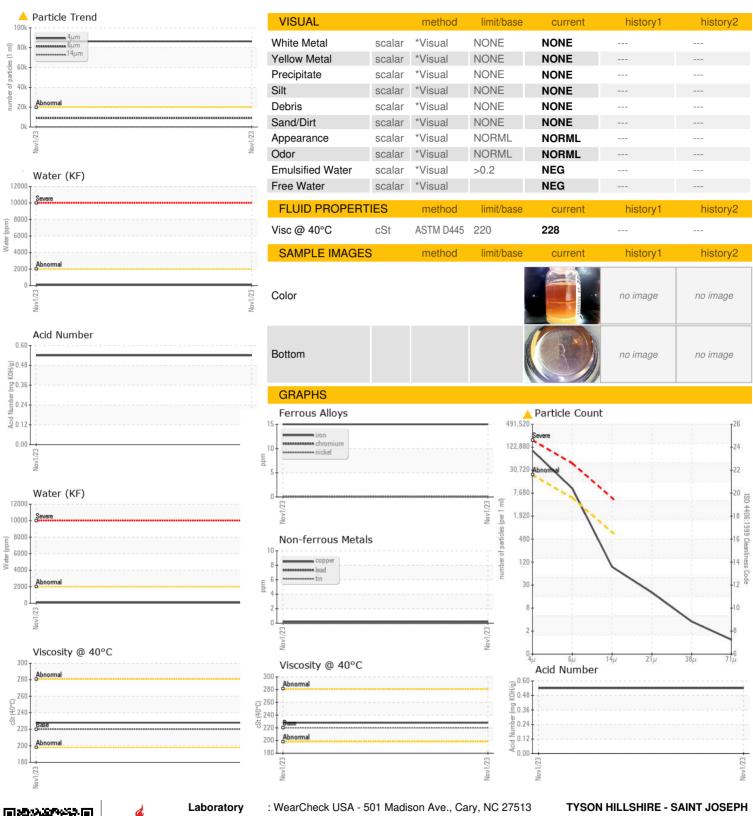





Certificate L2367

Sample No. Lab Number **Unique Number**

Test Package

: USP0003040 : 05996728 : 10725088 : IND 2

Received : 02 Nov 2023 Diagnosed : 06 Nov 2023

Diagnostician : Doug Bogart

5807 MITCHELL AVE SAINT JOSEPH, MO US 64507

Contact:

T: F:

To discuss this sample report, contact Customer Service at 1-800-237-1369.

* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)