

PROBLEM SUMMARY

Sample Rating Trend


ISO

PRE-BLEND 1 EAST (SOUTH PLANT)

Component **Gearbox**

JAX MAGNA-PLATE 220 FG (--- GAL)

COMPONENT CONDITION SUMMARY

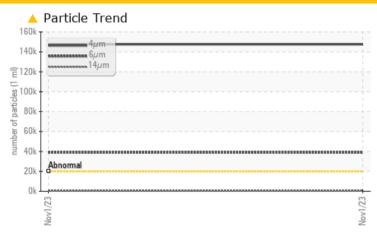

RECOMMENDATION

Resample at the next service interval to monitor.

PROBLEMATIC TEST RESULTS									
Sample Status			ABNORMAL						
Particles >4µm	ASTM D7647	>20000	<u> </u>						
Particles >6µm	ASTM D7647	>5000	38938						
Oil Cleanliness	ISO 4406 (c)	>21/19/16	4 24/22/16						

Customer Id: TYSSAI Sample No.: USP0003046 Lab Number: 05996734 Test Package: IND 2



To manage this report scan the QR code

To discuss the diagnosis or test data: Doug Bogart +1 (800)237-1369 x4016 dougb@wearcheckusa.com

To change component or sample information: Customer Service +1 1-800-237-1369 customerservice@wearcheck.com

RECOMMENDED ACTIONS

There are no recommended actions for this sample.

HISTORICAL DIAGNOSIS



OIL ANALYSIS REPORT

Sample Rating Trend



PRE-BLEND 1 EAST (SOUTH PLANT)

Gearbox

JAX MAGNA-PLATE 220 FG (--- GAL)

DIAGNOSIS

Recommendation

Resample at the next service interval to monitor.

All component wear rates are normal.

Contamination

There is a high amount of silt (particulates < 14 microns in size) present in the oil.


Fluid Condition

The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

				Nov2023		
SAMPLE INFOR	MATION	method	limit/base	current	history1	history2
		Client Info		USP0003046		,_
Sample Number				01 Nov 2023		
Sample Date	la con	Client Info				
Machine Age	hrs	Client Info		0		
Oil Age	hrs	Client Info		0		
Oil Changed		Client Info		N/A		
Sample Status				ABNORMAL		
WEAR METALS		method	limit/base	current	history1	history2
ron	ppm	ASTM D5185m	>200	10		
Chromium	ppm	ASTM D5185m	>15	<1		
Nickel	ppm	ASTM D5185m	>15	0		
Titanium	ppm	ASTM D5185m		0		
Silver	ppm	ASTM D5185m		0		
Aluminum	ppm	ASTM D5185m	>25	<1		
_ead	ppm	ASTM D5185m	>100	0		
Copper	ppm	ASTM D5185m	>200	<1		
Tin	ppm	ASTM D5185m	>25	0		
Vanadium	ppm	ASTM D5185m		0		
Cadmium	ppm	ASTM D5185m		0		
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m		0		
Barium	ppm	ASTM D5185m		0		
Molybdenum	ppm	ASTM D5185m		0		
Manganese	ppm	ASTM D5185m		0		
Magnesium	ppm	ASTM D5185m		<1		
Calcium	ppm	ASTM D5185m		2		
Phosphorus	ppm	ASTM D5185m		368		
Zinc	ppm	ASTM D5185m		0		
Sulfur	ppm	ASTM D5185m		236		
CONTAMINANTS	S	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>50	14		
Sodium	ppm	ASTM D5185m		0		
Potassium	ppm	ASTM D5185m	>20	2		
Nater	%	ASTM D6304	>0.2	0.003		
opm Water	ppm	ASTM D6304	>2000	36.8		
FLUID CLEANLIN	NESS	method	limit/base	current	history1	history2
Particles >4µm		ASTM D7647	>20000	<u> </u>		
Particles >6µm		ASTM D7647	>5000	△ 38938		
Particles >14µm		ASTM D7647	>640	548		
Particles >21µm		ASTM D7647		62		
Particles >38µm		ASTM D7647	>40	2		
Particles >71µm		ASTM D7647		0		
Oil Cleanliness		ISO 4406 (c)	>21/19/16	<u>4</u> 24/22/16		
FLUID DEGRADA	ATION	method	limit/base	current	history1	history2
Acid Number (AN)	mg KOH/g	ASTM D8045		1.07		
(•)	39			-		



OIL ANALYSIS REPORT

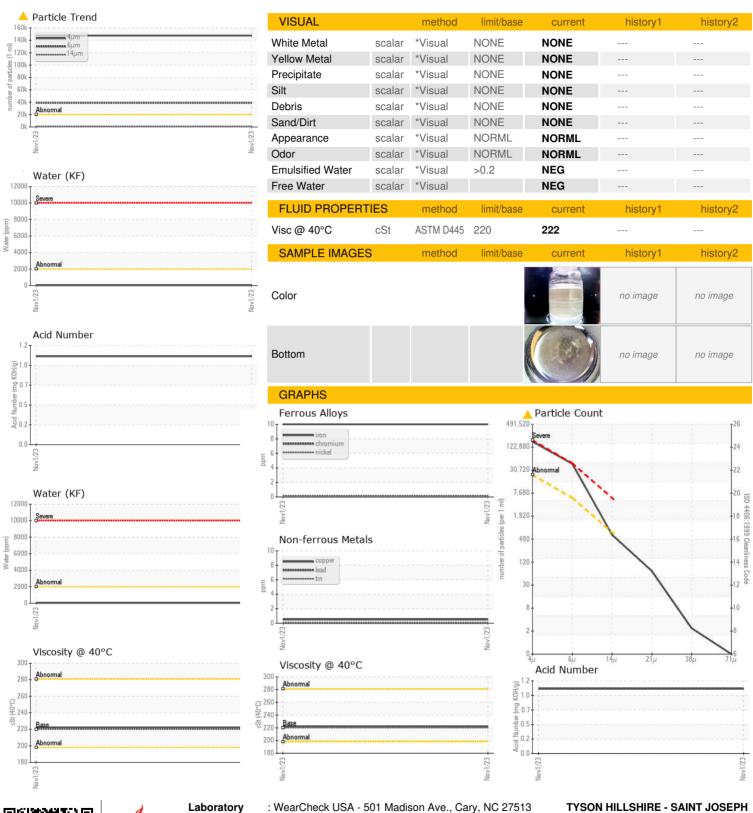





Certificate L2367

Laboratory Sample No. Lab Number **Unique Number**

Test Package

: USP0003046 : 05996734

: 10725094 : IND 2

Received : 02 Nov 2023 Diagnosed Diagnostician

: 06 Nov 2023 : Doug Bogart

5807 MITCHELL AVE SAINT JOSEPH, MO

US 64507 Contact:

T: F:

To discuss this sample report, contact Customer Service at 1-800-237-1369.

* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)