


PROBLEM SUMMARY

T-3 BLENDER SOUTH (SOUTH PLANT)

Gearbox

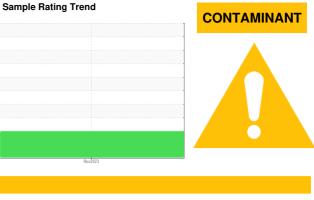

JAX MAGNA-PLATE 220 FG (--- GAL)

COMPONENT CONDITION SUMMARY



RECOMMENDATION

Resample at the next service interval to monitor.

PROBLEMATIC TEST RESULTS										
Sample Status				ATTENTION						
Particles >4µm		ASTM D7647	>20000	<u> </u>						
Particles >6µm		ASTM D7647	>5000	<u> </u>						
Oil Cleanliness		ISO 4406 (c)	>21/19/16	<u> </u>						
Appearance	scalar	*Visual	NORML	🔺 HAZY						

Customer Id: TYSSAI Sample No.: USP0003049 Lab Number: 05996738 Test Package: IND 2



To manage this report scan the QR code

To discuss the diagnosis or test data: Doug Bogart +1 (800)237-1369 x4016 <u>dougb@wearcheckusa.com</u>

To change component or sample information: Customer Service +1 1-800-237-1369 customerservice@wearcheck.com There are no recommended actions for this sample.

HISTORICAL DIAGNOSIS



OIL ANALYSIS REPORT



CONTAMINANT

T-3 BLENDER SOUTH (SOUTH PLANT)

Gearbox Fluid

JAX MAGNA-PLATE 220 FG (--- GAL)

DIAGNOSIS

A Recommendation

Resample at the next service interval to monitor.

Wear

All component wear rates are normal.

Contamination

There is a moderate amount of silt (particulates < 14 microns in size) present in the oil.

Fluid Condition

The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

SAMPLE INFORM	IATION	method	limit/base	current	history1	history2
Sample Number		Client Info		USP0003049		
Sample Date		Client Info		01 Nov 2023		
Machine Age	hrs	Client Info		0		
Oil Age	hrs	Client Info		0		
Oil Changed		Client Info		N/A		
Sample Status				ATTENTION		
WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>200	38		
Chromium	ppm	ASTM D5185m	>15	<1		
Nickel	ppm	ASTM D5185m	>15	0		
Titanium	ppm	ASTM D5185m		0		
Silver	ppm	ASTM D5185m		0		
Aluminum	ppm	ASTM D5185m	>25	<1		
Lead	ppm	ASTM D5185m	>100	0		
Copper	ppm	ASTM D5185m	>200	<1		
Tin	ppm	ASTM D5185m	>25	0		
Vanadium	ppm	ASTM D5185m		0		
Cadmium	ppm	ASTM D5185m		0		
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m		0		
Barium	ppm	ASTM D5185m		0		
Molybdenum	ppm	ASTM D5185m		0		
Manganese	ppm	ASTM D5185m		0		
Magnesium	ppm	ASTM D5185m		<1		
Calcium	ppm	ASTM D5185m		<1		
Phosphorus	ppm	ASTM D5185m		522		
Zinc	ppm	ASTM D5185m		10		
Sulfur	ppm	ASTM D5185m		510		
CONTAMINANTS		method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>50	2		
Sodium	ppm	ASTM D5185m		0		
Potassium	ppm	ASTM D5185m	>20	1		
Water	%	ASTM D6304	>0.2	0.198		
ppm Water	ppm	ASTM D6304	>2000	1980		
FLUID CLEANLIN	ESS	method	limit/base	current	history1	history2
Particles >4µm		ASTM D7647	>20000	22508		
Particles >6µm		ASTM D7647	>5000	<u> </u>		
Particles >14µm		ASTM D7647	>640	178		
Particles >21µm		ASTM D7647	>160	23		
Particles >38µm		ASTM D7647	>40	1		
Particles >71µm		ASTM D7647	>10	0		
Oil Cleanliness		ISO 4406 (c)	>21/19/16	A 22/20/15		
FLUID DEGRADA	TION	method	limit/base	current	history1	history2
Acid Number (AN)	mg KOH/g	ASTM D8045		0.44		



Acid Number

Water (KF)

0.50

(B/HOX Ê0.30

Pio 0.1

0.00

10000

6000 Water (

4000

200 Π

300

280

260

200 Abnorm

180

Base 220

). € 240

Abnom

Viscosity @ 40°C

OIL ANALYSIS REPORT

method


limit/base


current


history1

history2

VISUAL

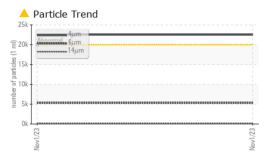

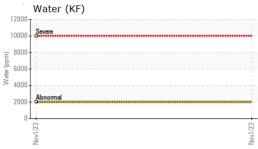

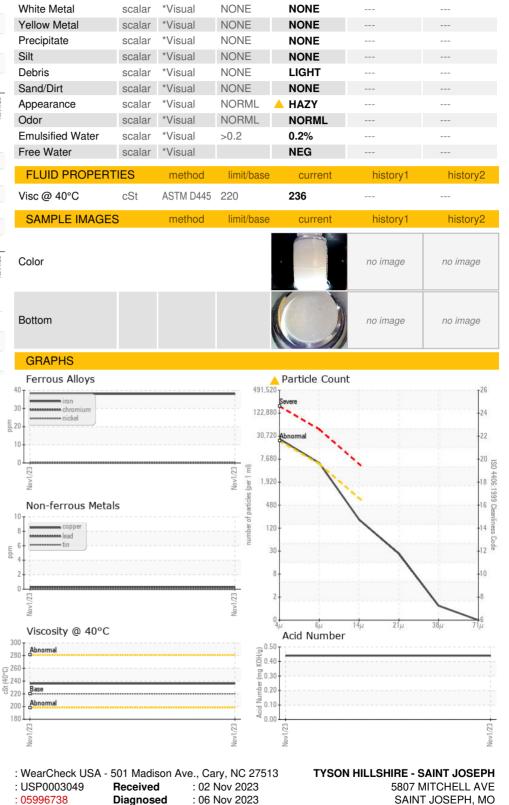



To discuss this sample report, contact Customer Service at 1-800-237-1369. * - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

: 10725098

: IND 2

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

Diagnostician

: Doug Bogart

Certificate L2367

Laboratory

Sample No.

Lab Number

Unique Number

Test Package

Page 4 of 4

US 64507

Contact: