

# **PROBLEM SUMMARY**

Sample Rating Trend

**VIS DEBRIS** 

KAESER SK 15T 8666369 (S/N 1507)

Compressor

KAESER SIGMA (OEM) S-460 (--- GAL)

**COMPONENT CONDITION SUMMARY** 

No relevant graphs to display

## RECOMMENDATION

No corrective action is recommended at this time. The filter change at the time of sampling has been noted. Resample at the next service interval to monitor. We were unable to perform a particle count due to a high concentration of particles present in this sample.

PROBLEMATIC TEST RESULTS							
Sample Status				ABNORMAL			
Debris	scalar	*Visual	NONE	▲ MODER			

Customer Id: AMELOC Sample No.: KCPA006966 Lab Number: 05998456 Test Package: IND 2

To manage this report scan the QR code

To discuss the diagnosis or test data:

Don Baldridge +1 don.b505@comcast.net

To change component or sample information: Customer Service +1 1-800-237-1369 customerservice@wearcheck.com

RECOMMENDED ACTIONS						
Action	Status	Date	Done By	Description		
Alert			?	We were unable to perform a particle count due to a high concentration of particles present in this sample.		

# HISTORICAL DIAGNOSIS



# **OIL ANALYSIS REPORT**

Sample Rating Trend **VIS DEBRIS** 

# KAESER SK 15T 8666369 (S/N 1507)

Compressor

KAESER SIGMA (OEM) S-460 (--- GAL)

## **DIAGNOSIS**

#### Recommendation

No corrective action is recommended at this time. The filter change at the time of sampling has been noted. Resample at the next service interval to monitor. We were unable to perform a particle count due to a high concentration of particles present in this sample.

#### Wear

All component wear rates are normal.

#### Contamination

Moderate concentration of visible dirt/debris present in the oil.

## **Fluid Condition**

The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

				Oct2023	<u> </u>	
SAMPLE INFORM	MATION	method	limit/base	current	history1	history2
Sample Number		Client Info		KCPA006966		
Sample Date		Client Info		31 Oct 2023		
Machine Age	hrs	Client Info		3972		
Oil Age	hrs	Client Info		0		
Oil Changed		Client Info		N/A		
Sample Status				ABNORMAL		
WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>50	0		
Chromium	ppm	ASTM D5185m	>10	0		
Nickel	ppm	ASTM D5185m	>3	0		
Titanium	ppm	ASTM D5185m	>3	0		
Silver	ppm	ASTM D5185m	>2	0		
Aluminum	ppm	ASTM D5185m	>10	0		
Lead	ppm	ASTM D5185m	>10	0		
Copper	ppm	ASTM D5185m	>50	9		
Tin	ppm	ASTM D5185m	>10	0		
Vanadium	ppm	ASTM D5185m		0		
Cadmium	ppm	ASTM D5185m		0		
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m		0		
Barium	ppm	ASTM D5185m	90	0		
Molybdenum	ppm	ASTM D5185m		0		
Manganese	ppm	ASTM D5185m		0		
Magnesium	ppm	ASTM D5185m	90	0		
Calcium	ppm	ASTM D5185m	2	0		
Phosphorus	ppm	ASTM D5185m		0		
Zinc	ppm	ASTM D5185m		0		
Sulfur	ppm	ASTM D5185m		13107		
CONTAMINANTS	3	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>25	<1		
Sodium	ppm	ASTM D5185m		<1		
Potassium	ppm	ASTM D5185m	>20	0		
Water	%	ASTM D6304	>0.05	0.005		
ppm Water	ppm	ASTM D6304	>500	53.6		
FLUID DEGRADA	ATION	method	limit/base	current	history1	history2


0.33

Acid Number (AN)

mg KOH/g ASTM D8045 0.4



## **OIL ANALYSIS REPORT**

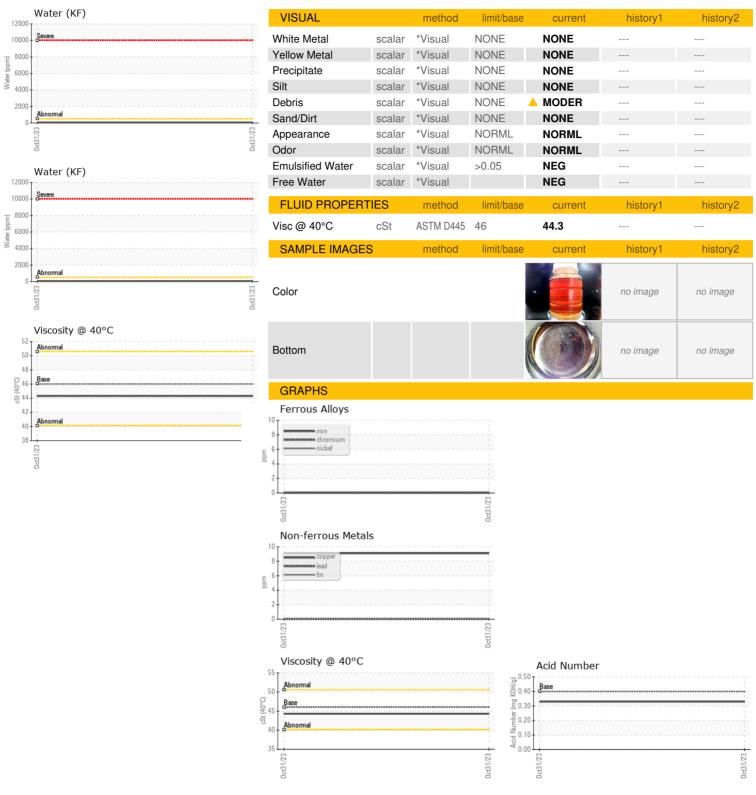





Laboratory Sample No. Lab Number Unique Number

: 05998456 : 10726816

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 : KCPA006966

Received Diagnosed

: 03 Nov 2023 : 07 Nov 2023

Diagnostician : Don Baldridge

Test Package : IND 2 ( Additional Tests: KF, PrtCount ) Certificate L2367 To discuss this sample report, contact Customer Service at 1-800-237-1369.

\* - Denotes test methods that are outside of the ISO 17025 scope of accreditation. Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012) **AMERISOURCE BERGEN** 

6301 LA SALLE DR LOCKBOURNE, OH

US 43137 Contact: M. BAUGHN

mbaughn@amerisourcebergen.com T:

F:

Contact/Location: M. BAUGHN - AMELOC