


## **PROBLEM SUMMARY**

# Sample Rating Trend WATER

#### Machine Id KAESER 8284837 Component

Compressor Fluid KAESER SIGMA (OEM) S-460 (--- GAL)

#### COMPONENT CONDITION SUMMARY

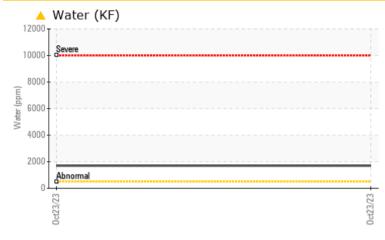

#### RECOMMENDATION

The filter change at the time of sampling has been noted. We advise that you stop the unit and follow the water drain-off procedure for this component. We recommend an early resample in 500 hours to monitor this condition.

PROBLEMATIC TEST RESULTS											
Sample Status				ABNORMAL							
Water	%	ASTM D6304	>0.05	<b>A</b> 0.170							
ppm Water	ppm	ASTM D6304	>500	<b>1700</b>							

Customer Id: IDLEAS Sample No.: KC124362 Lab Number: 06000510 Test Package: IND 2



To manage this report scan the QR code


To discuss the diagnosis or test data: Angela Borella +1 800-237-1369 angela.borella@wearcheckusa.com

*To change component or sample information:* Customer Service +1 1-800-237-1369 <u>customerservice@wearcheck.com</u> There are no recommended actions for this sample.

HISTORICAL DIAGNOSIS



### **OIL ANALYSIS REPORT**

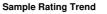



# KAESER 8284837

Component Compressor Fluid KAESER SIGMA (OEM) S-460 (--- GAL)

#### DIAGNOSIS

#### Recommendation

The filter change at the time of sampling has been noted. We advise that you stop the unit and follow the water drain-off procedure for this component. We recommend an early resample in 500 hours to monitor this condition.

#### Wear

All component wear rates are normal.

#### Contamination

There is a light concentration of water present in the oil. The amount and size of particulates present in the system are acceptable.


#### Fluid Condition


The AN level is acceptable for this fluid. The condition of the oil is acceptable for the time in service.


SAMPLE INFORM	<b>IATION</b>	method	limit/base	current	history1	history2
Sample Number		Client Info		KC124362		
Sample Date		Client Info		23 Oct 2023		
Machine Age	hrs	Client Info		8009		
Oil Age	hrs	Client Info		0		
Oil Changed		Client Info		N/A		
Sample Status				ABNORMAL		
WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>50	0		
Chromium	ppm	ASTM D5185m	>10	0		
Nickel	ppm	ASTM D5185m	>3	<1		
Titanium	ppm	ASTM D5185m	>3	0		
Silver	ppm	ASTM D5185m	>2	<1		
Aluminum	ppm	ASTM D5185m	>10	0		
Lead	ppm	ASTM D5185m	>10	<1		
Copper	ppm	ASTM D5185m	>50	11		
Tin	ppm	ASTM D5185m	>10	0		
Vanadium	ppm	ASTM D5185m		0		
Cadmium	ppm	ASTM D5185m		0		
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m		0		
Barium	ppm	ASTM D5185m	90	0		
Molybdenum	ppm	ASTM D5185m		0		
Manganese	ppm	ASTM D5185m		<1		
Magnesium	ppm	ASTM D5185m	90	14		
Calcium	ppm	ASTM D5185m	2	<1		
Phosphorus	ppm	ASTM D5185m		2		
Zinc	ppm	ASTM D5185m		0		
CONTAMINANTS	;	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>25	3		
Sodium	ppm	ASTM D5185m		8		
Potassium	ppm	ASTM D5185m	>20	2		
Water	%	ASTM D6304	>0.05	<b>A</b> 0.170		
ppm Water	ppm	ASTM D6304	>500	<b> </b> 1700		
FLUID CLEANLIN	IESS	method	limit/base	current	history1	history2
Particles >4µm		ASTM D7647		1795		
Particles >6µm		ASTM D7647	>1300	418		
Particles >14µm		ASTM D7647	>80	18		
Particles >21µm		ASTM D7647	>20	6		
Particles >38µm		ASTM D7647	>4	1		
Particles >71µm		ASTM D7647	>3	1		
Oil Cleanliness		ISO 4406 (c)	>/17/13	18/16/11		
FLUID DEGRADA	TION	method	limit/base	current	history1	history2




# **OIL ANALYSIS REPORT**

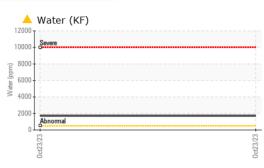

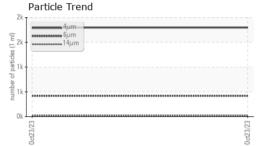

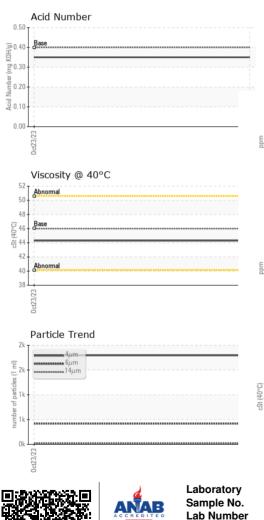

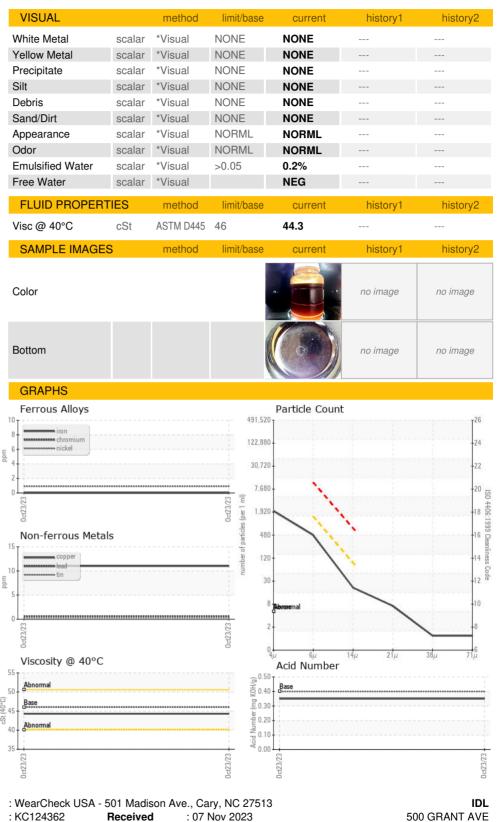

: 10728870 Test Package : IND 2 Certificate L2367 To discuss this sample report, contact Customer Service at 1-800-237-1369.

:06000510

Unique Number

\* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

Diagnosed

Diagnostician

: 14 Nov 2023 : Angela Borella

Contact/Location: Service Manager - IDLEAS

US 16029

EAST BUTLER, PA

Contact: Service Manager