

PROBLEM SUMMARY

PROBETROASH Machine Id R12 HOT FH

Component **Bearing** Fluid

ESSO NUTO H ISO 68 (2 QTS)

COMPONENT CONDITION SUMMARY

No relevant graphs to display

RECOMMENDATION

The oil change at the time of sampling has been noted. No corrective action is recommended at this time. Resample at the next service interval to monitor.

PROBLEMATIC TEST RESULTS									
Sample Status				ABNORMAL					
Debris	scalar	*Visual	NONE	▲ MODER					

Customer Id: JMSNEW Sample No.: BRI004851 Lab Number: 06007357 Test Package: IND 1

To manage this report scan the QR code

To discuss the diagnosis or test data:

Don Baldridge +1 don.b505@comcast.net

To change component or sample information: Customer Service +1 1-800-237-1369 customerservice@wearcheck.com

RECOMMENDED ACTIONS

There are no recommended actions for this sample.

HISTORICAL DIAGNOSIS



OIL ANALYSIS REPORT

Sample Rating Trend

VIS DEBRIS



history2

PROBETROASH Machine Id R12 HOT FH

Component

Bearing

ESSO NUTO H ISO 68 (2 QTS)

DIAGNOSIS

Recommendation

The oil change at the time of sampling has been noted. No corrective action is recommended at this time. Resample at the next service interval to monitor.

Wear


All component wear rates are normal.

Contamination

Moderate concentration of visible dirt/debris present in the oil.

Fluid Condition


The condition of the oil is acceptable for the time in service.

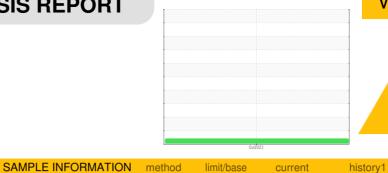


Sample Number		Client Info		BRI004851		
Sample Date		Client Info		17 Oct 2023		
Machine Age	mths	Client Info		24		
Oil Age	mths	Client Info		12		
Oil Changed		Client Info		Changed		
Sample Status				ABNORMAL		
CONTAMINATION	١	method	limit/base	current	history1	history2
Water		WC Method	>2	NEG		
WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>20	<1		
Chromium	ppm	ASTM D5185m	>20	0		
Nickel	ppm	ASTM D5185m	>20	<1		
Titanium	ppm	ASTM D5185m		0		
Silver	ppm	ASTM D5185m		0		
Aluminum	ppm	ASTM D5185m	>20	1		
Lead	ppm	ASTM D5185m	>20	0		
Copper	ppm	ASTM D5185m	>20	1		
Tin	ppm	ASTM D5185m	>20	0		
Vanadium	ppm	ASTM D5185m		0		
Cadmium	ppm	ASTM D5185m		0		
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m	0	0		
Barium	ppm	ASTM D5185m	0	0		
Molybdenum	ppm	ASTM D5185m	0	0		
Manganese	ppm	ASTM D5185m		<1		
Magnesium	ppm	ASTM D5185m	5	<1		
Calcium	ppm	ASTM D5185m	50	23		
Phosphorus	ppm	ASTM D5185m	330	339		
Zinc	ppm	ASTM D5185m	420	417		
Sulfur	ppm	ASTM D5185m	3100	2737		
CONTAMINANTS		method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>15	12		
Sodium	ppm	ASTM D5185m		2		
Potassium	ppm	ASTM D5185m	>20	<1		
VISUAL		method	limit/base	current	history1	history2
White Metal	scalar	*Visual	NONE	NONE		
Yellow Metal	scalar	*Visual	NONE	NONE		
Precipitate	scalar	*Visual	NONE	NONE		
Silt	scalar	*Visual	NONE	NONE		
Debris	scalar	*Visual	NONE	▲ MODER		
Sand/Dirt	scalar	*Visual	NONE	NONE		
Appearance	scalar	*Visual	NORML	NORML		
Odor	scalar	*Visual	NORML	NORML		
Emulsified Water	scalar	*Visual	>2	NEG		
Free Water	scalar	*Visual		NEG		
9:59:13) Rev: 1			Conta	act/Location: M	ICHAEL MARTII	NEZ - JMSNEW




OIL ANALYSIS REPORT

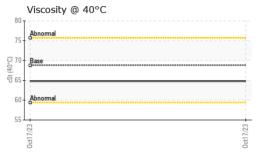


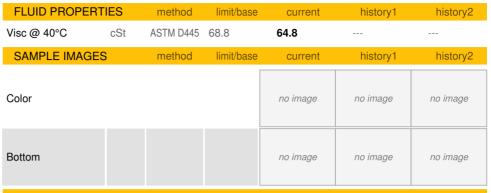

GRAPHS

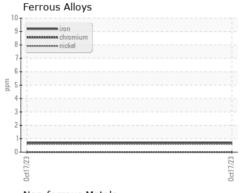

Non-ferrous Metals

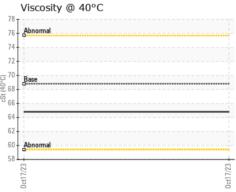



Certificate L2367

Laboratory Sample No. Lab Number Test Package : IND 1

: BRI004851 : 06007357 Unique Number : 10741119

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 Received : 14 Nov 2023 Diagnosed Diagnostician : Don Baldridge

: 23 Nov 2023

J.M. SMUCKER - FOLGERS 14601 OLD GENTILLY RD

NEW ORLEANS, LA US 70129

Contact: MICHAEL MARTINEZ michael.martinez@jmsmucker.com

To discuss this sample report, contact Customer Service at 1-800-237-1369. * - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

T:

F: