

PROBLEM SUMMARY


ISO

Machine Id KAESER 7094986 (S/N 1017)


Compressor

KAESER SIGMA (OEM) M-460 (--- GAL)



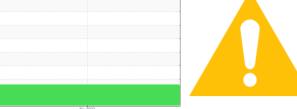

COMPONENT CONDITION SUMMARY

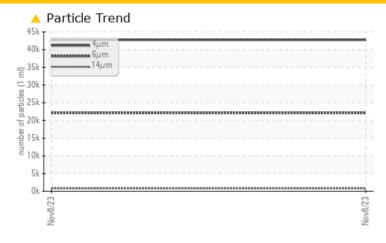

RECOMMENDATION

No corrective action is recommended at this time. The filter change at the time of sampling has been noted. Resample at the next service interval to monitor.

PROBLEMATIC TEST	RESULTS			
Sample Status			ABNORMAL	
Particles >6µm	ASTM D7647	>1300	<u>22112</u>	
Particles >14μm	ASTM D7647	>80	783	
Particles >21µm	ASTM D7647	>20	<u>▲</u> 82	
Oil Cleanliness	ISO 4406 (c)	>/17/13	23/22/17	

Customer Id: DSXAFF Sample No.: KCPA009045 Lab Number: 06007719 Test Package: IND 2



To manage this report scan the QR code

To discuss the diagnosis or test data:

Don Baldridge +1 don.b505@comcast.net

To change component or sample information: Customer Service +1 1-800-237-1369 customerservice@wearcheck.com

RECOMMENDED ACTIONS

There are no recommended actions for this sample.

HISTORICAL DIAGNOSIS



OIL ANALYSIS REPORT

T

Sample Rating Trend

ISO



Machine Id

KAESER 7094986 (S/N 1017)

Component

Compressor

KAESER SIGMA (OEM) M-460 (--- GAL)

DIAGNOSIS

Recommendation

No corrective action is recommended at this time. The filter change at the time of sampling has been noted. Resample at the next service interval to monitor.

Wear

All component wear rates are normal.

Contamination

There is a high amount of particulates present in the oil.

Fluid Condition

The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

,						
				Nov2023		
SAMPLE INFORM	MATION	method	limit/base	current	history1	history2
Sample Number		Client Info		KCPA009045		
Sample Date		Client Info		08 Nov 2023		
Machine Age	hrs	Client Info		2371		
Oil Age	hrs	Client Info		0		
Oil Changed		Client Info		N/A		
Sample Status				ABNORMAL		
WEAR METALS		method	limit/base	current	history1	history2
ron	ppm	ASTM D5185m	>50	0		
Chromium	ppm	ASTM D5185m	>10	0		
Nickel	ppm	ASTM D5185m	>3	0		
Γitanium	ppm	ASTM D5185m	>3	<1		
Silver	ppm	ASTM D5185m	>2	0		
Aluminum	ppm	ASTM D5185m	>10	0		
_ead	ppm	ASTM D5185m	>10	0		
Copper	ppm	ASTM D5185m	>50	20		
 Γin	ppm	ASTM D5185m	>10	0		
/anadium	ppm	ASTM D5185m		<1		
Cadmium	ppm	ASTM D5185m		0		
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m	0	0		
Barium	ppm	ASTM D5185m	90	0		
Molybdenum	ppm	ASTM D5185m	0	0		
Manganese	ppm	ASTM D5185m		0		
Magnesium	ppm	ASTM D5185m	100	0		
Calcium	ppm	ASTM D5185m	0	0		
Phosphorus	ppm	ASTM D5185m	0	0		
Zinc	ppm	ASTM D5185m	0	0		
Sulfur	ppm	ASTM D5185m	23500	17256		
CONTAMINANTS	6	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>25	2		
Sodium	ppm	ASTM D5185m		5		
Potassium	ppm	ASTM D5185m	>20	0		
Water	%	ASTM D6304	>0.05	0.008		
opm Water	ppm	ASTM D6304	>500	84.8		
FLUID CLEANLIN	IESS	method	limit/base	current	history1	history2
Particles >4µm		ASTM D7647		42761		
Particles >6µm		ASTM D7647	>1300	<u>^</u> 22112		
Particles >14µm		ASTM D7647	>80	<u> </u>		
Particles >21µm		ASTM D7647	>20	<u> </u>		
Particles >38µm		ASTM D7647	>4	1		
Particles >71µm		ASTM D7647		0		
α. ποιου > / τμιτι						

ISO 4406 (c) >--/17/13 **423/22/17**

limit/base

current

0.26

method

mg KOH/g ASTM D8045 1.0

Oil Cleanliness

Acid Number (AN)


FLUID DEGRADATION

history1

history2



OIL ANALYSIS REPORT

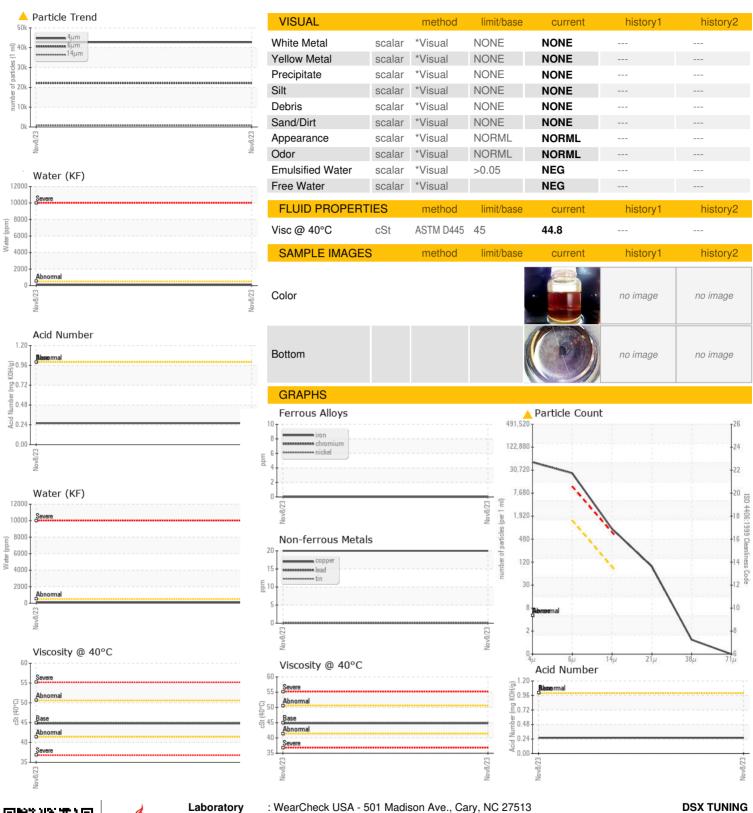





Certificate L2367

Laboratory Sample No. Lab Number **Unique Number**

: 06007719

: KCPA009045 : 10741481

Received Diagnosed

: 14 Nov 2023 : 16 Nov 2023 Diagnostician : Don Baldridge

Test Package : IND 2 (Additional Tests: KF, PrtCount) To discuss this sample report, contact Customer Service at 1-800-237-1369.

* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

9783 REAVIS PARK DR

AFFTON, MO US 63123

Contact: DAVE dave@dsxtuning.com

T: F:

Contact/Location: DAVE ? - DSXAFF