

No relevant graphs to display

RECOMMENDATION

No corrective action is recommended at this time. The filter change at the time of sampling has been noted. Resample at the next service interval to monitor. We were unable to perform a particle count due to a high concentration of particles present in this sample.

PROBLEMATIC TEST RESULTS						
Sample Status				ABNORMAL	NORMAL	NORMAL
Debris	scalar	*Visual	NONE	A MODER	NONE	NONE

Customer Id: DENBRO Sample No.: KCPA007138 Lab Number: 06008317 Test Package: IND 2



To manage this report scan the QR code

To discuss the diagnosis or test data: Don Baldridge +1 <u>don.b505@comcast.net</u>

To change component or sample information: Customer Service +1 1-800-237-1369 <u>customerservice@wearcheck.com</u>

RECOMMEND	DED ACTIONS			
Action	Status	Date	Done By	Descr
Alert			?	We we particl

Description

We were unable to perform a particle count due to a high concentration of particles present in this sample.

HISTORICAL DIAGNOSIS

23 May 2022 Diag: Jonathan Hester



Resample at the next service interval to monitor.All component wear rates are normal. The amount and size of particulates present in the system are acceptable. There is no indication of any contamination in the oil. The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.



view report

04 Jan 2022 Diag: Don Baldridge

NORMAL



Resample at the next service interval to monitor.All component wear rates are normal. The amount and size of particulates present in the system are acceptable. There is no indication of any contamination in the oil. The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

29 Oct 2020 Diag: Jonathan Hester

Resample at the next service interval to monitor.All component wear rates are normal. There is no indication of any contamination in the oil. The amount and size of particulates present in the system are acceptable. The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.









OIL ANALYSIS REPORT

Machine Id KAESER SM 10 6119350 (S/N 1022) Component

Compressor

KAESER SIGMA (OEM) S-460 (--- GAL)

DIAGNOSIS

Recommendation

No corrective action is recommended at this time. The filter change at the time of sampling has been noted. Resample at the next service interval to monitor. We were unable to perform a particle count due to a high concentration of particles present in this sample.

Wear


All component wear rates are normal.

Contamination

Moderate concentration of visible dirt/debris present in the oil.

Fluid Condition

The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

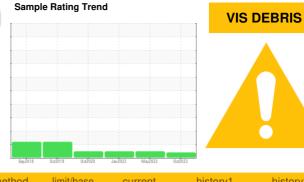

SAMPLE INFORM	IATION	method	limit/base	current	history1	history2
Sample Number		Client Info		KCPA007138	KC96795	KCP42924
Sample Date		Client Info		02 Oct 2023	23 May 2022	04 Jan 2022
Machine Age	hrs	Client Info		31659	28150	21608
Oil Age	hrs	Client Info		0	6542	4000
Oil Changed		Client Info		N/A	Changed	Changed
Sample Status				ABNORMAL	NORMAL	NORMAL
WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>50	0	0	0
Chromium	ppm	ASTM D5185m	>10	0	0	0
Nickel	ppm	ASTM D5185m	>3	0	0	0
Titanium	ppm	ASTM D5185m	>3	0	0	0
Silver	ppm	ASTM D5185m	>2	0	0	<1
Aluminum	ppm	ASTM D5185m	>10	0	0	0
Lead	ppm	ASTM D5185m	>10	0	0	0
Copper	ppm	ASTM D5185m	>50	7	8	11
Tin	ppm	ASTM D5185m	>10	0	0	0
Antimony	ppm	ASTM D5185m				0
Vanadium	ppm	ASTM D5185m		<1	0	0
Cadmium	ppm	ASTM D5185m		0	0	0
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m		0	0	4
Barium	ppm	ASTM D5185m	90	<1	0	0
Molybdenum	ppm	ASTM D5185m		0	0	0
Manganese	ppm	ASTM D5185m		<1	0	0
Magnesium	ppm	ASTM D5185m	90	16	<1	<1
Calcium	ppm	ASTM D5185m	2	0	0	0
Phosphorus	ppm	ASTM D5185m		0	4	<1
Zinc	ppm	ASTM D5185m		27	0	0
Sulfur	ppm	ASTM D5185m		20441	13144	14568
CONTAMINANTS		method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>25	<1	<1	0
Sodium	ppm	ASTM D5185m		3	<1	0
Potassium	ppm	ASTM D5185m	>20	<1	0	0
Water	%	ASTM D6304	>0.05	0.006	0.005	0.001
ppm Water	ppm	ASTM D6304	>500	69.0	54.2	13.3
FLUID CLEANLIN	IESS	method	limit/base	current	history1	history2
Particles >4µm		ASTM D7647			2075	193
Particles >6µm		ASTM D7647	>1300		343	60
Particles >14µm		ASTM D7647	>80		22	5
Particles >21µm		ASTM D7647	>20		6	0
Particles >38µm		ASTM D7647	>4		0	0
Particles >71µm		ASTM D7647	>3		0	0
Oil Cleanliness		ISO 4406 (c)	>/17/13		18/16/12	13/10
FLUID DEGRADA	TION	method	limit/base	current	history1	history2

Acid Number (AN)

mg KOH/g ASTM D8045 0.4


0.34 0.33 0.299


Report Id: DENBRO [WUSCAR] 06008317 (Generated: 11/17/2023 13:47:04) Rev: 1


Contact/Location: Service Manager - DENBRO



OIL ANALYSIS REPORT

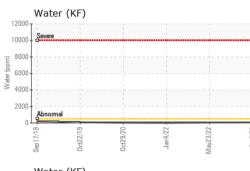


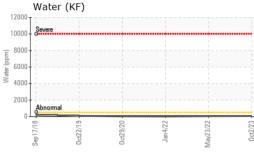

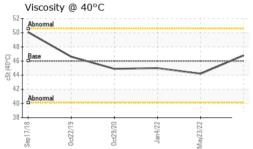


VISUAL		method	limit/base	current	history1	history2
White Metal	scalar	*Visual	NONE	NONE	NONE	NONE
Yellow Metal	scalar	*Visual	NONE	NONE	NONE	NONE
Precipitate	scalar	*Visual	NONE	NONE	NONE	NONE
Silt	scalar	*Visual	NONE	NONE	NONE	NONE
Debris	scalar	*Visual	NONE	🔺 MODER	NONE	NONE
Sand/Dirt	scalar	*Visual	NONE	NONE	NONE	NONE
Appearance	scalar	*Visual	NORML	NORML	NORML	NORML
Odor	scalar	*Visual	NORML	NORML	NORML	NORML
Emulsified Water	scalar	*Visual	>0.05	NEG	NEG	NEG
Free Water	scalar	*Visual		NEG	NEG	NEG
FLUID PROPERT	IES	method	limit/base	current	history1	history2
Visc @ 40°C	cSt	ASTM D445	46	46.8	44.2	45.0
SAMPLE IMAGES	6	method	limit/base	current	history1	history2

Color

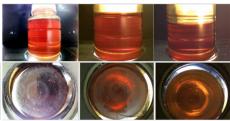

Bottom

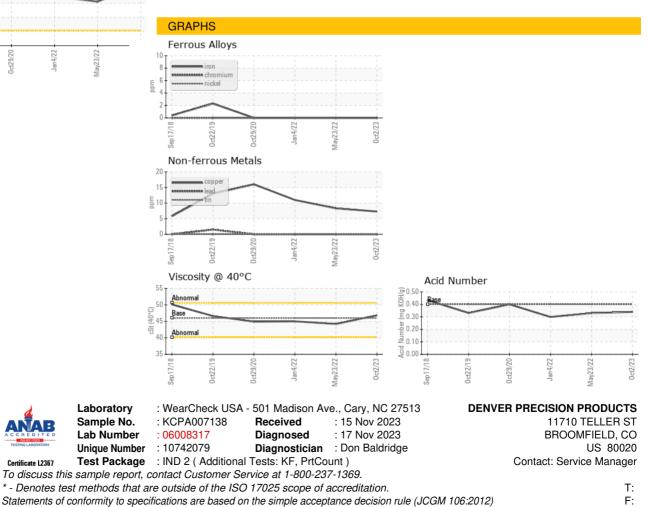

Contact/Location: Service Manager - DENBRO