


# **PROBLEM SUMMARY**


# RANDO HD 32 [SR2928391] JOY 8808 - PALISADES

Component

Compressor

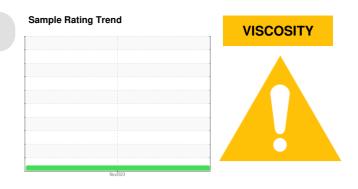

### **COMPONENT CONDITION SUMMARY**

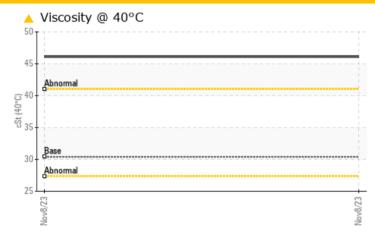

### RECOMMENDATION

Resample at the next service interval to monitor.

PROBLEMATIC TEST RESULTS										
Sample Status			ATTENTION							
Visc @ 40°C	cSt	ASTM D445	30.4	<b>46.1</b>						

Customer Id: UCCISSAC **Sample No.:** UCH06009732 Lab Number: 06009732 Test Package: IND 2 To manage this report scan the QR code To discuss the diagnosis or test data: Doug Bogart +1 (800)237-1369 x4016 dougb@wearcheckusa.com To change component or sample information: Customer Service +1 1-800-237-1369 customerservice@wearcheck.com

### RECOMMENDED ACTIONS

There are no recommended actions for this sample.

### HISTORICAL DIAGNOSIS




# **OIL ANALYSIS REPORT**

# Area RANDO HD 32 [SR2928391]

Component

Compressor

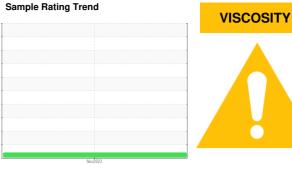

### DIAGNOSIS

### Recommendation

Resample at the next service interval to monitor.

**JOY 8808 - PALISADES** 

#### Moor

All component wear rates are normal.

### Contamination

There is no indication of any contamination in the oil


### Fluid Condition

Viscosity of sample indicates oil is within ISO 46 range, advise investigate. Confirm oil type. The AN level is acceptable for this fluid.

				Nov2023		
SAMPLE INFORM	MATION	method	limit/base	current	history1	history2
Sample Number		Client Info		UCH06009732		
Sample Date		Client Info		08 Nov 2023		
Machine Age	hrs	Client Info		12011		
Oil Age	hrs	Client Info		0		
Oil Changed		Client Info		N/A		
Sample Status				ATTENTION		
WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>50	0		
Chromium	ppm	ASTM D5185m	>10	0		
Nickel	ppm	ASTM D5185m		0		
Titanium	ppm	ASTM D5185m		0		
Silver	ppm	ASTM D5185m		0		
Aluminum	ppm	ASTM D5185m	>25	0		
Lead	ppm	ASTM D5185m	>25	0		
Copper	ppm	ASTM D5185m	>50	<1		
Tin	ppm	ASTM D5185m	>15	0		
Vanadium	ppm	ASTM D5185m		0		
Cadmium	ppm	ASTM D5185m		0		
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m		0		
Barium	ppm	ASTM D5185m		<1		
Molybdenum	ppm	ASTM D5185m		0		
Manganese	ppm	ASTM D5185m		0		
Magnesium	ppm	ASTM D5185m		0		
Calcium	ppm	ASTM D5185m		44		
Phosphorus	ppm	ASTM D5185m		320		
Zinc	ppm	ASTM D5185m		454		
Sulfur	ppm	ASTM D5185m		789		
CONTAMINANTS	)	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>25	<1		
Sodium	ppm	ASTM D5185m		2		
Potassium	ppm	ASTM D5185m	>20	0		
FLUID DEGRADA	TION	method	limit/base	current	history1	history2
Acid Number (AN)	mg KOH/g	ASTM D8045		0.34		
VISUAL		method	limit/base	current	history1	history2
White Metal	scalar	*Visual	NONE	NONE		
Yellow Metal	scalar	*Visual	NONE	NONE		
Precipitate	scalar	*Visual	NONE	NONE		
Silt	scalar	*Visual	NONE	NONE		
Debris	scalar	*Visual	NONE	NONE		
Sand/Dirt	scalar	*Visual	NONE	NONE		
Appearance	scalar	*Visual	NORML	NORML		
Odor	scalar	*Visual	NORML	NORML		
Emulsified Water	scalar	*Visual	>0.1	NEG		
Free Water	scalar	*Visual		NEG		
4 4 4 0E/ D						



## **OIL ANALYSIS REPORT**

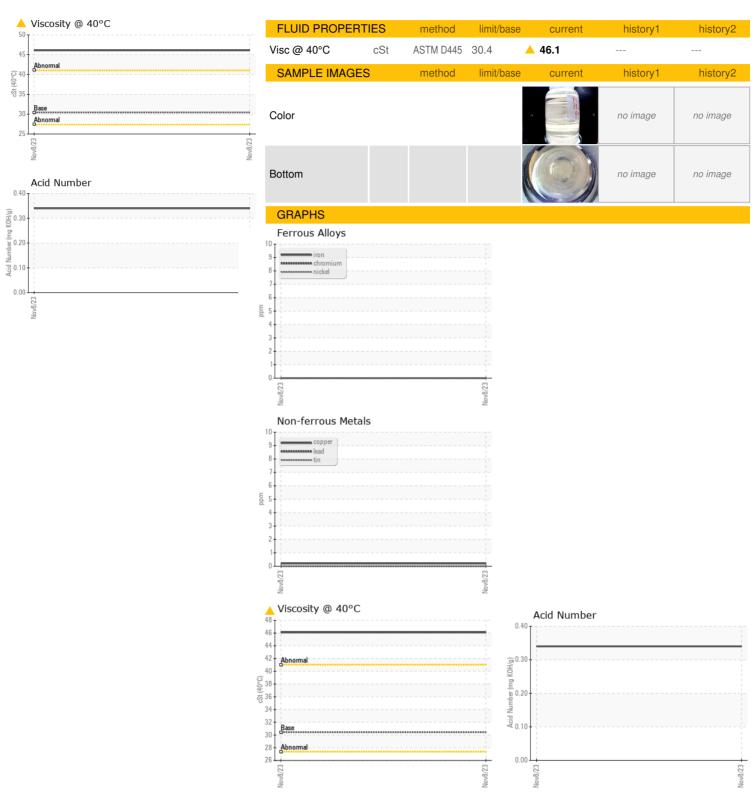





Certificate L2367

Laboratory Sample No. Lab Number

: UCH06009732 : 06009732 Unique Number : 10743494 Test Package : IND 2

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 Received : 16 Nov 2023 Diagnosed

: 17 Nov 2023 Diagnostician : Doug Bogart

214 27TH ST SACRAMENTO, CA US 95816

**CISCO AIR SYSTEMS** 

Contact: BARRY FRKOVICH barryfrkovich@ciscoair.com

T: (916)444-2525

To discuss this sample report, contact Customer Service at 1-800-237-1369.

\* - Denotes test methods that are outside of the ISO 17025 scope of accreditation. Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

Contact/Location: BARRY FRKOVICH - UCCISSAC

F: x: