

# **PROBLEM SUMMARY**


# Machine Id KAESER 7439791 (S/N 1517)

Compressor

KAESER SIGMA (OEM) M-460 (--- GAL)

# Sample Rating Trend ISO

# **COMPONENT CONDITION SUMMARY**

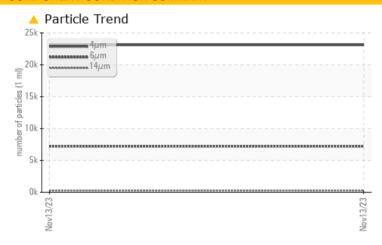

# RECOMMENDATION

No corrective action is recommended at this time. The filter change at the time of sampling has been noted. Resample at the next service interval to monitor.

PROBLEMATIC TEST RESULTS									
Sample Status			<b>ABNORMAL</b>						
Particles >6µm	ASTM D7647	>1300	<u> </u>						
Particles >14μm	ASTM D7647	>80	<b>275</b>						
Particles >21μm	ASTM D7647	>20	<u> </u>		***				
Oil Cleanliness	ISO 4406 (c)	>17/13	<b>20/15</b>						

Customer Id: QUAGREPA Sample No.: KC06010797 Lab Number: 06010797 Test Package: IND 2



To manage this report scan the QR code

To discuss the diagnosis or test data:

Don Baldridge +1 don.b505@comcast.net

To change component or sample information: Customer Service +1 1-800-237-1369 customerservice@wearcheck.com

# RECOMMENDED ACTIONS

There are no recommended actions for this sample.

# HISTORICAL DIAGNOSIS



# **OIL ANALYSIS REPORT**

Sample Rating Trend

ISO

# KAESER 7439791 (S/N 1517)

Compressor

KAESER SIGMA (OEM) M-460 (--- GAL)

# **DIAGNOSIS**

# Recommendation

No corrective action is recommended at this time. The filter change at the time of sampling has been noted. Resample at the next service interval to monitor.

# Wear

All component wear rates are normal.

# Contamination

There is a high amount of particulates present in the oil.

# **Fluid Condition**

The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

				Nov2023		
SAMPLE INFORM	MATION	method	limit/base	current	history1	history2
Sample Number		Client Info		KC06010797		
Sample Date		Client Info		13 Nov 2023		
Machine Age	hrs	Client Info		11507		
Oil Age	hrs	Client Info		0		
Oil Changed		Client Info		N/A		
Sample Status				ABNORMAL		
WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>50	0		
Chromium	ppm	ASTM D5185m	>10	0		
Nickel	ppm	ASTM D5185m	>3	0		
Titanium	ppm	ASTM D5185m	>3	0		
Silver	ppm	ASTM D5185m	>2	0		
Aluminum	ppm	ASTM D5185m	>10	0		
Lead	ppm	ASTM D5185m	>10	0		
Copper	ppm	ASTM D5185m	>50	2		
Tin	ppm	ASTM D5185m	>10	0		
Vanadium	ppm	ASTM D5185m		0		
Cadmium	ppm	ASTM D5185m		0		
ADDITIVES	''	method	limit/base	current	history1	history2
Boron	nnm	ASTM D5185m	0	0		
Barium	ppm	ASTM D5185m	90	8		
	ppm	ASTM D5185m	0	0		
Molybdenum	ppm	ASTM D5185m	U	0		
Manganese	ppm		100	_		
Magnesium	ppm	ASTM D5185m		34 0		
Calcium	ppm	ASTM D5185m	0	-		
Phosphorus	ppm	ASTM D5185m	0	1		
Zinc	ppm	ASTM D5185m	0	18		
CONTAMINANTS		method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>25	4		
Sodium	ppm	ASTM D5185m		20		
Potassium	ppm	ASTM D5185m	>20	7		
Water	%	ASTM D6304	>0.05	0.016		
ppm Water	ppm	ASTM D6304	>500	169.1		
FLUID CLEANLIN	IESS	method	limit/base	current	history1	history2
Particles >4μm		ASTM D7647		23110		
Particles >6µm		ASTM D7647	>1300	<u> </u>		
Particles >14μm		ASTM D7647	>80	<b>275</b>		
Particles >21µm		ASTM D7647	>20	<u></u> 41		
Particles >38µm		ASTM D7647	>4	1		
Particles >71µm		ASTM D7647	>3	0		
Oil Cleanliness		ISO 4406 (c)	>17/13	<b>20/15</b>		
ELLID DECDADA	TION	mathad	limit/bass		for the second	111

FLUID DEGRADATION

Acid Number (AN)

method

mg KOH/g ASTM D8045 1.0

limit/base

current


0.22

history1

history2



# **OIL ANALYSIS REPORT**

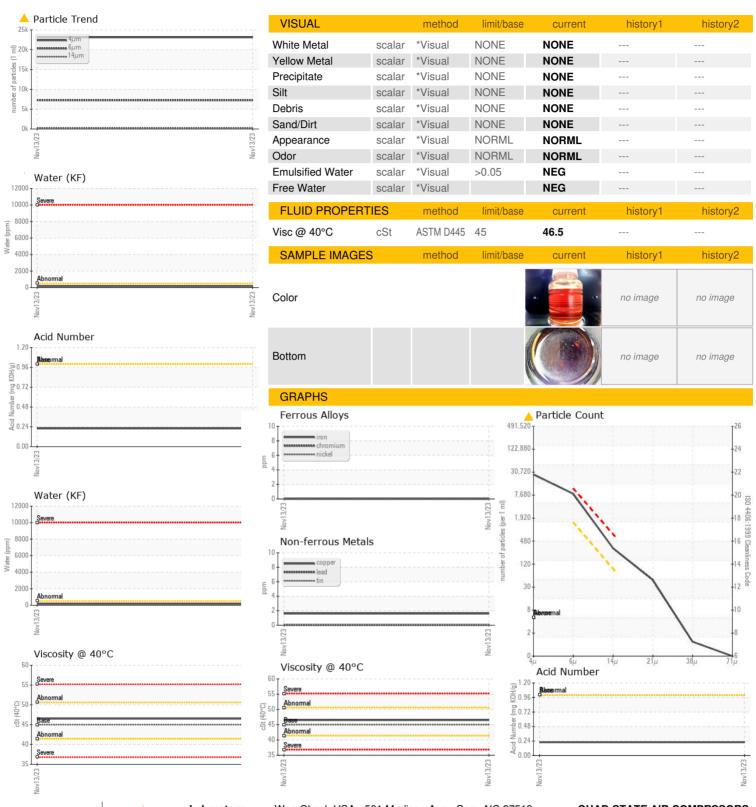



Certificate L2367

Laboratory Sample No. Lab Number

**Unique Number** 

: KC06010797 : 06010797 : 10749941 Test Package : IND 2

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 : 17 Nov 2023 Received Diagnosed : 20 Nov 2023

Diagnostician

: Don Baldridge

To discuss this sample report, contact Customer Service at 1-800-237-1369. \* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

**QUAD-STATE AIR COMPRSSORS** 

362 SOUTH CARLISLE STREET GREENCASTLE, PA

US 17225

Contact: MARK SHAWYER mark@quadstateair.com

> T: (717)597-9150 F: (717)597-9153