


PROBLEM SUMMARY


Sample Rating Trend

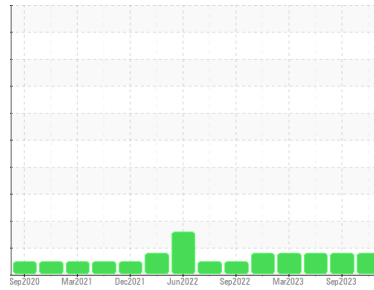

Machine Id
TOLE_U5 TOLE_U5_P5
 Component
Drive End Pump
 Fluid
ROYAL PURPLE SYNFILM GT 32 (2 QTS)

COMPONENT CONDITION SUMMARY

▲ Non-ferrous Metals

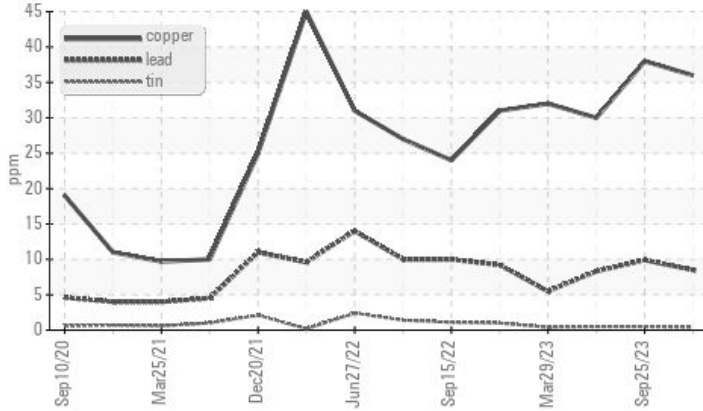

RECOMMENDATION

No corrective action is recommended at this time.
 Resample at the next service interval to monitor.

PROBLEMATIC TEST RESULTS

Sample Status	ABNORMAL	ABNORMAL	ABNORMAL
Copper	ppm ASTM D5185m >30 ▲ 36	▲ 38	▲ 30

Customer Id: ENEORE2
 Sample No.: RP0025468
 Lab Number: 06016499
 Test Package: PLANT



To manage this report scan the QR code

To discuss the diagnosis or test data:
 Jonathan Hester +1 919-379-4092 x4092
jhester@wearcheckusa.com

To change component or sample information:
 Customer Service +1 1-800-237-1369
customerservice@wearcheck.com

RECOMMENDED ACTIONS

There are no recommended actions for this sample.

HISTORICAL DIAGNOSIS

25 Sep 2023 Diag: Don Baldrige

WEAR



No corrective action is recommended at this time. Resample at the next service interval to monitor. The copper level is abnormal. All other component wear rates are normal. There is no indication of any contamination in the oil. The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

view report



06 Jun 2023 Diag: Don Baldrige

WEAR



No corrective action is recommended at this time. Resample at the next service interval to monitor. The copper level is abnormal. All other component wear rates are normal. There is no indication of any contamination in the oil. The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

view report



29 Mar 2023 Diag: Angela Borella

WEAR



No corrective action is recommended at this time. Resample at the next service interval to monitor. The copper level is abnormal. All other component wear rates are normal. There is no indication of any contamination in the oil. The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.


view report





OIL ANALYSIS REPORT

Sample Rating Trend

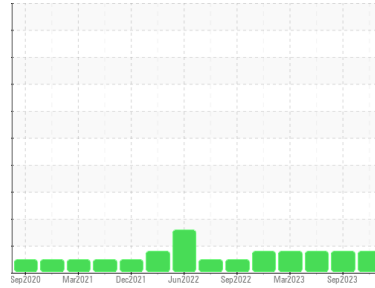

WEAR



Machine Id
TOLE_U5 TOLE_U5_P5
 Component
Drive End Pump
 Fluid
ROYAL PURPLE SYNFILM GT 32 (2 QTS)

DIAGNOSIS

Recommendation

No corrective action is recommended at this time. Resample at the next service interval to monitor.

Wear

The copper level is abnormal. All other component wear rates are normal.

Contamination

The water content is negligible. There is no indication of any contamination in the oil.

Fluid Condition

The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

SAMPLE INFORMATION

method	limit/base	current	history1	history2
Sample Number	Client Info	RP0025468	RP0026204	RP0025433
Sample Date	Client Info	16 Nov 2023	25 Sep 2023	06 Jun 2023
Machine Age	hrs	Client Info	0	0
Oil Age	hrs	Client Info	0	0
Oil Changed	Client Info	N/A	N/A	N/A
Sample Status		ABNORMAL	ABNORMAL	ABNORMAL

WEAR METALS

method	limit/base	current	history1	history2	
Iron	ppm	ASTM D5185m >90	4	6	5
Chromium	ppm	ASTM D5185m >5	0	0	0
Nickel	ppm	ASTM D5185m >5	<1	<1	0
Titanium	ppm	ASTM D5185m >3	0	0	<1
Silver	ppm	ASTM D5185m >3	0	0	0
Aluminum	ppm	ASTM D5185m >7	0	0	<1
Lead	ppm	ASTM D5185m >12	8	10	8
Copper	ppm	ASTM D5185m >30	▲ 36	▲ 38	▲ 30
Tin	ppm	ASTM D5185m >9	<1	<1	<1
Vanadium	ppm	ASTM D5185m	0	0	0
Cadmium	ppm	ASTM D5185m	0	0	0

ADDITIVES

method	limit/base	current	history1	history2	
Boron	ppm	ASTM D5185m	0	0	0
Barium	ppm	ASTM D5185m	0	0	0
Molybdenum	ppm	ASTM D5185m	0	0	0
Manganese	ppm	ASTM D5185m	<1	<1	<1
Magnesium	ppm	ASTM D5185m	5	4	6
Calcium	ppm	ASTM D5185m	<1	0	0
Phosphorus	ppm	ASTM D5185m	4	8	7
Zinc	ppm	ASTM D5185m	4	16	0

CONTAMINANTS

method	limit/base	current	history1	history2	
Silicon	ppm	ASTM D5185m >60	<1	<1	<1
Sodium	ppm	ASTM D5185m	1	0	<1
Potassium	ppm	ASTM D5185m >20	<1	1	0
Water	%	ASTM D6304 >.1	0.006	0.008	0.003
ppm Water	ppm	ASTM D6304 >1000	64	86.6	33.4





FLUID DEGRADATION

method	limit/base	current	history1	history2	
Acid Number (AN)	mg KOH/g	ASTM D8045	0.417	0.51	0.49

VISUAL

method	limit/base	current	history1	history2	
White Metal	scalar	*Visual NONE	NONE	NONE	NONE
Yellow Metal	scalar	*Visual NONE	NONE	NONE	NONE
Precipitate	scalar	*Visual NONE	NONE	NONE	NONE
Silt	scalar	*Visual NONE	NONE	NONE	NONE
Debris	scalar	*Visual NONE	NONE	NONE	NONE
Sand/Dirt	scalar	*Visual NONE	NONE	NONE	NONE
Appearance	scalar	*Visual NORML	NORML	NORML	NORML
Odor	scalar	*Visual NORML	NORML	NORML	NORML
Emulsified Water	scalar	*Visual >.1	NEG	NEG	NEG
Free Water	scalar	*Visual	NEG	NEG	NEG


OIL ANALYSIS REPORT

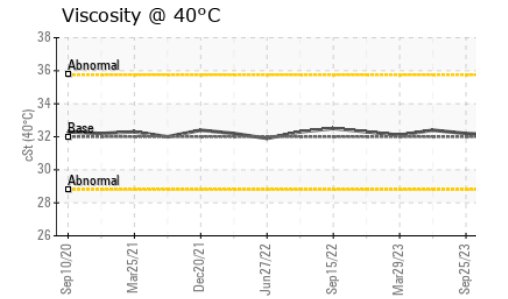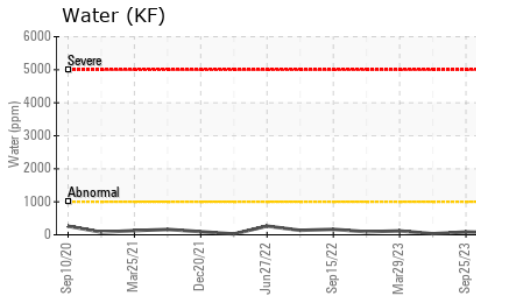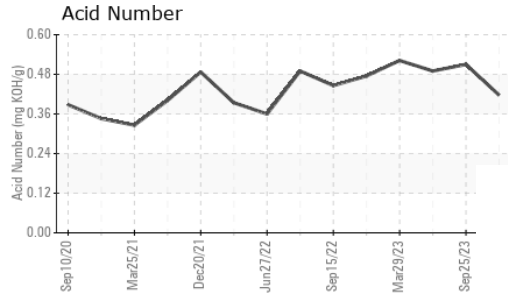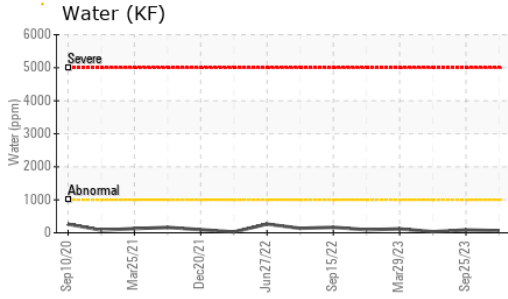

FLUID PROPERTIES		method	limit/base	current	history1	history2
Visc @ 40°C	cSt	ASTM D445	32	32.1	32.2	32.4

SAMPLE IMAGES		method	limit/base	current	history1	history2
---------------	--	--------	------------	---------	----------	----------





Color



Bottom



GRAPHS

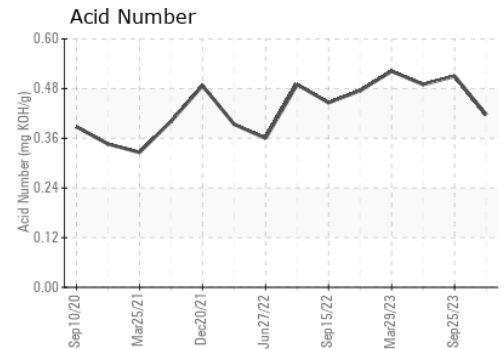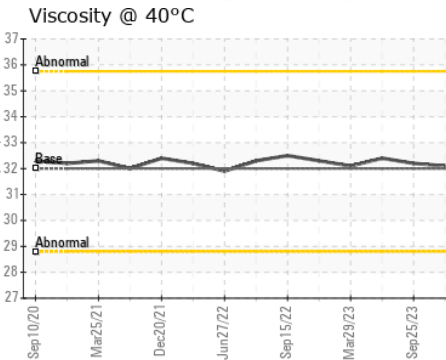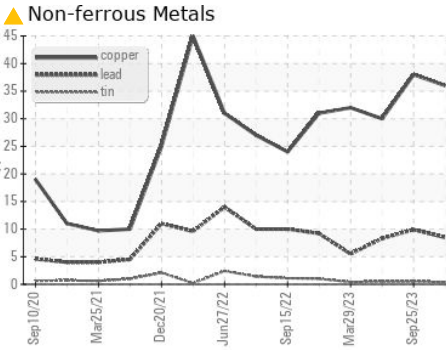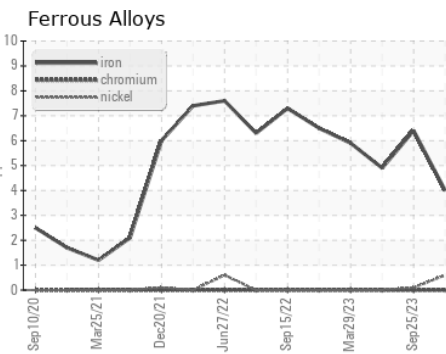

Certificate L2367

Laboratory : WearCheck USA - 501 Madison Ave., Cary, NC 27513
Sample No. : RP0025468 **Received** : 24 Nov 2023
Lab Number : 06016499 **Diagnosed** : 28 Nov 2023
Unique Number : 10755643 **Diagnostician** : Jonathan Hester
Test Package : PLANT

ENERGY TRANSFER - TOLEDO
 2549 BROWN ROAD
 OREGON, OH
 US 43616
 Contact: DARREN GRANT

To discuss this sample report, contact Customer Service at 1-800-237-1369.

* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

T: (419)389-7403

F: