



PROBLEM SUMMARY

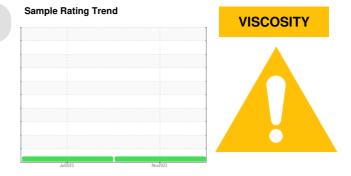

Machine Id 600 HP Component Outboard Bearing Fluid MOBIL 150 (--- GAL)

COMPONENT CONDITION SUMMARY

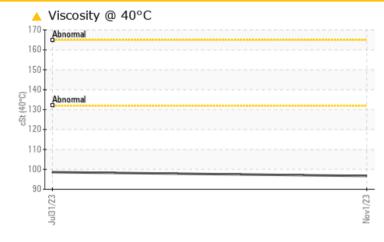

RECOMMENDATION

No corrective action is recommended at this time. Resample at the next service interval to monitor.

PROBLEMATIC TEST RESULTS										
Sample Status			ATTENTION	ATTENTION						
Visc @ 40°C	cSt	ASTM D445	<u> </u>	▲ 98.6						

Customer Id: ENELONRP Sample No.: RP0032097 Lab Number: 06016552 Test Package: IND 2



To manage this report scan the QR code

To discuss the diagnosis or test data: Jonathan Hester +1 919-379-4092 x4092 jhester@wearcheckusa.com

To change component or sample information: Customer Service +1 1-800-237-1369 customerservice@wearcheck.com There are no recommended actions for this sample.

HISTORICAL DIAGNOSIS

31 Jul 2023 Diag: Jonathan Hester

VISCOSITY



No corrective action is recommended at this time. Resample at the next service interval to monitor.All component wear rates are normal. The water content is negligible. There is no indication of any contamination in the oil. Viscosity of sample indicates oil is within ISO 100 range, advise investigate. Confirm oil type. The AN level is acceptable for this fluid.





OIL ANALYSIS REPORT

Sample Rating Trend



Machine Id 600 HP Component Outboard Bearing Fluid MOBIL 150 (--- GAL)

DIAGNOSIS

A Recommendation

No corrective action is recommended at this time. Resample at the next service interval to monitor.

Wear

All component wear rates are normal.

Contamination

The water content is negligible. There is no indication of any contamination in the oil.


Fluid Condition

Viscosity of sample indicates oil is within ISO 100 range, advise investigate. Confirm oil type. The AN level is acceptable for this fluid.

SAMPLE INFORM	IATION	method	limit/base	current	history1	history2
Sample Number		Client Info		RP0032097	RP0032078	
Sample Date		Client Info		01 Nov 2023	31 Jul 2023	
Machine Age	hrs	Client Info		0	0	
Oil Age	hrs	Client Info		0	0	
Oil Changed		Client Info		N/A	N/A	
Sample Status				ATTENTION	ATTENTION	
WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>20	0	0	
Chromium	ppm	ASTM D5185m	>20	0	0	
Nickel	ppm	ASTM D5185m	>20	<1	0	
Titanium	ppm	ASTM D5185m		0	0	
Silver	ppm	ASTM D5185m		0	0	
Aluminum	ppm	ASTM D5185m	>20	0	1	
Lead	ppm	ASTM D5185m	>20	0	0	
Copper	ppm	ASTM D5185m		0	0	
Tin	ppm	ASTM D5185m	>20	۲ ۲	0	
Vanadium	ppm	ASTM D5185m		0	0	
Cadmium	ppm	ASTM D5185m		0	0	
ADDITIVES	ppm	method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m	IIIIII/base	0	0	
Barium		ASTM D5185m		0	0	
	ppm					
Molybdenum	ppm	ASTM D5185m		0	0	
Manganese	ppm	ASTM D5185m		0	<1	
Magnesium	ppm	ASTM D5185m		1	2	
Calcium	ppm	ASTM D5185m		<1	1	
Phosphorus	ppm	ASTM D5185m		156	157	
Zinc	ppm	ASTM D5185m		78	93	
CONTAMINANTS	;	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>15	<1	<1	
Sodium	ppm	ASTM D5185m		<1	0	
Potassium	ppm	ASTM D5185m	>20	<1	0	
Water	%	ASTM D6304	>2	0.005	0.003	
ppm Water	ppm	ASTM D6304		56	37.8	
FLUID DEGRADA	TION	method	limit/base	current	history1	history2
Acid Number (AN)	mg KOH/g	ASTM D8045		0.10	0.16	
VISUAL		method	limit/base	current	history1	history2
White Metal	scalar	*Visual	NONE	NONE	NONE	
Yellow Metal	scalar	*Visual	NONE	NONE	NONE	
Precipitate	scalar	*Visual	NONE	NONE	NONE	
Silt	scalar	*Visual	NONE	NONE	NONE	
Debris	scalar	*Visual	NONE	LIGHT	NONE	
Sand/Dirt	scalar	*Visual	NONE	NONE	NONE	
Appearance	scalar	*Visual	NORML	NORML	NORML	
Odor	scalar	*Visual	NORML	NORML	NORML	
Emulsified Water	scalar	*Visual	>2	NEG	NEG	
Free Water	scalar	*Visual	2	NEG	SerwiteGManage	r - ENELONRF
						Page 3 of 4



OIL ANALYSIS REPORT

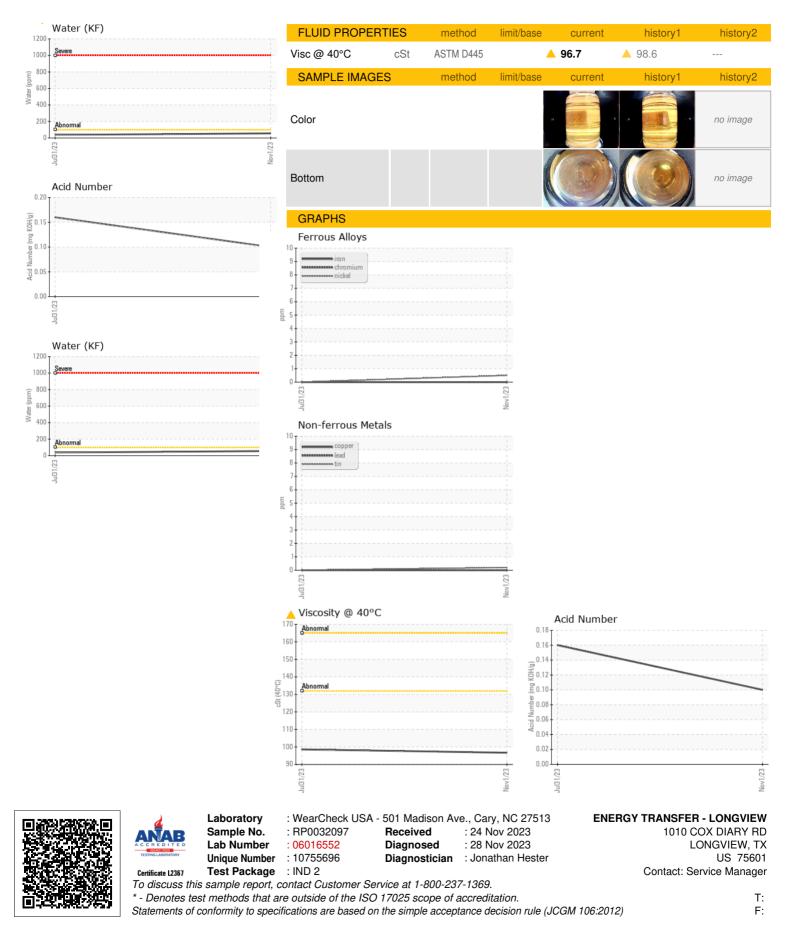

Contact/Location: Service Manager - ENELONRP