


# **OIL ANALYSIS REPORT**

# PALEXTRA 44 [17444] Machine Id SULLIVAN PALATEK 1801300001 - A-V GAUGE

Component

Compressor

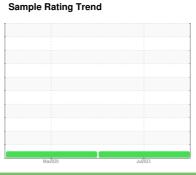



### DIAGNOSIS

## Recommendation

Resample at the next service interval to monitor.

#### Wear

All component wear rates are normal.

## Contamination

There is no indication of any contamination in the oil


# **Fluid Condition**

The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

SAMPLE INFORM	MATION	method				history2
Sample Number		Client Info		UCH06016608	UCH04927103	
Sample Date		Client Info		14 Jul 2023	03 Mar 2020	
Machine Age	hrs	Client Info		46171	13339	
Oil Age	hrs	Client Info		6500	8000	
Oil Changed		Client Info		Changed	Changed	
Sample Status				NORMAL	NORMAL	
CONTAMINATION	١	method	limit/base	current	history1	history2
Water		WC Method	>0.1	NEG	NEG	
WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>50	0	2	
Chromium	ppm	ASTM D5185m	>10	0	0	
Nickel	ppm	ASTM D5185m		<1	<1	
Titanium	ppm	ASTM D5185m		0	0	
Silver	ppm	ASTM D5185m		0	0	
Aluminum	ppm	ASTM D5185m	>25	0	<1	
Lead	ppm	ASTM D5185m	>25	0	0	
Copper	ppm	ASTM D5185m	>50	<1	<1	
Tin	ppm	ASTM D5185m	>15	<1	0	
Antimony	ppm	ASTM D5185m			0	
Vanadium	ppm	ASTM D5185m		0	0	
Cadmium	ppm	ASTM D5185m		0	0	
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m	0	0	0	
Barium	ppm	ASTM D5185m	0.3	0	1	
Molybdenum	ppm	ASTM D5185m	0	0	0	
Manganese	ppm	ASTM D5185m	0.3	0	<1	
Magnesium	ppm	ASTM D5185m	0.4	<1	0	
Calcium	ppm	ASTM D5185m	0	<1	0	
Phosphorus	ppm	ASTM D5185m	689	371	328	
Zinc	ppm	ASTM D5185m	0	0	0	
Sulfur	ppm	ASTM D5185m	1237	615	621	
CONTAMINANTS		method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>25	3	2	
Sodium	ppm	ASTM D5185m		2	3	
Potassium	ppm	ASTM D5185m	>20	<1	<1	
FLUID DEGRADA	TION	method	limit/base	current	history1	history2
Acid Number (AN)	mg KOH/g	ASTM D8045	0.135	0.15	0.084	



# **OIL ANALYSIS REPORT**

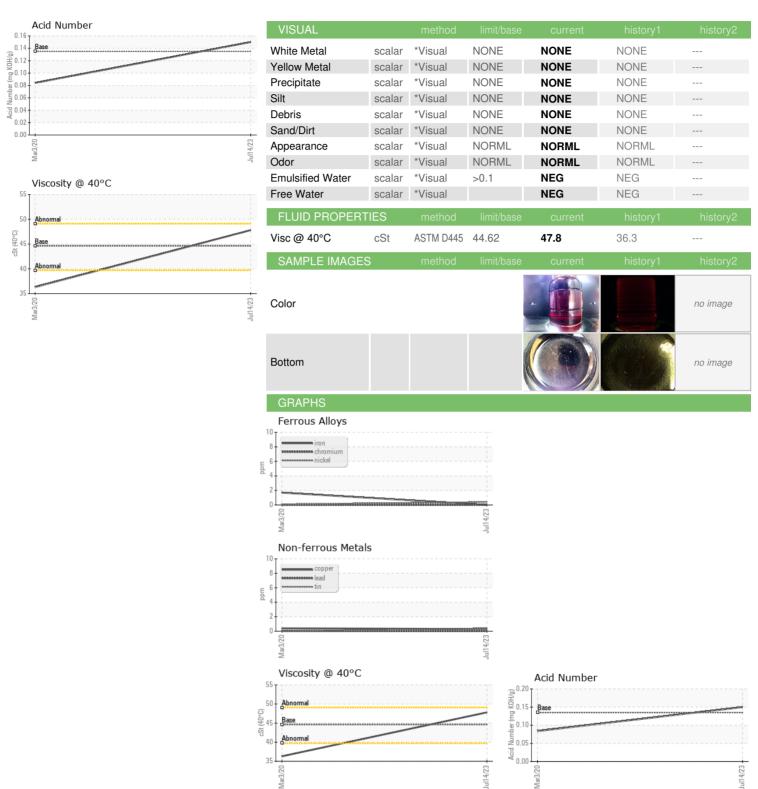





Certificate L2367

Laboratory

Sample No. Lab Number Unique Number

: 10755752 Test Package : IND 2

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 : UCH06016608 : 06016608

Diagnosed

Received : 24 Nov 2023 : 28 Nov 2023 : Jonathan Hester Diagnostician

AIR SERVICE AND PARTS INC. 2211 BUECHEL AVE LOUISVILLE, KY

US 40218 Contact: DWIGHT LOGSDON

dwight@airserviceandparts.com;canastasio@wearcheckusa.com

T: (502)239-1541 F: (502)239-7678

To discuss this sample report, contact Customer Service at 1-800-237-1369.

\* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)