

PROBLEM SUMMARY

Sample Rating Trend

VIS DEBRIS


Machine Id

KAESER ASD 30T 5719916 (S/N 1143)

Component

Compressor

KAESER SIGMA (OEM) S-460 (--- GAL)

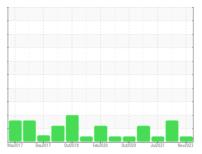



COMPONENT CONDITION SUMMARY

No relevant graphs to display

RECOMMENDATION

No corrective action is recommended at this time. The filter change at the time of sampling has been noted. Resample at the next service interval to monitor. We were unable to perform a particle count due to a high concentration of particles present in this sample.

PROBLEMATIC TEST RESULTS

Sample Status

ABNORMAL

Customer Id: STOEAS Sample No.: KC123115 Lab Number: 06017389 Test Package: IND 2



To manage this report scan the QR code

To discuss the diagnosis or test data: Jonathan Hester +1 919-379-4092 x4092 jhester@wearcheckusa.com

To change component or sample information: Customer Service +1 1-800-237-1369 customerservice@wearcheck.com

RECOMMENDED ACTIONS

Action	Status	Date	Done By	Description
Alert			?	We were unable to perform a particle count due to a high concentration of particles present in this sample.

HISTORICAL DIAGNOSIS

20 Jun 2023 Diag: Doug Bogart





No corrective action is recommended at this time. The filter change at the time of sampling has been noted. Resample at the next service interval to monitor. All component wear rates are normal. There is a high amount of particulates present in the oil. The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.



29 Jul 2021 Diag: Don Baldridge

VIS DEBRIS



No corrective action is recommended at this time. The filter change at the time of sampling has been noted. Resample at the next service interval to monitor. We were unable to perform a particle count due to a high concentration of particles present in this sample. All component wear rates are normal. Moderate concentration of visible dirt/debris present in the oil. The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.



29 Mar 2021 Diag: Jonathan Hester

ISO



Oil and filter change at the time of sampling has been noted. Resample at the next service interval to monitor. All component wear rates are normal. There is a high amount of particulates present in the oil. The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.





OIL ANALYSIS REPORT

Sample Rating Trend



Machine Id

KAESER ASD 30T 5719916 (S/N 1143)

Component

Compressor

KAESER SIGMA (OEM) S-460 (--- GAL)

DIAGNOSIS

Recommendation

No corrective action is recommended at this time. The filter change at the time of sampling has been noted. Resample at the next service interval to monitor. We were unable to perform a particle count due to a high concentration of particles present in this sample.

Wear

All component wear rates are normal.

Contamination

Moderate concentration of visible dirt/debris present in the oil.

Fluid Condition

The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

		Mar2017 [Dec2017 Oct2018	Feb 2020 Oct2020 Jul2021	Nov2023	
SAMPLE INFORM	MATION	method	limit/base	current	history1	history2
Sample Number		Client Info		KC123115	KC123112	KC92811
Sample Date		Client Info		17 Nov 2023	20 Jun 2023	29 Jul 2021
Machine Age	hrs	Client Info		13827	13063	9602
Oil Age	hrs	Client Info		0	0	738
Oil Changed		Client Info		N/A	N/A	Not Changd
Sample Status				ABNORMAL	ABNORMAL	ABNORMAL
WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>50	0	0	0
Chromium	ppm	ASTM D5185m	>10	0	0	0
Nickel	ppm	ASTM D5185m	>3	0	<1	0
Titanium	ppm	ASTM D5185m	>3	0	0	0
Silver	ppm	ASTM D5185m	>2	0	0	0
Aluminum	ppm	ASTM D5185m	>10	0	0	0
Lead	ppm	ASTM D5185m	>10	0	<1	0
Copper	ppm	ASTM D5185m	>50	9	26	8
Tin	ppm	ASTM D5185m	>10	0	0	0
Antimony	ppm	ASTM D5185m				0
Vanadium	ppm	ASTM D5185m		0	0	0
Cadmium	ppm	ASTM D5185m		0	0	0
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m		0	0	0
Barium	ppm	ASTM D5185m	90	<1	0	0
Molybdenum	ppm	ASTM D5185m		0	0	0
Manganese	ppm	ASTM D5185m		0	0	0
Magnesium	ppm	ASTM D5185m	90	44	6	45
Calcium	ppm	ASTM D5185m	2	0	0	0
Phosphorus	ppm	ASTM D5185m		0	0	9
Zinc	ppm	ASTM D5185m		158	132	49
CONTAMINANTS		method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>25	0	0	2
Sodium	ppm	ASTM D5185m		18	0	15
Potassium	ppm	ASTM D5185m	>20	5	2	6
Water	%	ASTM D6304	>0.05	0.023	0.009	0.025
ppm Water	ppm	ASTM D6304	>500	231	92.7	253.7
FLUID CLEANLIN	IESS	method	limit/base	current	history1	history2
Particles >4µm		ASTM D7647			26121	
Particles >6µm		ASTM D7647	>1300		<u>▲</u> 10498	
Particles >14µm		ASTM D7647	>80		803	
Particles >21µm		ASTM D7647	>20		<u>157</u>	
Particles >38µm		ASTM D7647	>4		2	
Particles >71µm		ASTM D7647	>3		0	
Oil Cleanliness		ISO 4406 (c)	>/17/13		<u>^</u> 22/21/17	
FLUID DEGRADA	TION	method	limit/base	current	history1	history2
		ACTM DODAE		0.20		

Acid Number (AN)

mg KOH/g ASTM D8045 0.4


0.39

0.39

0.324



OIL ANALYSIS REPORT

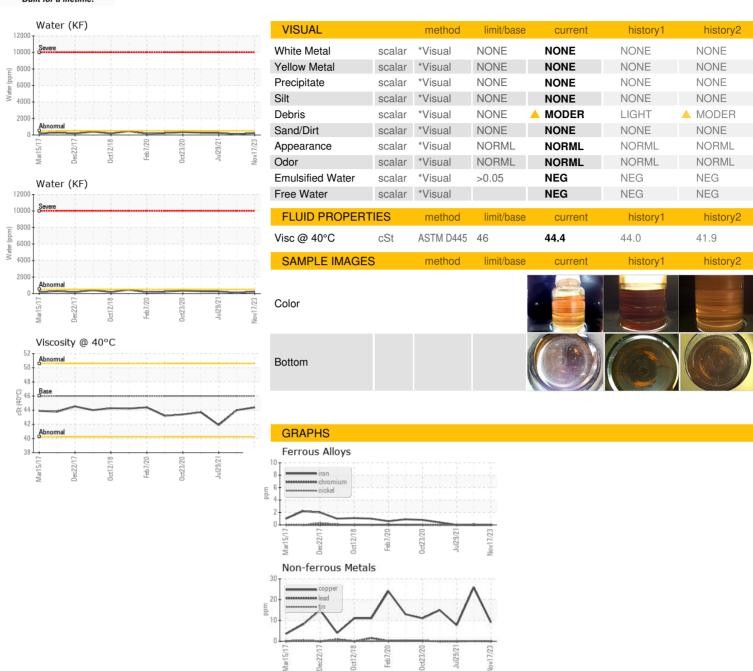





Certificate L2367

Laboratory Sample No. Lab Number **Unique Number**

Test Package : IND 2

50 (40°C)

샹

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 : KC123115 Received Diagnosed : 06017389 : 10756533

Feb7/20

: 24 Nov 2023 : 29 Nov 2023 Diagnostician : Jonathan Hester STONE PLUS DESIGN 21 RD 17 SOUTH

Acid Number

(B) 0.60 W 0.48

Ĕ 0.36 흗 0.24

₹ 0.12 0.00 kg

Nov17/23

EAST RUTHERFORD, NJ US 07073

Contact:

T: F:

To discuss this sample report, contact Customer Service at 1-800-237-1369.

* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Viscosity @ 40°C

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)