

FUEL REPORT

SAMPLE INFORMATION method

Area West Virginia [West Virginia] Diesel - #2 Port Component

Diesel Fuel

Fluid No.2 DIESEL FUEL (ULTRALOW SULPHUR) (--- GAL)

DIAGNOSIS

Recommendation

This is a baseline read-out on the submitted sample. No corrective action is recommended at this time.

Corrosion


All metal levels are normal indicating no corrosion in the system.

Contaminants

The water content is negligible. There is no indication of any contamination in the fuel.

Fuel Condition

The condition of the fuel is acceptable for the time in service.

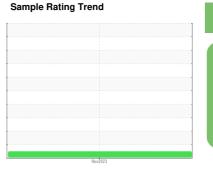





NORMAL


SAMPLE INFORM	ATION	method			riistory i	nistory2
Sample Number		Client Info		WC0846120		
Sample Date		Client Info		27 Nov 2023		
Machine Age	hrs	Client Info		0		
Sample Status				NORMAL		
PHYSICAL PROP	ERTIES	method	limit/base	current	history1	history2
Visc @ 40°C	cSt	ASTM D445	3.0	2.57		
SULFUR CONTEN	١T	method	limit/base	current	history1	history2
Sulfur	ppm	ASTM D5185m	10	0		
CONTAMINANTS		method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	<1.0	0		
Sodium	ppm	ASTM D5185m	<0.1	0		
Potassium	ppm	ASTM D5185m	<0.1	<1		
Water	%	ASTM D6304	<0.05	0.002		
ppm Water	ppm	ASTM D6304	<500	25		
HEAVY METALS		method	limit/base	current	history1	history2
Aluminum	ppm	ASTM D5185m	<0.1	2		
Nickel	ppm	ASTM D5185m	<0.1	0		
Lead	ppm	ASTM D5185m	<0.1	0		
Vanadium	ppm	ASTM D5185m	<0.1	0		
Iron	ppm	ASTM D5185m	<0.1	0		
Calcium	ppm	ASTM D5185m	<0.1	0		
Magnesium	ppm	ASTM D5185m	<0.1	0		
Phosphorus	ppm	ASTM D5185m	<0.1	0		
Zinc	ppm	ASTM D5185m	<0.1	0		
SAMPLE IMAGES	\$	method	limit/base	current	history1	history2
Color					no image	no image
Bottom					no image	no image



FUEL REPORT

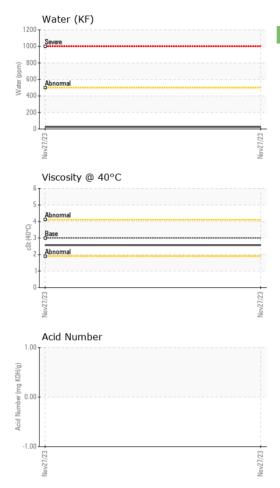

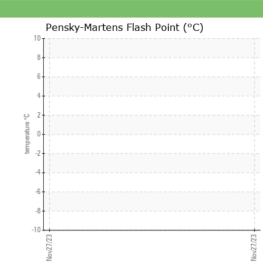

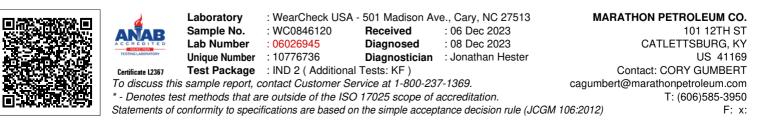

Page 2 of 2