

PROBLEM SUMMARY

Sample Rating Trend

ISO

Machine Id


KAESER AS 20 8114042 (S/N 1023)

Component

Compressor

KAESER SIGMA (OEM) M-460 (--- GAL)

COMPONENT CONDITION SUMMARY

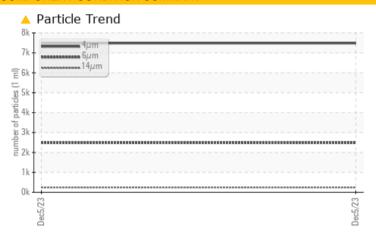

RECOMMENDATION

No corrective action is recommended at this time. The filter change at the time of sampling has been noted. Resample at the next service interval to monitor.

PROBLEMATIC TEST RESULTS									
Sample Status			ABNORMAL						
Particles >6µm	ASTM D7647	>1300	4 2478						
Particles >14µm	ASTM D7647	>80	4 242						
Particles >21µm	ASTM D7647	>20	△ 59						
Oil Cleanliness	ISO 4406 (c)	>/17/13	20/18/15						

Customer Id: VREFRE Sample No.: KC125086 Lab Number: 06027167 Test Package: IND 2



To manage this report scan the QR code

To discuss the diagnosis or test data:

Don Baldridge +1 don.b505@comcast.net

To change component or sample information: Customer Service +1 1-800-237-1369 customerservice@wearcheck.com

RECOMMENDED ACTIONS

There are no recommended actions for this sample.

HISTORICAL DIAGNOSIS




OIL ANALYSIS REPORT

KAESER AS 20 8114042 (S/N 1023)

Compressor

KAESER SIGMA (OEM) M-460 (--- GAL)

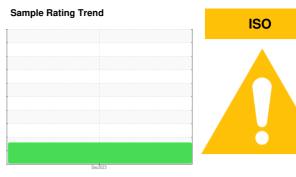

DIAGNOSIS

Recommendation

No corrective action is recommended at this time. The filter change at the time of sampling has been noted. Resample at the next service interval to monitor.

Wear

All component wear rates are normal.

Contamination

There is a high amount of particulates present in the oil.


Fluid Condition

The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

				Dec2023		
SAMPLE INFORM	MATION	method	limit/base	current	history1	history2
Sample Number		Client Info		KC125086		
Sample Date		Client Info		05 Dec 2023		
Machine Age	hrs	Client Info		8333		
Oil Age	hrs	Client Info		0		
Oil Changed		Client Info		N/A		
Sample Status				ABNORMAL		
WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>50	0		
Chromium	ppm	ASTM D5185m	>10	<1		
Nickel	ppm	ASTM D5185m	>3	0		
Titanium	ppm	ASTM D5185m	>3	0		
Silver	ppm	ASTM D5185m	>2	0		
Aluminum	ppm	ASTM D5185m	>10	2		
Lead	ppm	ASTM D5185m	>10	0		
Copper	ppm	ASTM D5185m	>50	7		
Tin	ppm	ASTM D5185m	>10	0		
Vanadium	ppm	ASTM D5185m		0		
Cadmium	ppm	ASTM D5185m		0		
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m	0	0		
Barium	ppm	ASTM D5185m	90	0		
Molybdenum	ppm	ASTM D5185m	0	<1		
Manganese	ppm	ASTM D5185m		0		
Magnesium	ppm	ASTM D5185m	100	<1		
Calcium	ppm	ASTM D5185m	0	0		
Phosphorus	ppm	ASTM D5185m	0	0		
Zinc	ppm	ASTM D5185m	0	0		
CONTAMINANTS	;	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>25	0		
Sodium	ppm	ASTM D5185m		0		
Potassium	ppm	ASTM D5185m	>20	<1		
Water	%	ASTM D6304	>0.05	0.004		
ppm Water	ppm	ASTM D6304	>500	42		
FLUID CLEANLIN	IESS	method	limit/base	current	history1	history2
Particles >4µm		ASTM D7647		7485		
Particles >6µm		ASTM D7647	>1300	<u>^</u> 2478		
Particles >14µm		ASTM D7647	>80	242		
Particles >21µm		ASTM D7647	>20	^ 59		
Particles >38µm		ASTM D7647	>4	3		
Particles >71µm		ASTM D7647	>3	0		
Oil Cleanliness		ISO 4406 (c)	>/17/13	<u>^</u> 20/18/15		
FLUID DEGRADA	ATION	method	limit/base	current	history1	history2
Acid Number (AN)	mg KOH/g	ASTM D8045	1.0	0.35		



OIL ANALYSIS REPORT

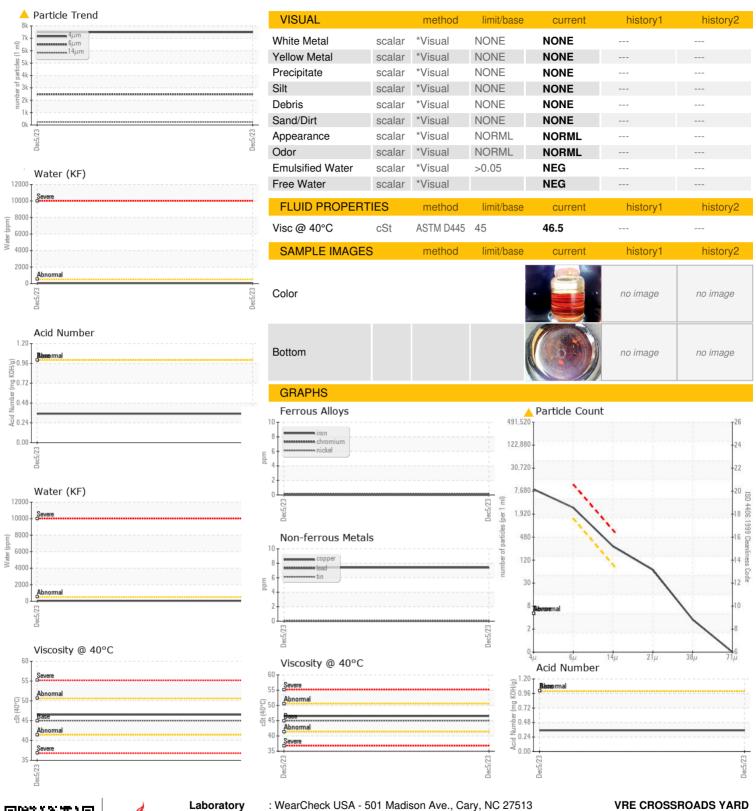





Certificate L2367

Laboratory Sample No. Lab Number **Unique Number**

: KC125086 : 06027167

: 10776958 : IND 2

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 : 06 Dec 2023 Received Diagnosed : 08 Dec 2023 : Don Baldridge Diagnostician

Test Package To discuss this sample report, contact Customer Service at 1-800-237-1369.

* - Denotes test methods that are outside of the ISO 17025 scope of accreditation. Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

9400 CROSSROADS PKWY FREDERICKSBURG, VA

US 22408 Contact: DAVID SHORES

david.shores@keolisna.com

T: F:

Contact/Location: DAVID SHORES - VREFRE